

To : P.T. Honda Prospect Motor

Report No. : APTX26124
 Issued date : 21 May 2026
 NSK Asia Pacific Technology
 Centre (Thailand) Co., Ltd.
 Approved by : T. Ikeda 5/21 T.Ikeda
 Checked by : E. Watanabe E. Watanabe
 : C. Pastraporn Pastraporn
 Prepared by : T. Theera T. Theera

Investigation Report of Returned Front Wheel Bearing from Indonesia

1. Introduction

These hub bearings were returned from Indonesian market due to abnormal noise. NSK-APTC has performed an investigation to find out the cause of trouble.

2. Investigation bearings

Country : Indonesia
 Customer part No. : 44300-T9C -T511-M1
 NSK part No. : 38BWD27R
 Filling grease : JX Nippon Oil & Energy Corporation, Pyronoc Universal N6C
 Application : Front wheel hub unit bearing
 Quantity : 4 pcs.

Vehicle information

Brg. No.	Frame No.	Engine No.	Bearing production date	Delivery date	Repaired date	Mileage (km)	Dealer (code)
1L [#]	MHRDD4730PJ301152	L15Z17381152	27/01/2018	18/12/2023	09/09/2025	61,483	Honda Dewata Motor (0411)
3L [#]	MHRDD4730PJ301221	L15Z17381221	12/11/2019	11/01/2024	06/02/2026	80,469	Honda Dewata Motor (0411)
4R [#]	MHRDD4730PJ301217	L15Z17381217	01/02/2018	11/01/2024	05/03/2026	86,338	Honda Dewata Motor (0411)
5R [#]	MHRDD4730PJ301185	L15Z17381185	12/11/2019	18/12/2023	31/03/2026	87,173	Honda Dewata Motor (0411)

Remark : L = Left wheel side, R = Right wheel side.

: # This bearing might not be returned from this vehicle due to bearing production date is too difference from car delivery date.

3. Investigation items

1. Dimension and characteristic check : Page 2
2. Condition as received and grease condition : Page 3 - 6
3. Bearing raceways and parts condition : Page 3 - 6
4. Roundness : Page 7
5. Grease spectrum (FTIR) : Page 8

4. Investigation result

Group	Bearing No.	Bearing condition	Possible cause	Quantity
D	1L, 3L, 4R and 5R	Flaking was found on raceway. Also moisture content in grease was high.	Water penetration	4

Remark : L = Left wheel side, R = Right wheel side.

Result of investigation and analysis of each category is shown in following pages 2 - 8.

5. Summary



- Group D, 4 bearings : Bearing No. 1L, 3L, 4R and 5R.
 : Flaking was found on raceway. Hence the vehicle noise was caused by this failure. Also high moisture content in grease was found.
 This type of flaking is typically generated by water penetration.

Bearing inspection data

Item		Spec. of new bearing	Bearing No.			
			1L	3L	4R	5R
Bearing and parts condition						
Condition as received [Assembled condition]		-	- Bearing was returned in complete condition. - Outboard seal out of position from dismounting process was found since received. - Rough hand rotating feeling was found.	- Bearing was returned in complete condition. - Rough hand rotating feeling was found.	- Bearing was returned in complete condition. - Rough hand rotating feeling was found.	- Bearing was returned in complete condition. - Outboard seal out of position from dismounting process was found since received. - Rough hand rotating feeling was found.
Bearing internal condition after disassembled 	Inboard	-	Grease color had changed.	Grease color had changed.	Grease color had changed.	Grease color had changed.
	Outboard	-	Grease color had changed.	Grease color had changed.	Grease color had changed.	Grease color had changed.
Outer ring raceway condition	Inboard	-	No abnormality	Indentation	Flaking	Indentation
	Outboard	-	Indentation	No abnormality	Flaking	No abnormality
Inner ring raceway condition	Inboard	-	No abnormality	Flaking	Flaking	Flaking
	Outboard	-	Flaking	No abnormality	Flaking	No abnormality
Balls condition	Inboard	-	No abnormality	Indentation	Indentation	Indentation
	Outboard	-	Indentation	No abnormality	Indentation	No abnormality
Sound pressure(dB) After wash @ 1500 rpm	Inboard	-	61	77	81	81
	Outboard	-	83	64	86	60
Bearing Dimension						
Outer ring outside diameter (mm)		Ø74 -0.013 ~ 0	-0.004	-0.007	-0.008	-0.005
Inner ring bore diameter (mm)	Inboard	Ø 38 -0.032 ~ -0.020	-0.021	-0.022	-0.023	-0.021
	Outboard		-0.015 *1	-0.023	-0.021	-0.024
Width outer ring (mm)		40 -0.060 ~ 0	-0.028	-0.038	-0.027	-0.023
Width inner ring (mm)	Inboard	20 -0.060 ~ 0	-0.045	-0.026	-0.026	-0.019
	Outboard		-0.037	-0.027	-0.024	-0.031
Axial clearance (µm)		65 ~ 85	_ *2	_ *2	_ *2	_ *2
Grease Condition						
Grease remain (%)		30% - 40%	32.9	33.3	35.0	35.2
Grease spectrum [FTIR]		-	No abnormality	No abnormality	No abnormality	No abnormality
Moisture content in grease (%wt)	Inboard	-	0.03	0.12	0.07	0.08
	Outboard	-	0.49	0.04	0.53	0.19
Hardness (HRC)						
Outer ring		HRC 60 ~ 64	63.1	62.9	62.8	62.9
Inner ring [Inboard / Outboard]		HRC 60 ~ 64	62.8 / 63.1	62.5 / 62.5	62.6 / 62.5	62.6 / 61.9
Ball [Inboard / Outboard]		HRC 61 ~ 66	64.2 / 65.4	64.2 / 64.3	64.5 / 64.7	64.0 / 64.6

Remark : *1 Over specification was probably caused by usage.

: *2 Cannot be measured due to flaking.

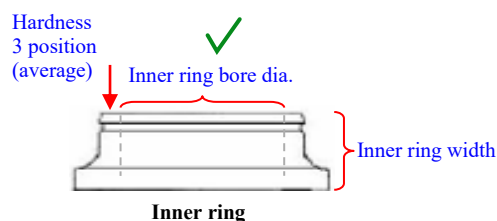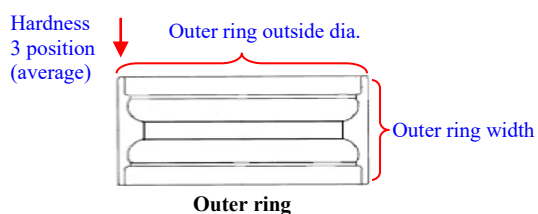

Photos of bearing No. 1L



Condition as received : Inboard
Bearing was returned in complete condition.
Smooth hand rotating feeling was found.



Condition as received : Outboard
Bearing was returned in complete condition.
Seal out of position from dismounting process was found since received.
Rough hand rotating feeling was found.



Internal condition : Inboard
Grease color had changed but base oil remained enough.



Internal condition : Outboard
Grease color had changed but base oil remained enough.



Outer ring condition : Inboard
No abnormality was found.



Outer ring condition : Outboard
Indentation was found on raceway.



Inner ring condition : Inboard
No abnormality was found.



Inner ring condition : Outboard
Flaking was found on raceway.



Balls and cage condition : Inboard
No abnormality was found.



Balls and cage condition : Outboard
Indentation was found on balls surface.
Breakage was found on cage.



Seal and encoder condition : Inboard
No abnormality was found on seal lip and encoder.
(Seal deformation from dismounting process was found.)



Seal condition : Outboard
No abnormality was found on seal lip.
(Seal deformation from dismounting process was found.)

Photos of bearing No. 3L



Condition as received : Inboard
Bearing was returned in complete condition.
Rough hand rotating feeling was found.




Condition as received : Outboard
Bearing was returned in complete condition.
Smooth hand rotating feeling was found.



Internal condition : Inboard
Grease color had changed but base oil remained enough.



Internal condition : Outboard
Grease color had changed but base oil remained enough.

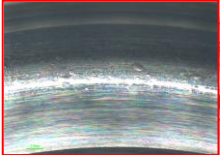

Outer ring condition : Inboard
Indentation was found on raceway.



Outer ring condition : Outboard
No abnormality was found.



Inner ring condition : Inboard
Flaking was found on raceway.



Inner ring condition : Outboard
No abnormality was found.



Balls and cage condition : Inboard
Indentation was found on balls surface.
Breakage was found on cage.



Balls and cage condition : Outboard
No abnormality was found.



Seal and encoder condition : Inboard
No abnormality was found on seal lip and encoder.
(Seal deformation from dismounting process was found.)



Seal condition : Outboard
No abnormality was found on seal lip.
(Seal deformation from dismounting process was found.)

Photos of bearing No. 4R



Condition as received : Inboard
Bearing was returned in complete condition.
Rough hand rotating feeling was found.



Internal condition : Inboard
Grease color had changed but base oil remained enough.



Outer ring condition : Inboard
Flaking was found on raceway.



Inner ring condition : Inboard
Flaking was found on raceway.



Balls and cage condition : Inboard
Indentation was found on balls surface.
No abnormality was found on cage.



Seal and encoder condition : Inboard
No abnormality was found on seal lip and encoder.
(Seal deformation from dismounting process was found.)



Condition as received : Outboard
Bearing was returned in complete condition.
Rough hand rotating feeling was found.



Internal condition : Outboard
Grease color had changed but base oil remained enough.



Outer ring condition : Outboard
Flaking was found on raceway.



Inner ring condition : Outboard
Flaking was found on raceway.



Balls and cage condition : Outboard
Indentation was found on balls surface.
No abnormality was found on cage.



Seal condition : Outboard
No abnormality was found on seal lip.
(Seal deformation from dismounting process was found.)

Photos of bearing No. 5R



Condition as received : Inboard
Bearing was returned in complete condition.
Rough hand rotating feeling was found.




Condition as received : Outboard
Bearing was returned in complete condition.
Seal out of position from dismounting process was found since received.
Smooth hand rotating feeling was found.



Internal condition : Inboard
Grease color had changed but base oil remained enough.



Internal condition : Outboard
Grease color had changed but base oil remained enough.

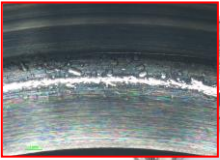

Outer ring condition : Inboard
Indentation was found on raceway.



Outer ring condition : Outboard
No abnormality was found.



Inner ring condition : Inboard
Flaking was found on raceway.



Inner ring condition : Outboard
No abnormality was found.



Balls and cage condition : Inboard
Indentation was found on balls surface.
Breakage was found on cage.



Balls and cage condition : Outboard
No abnormality was found.




Seal and encoder condition : Inboard
No abnormality was found on seal lip and encoder.
(Seal deformation from dismounting process was found.)




Seal condition : Outboard
No abnormality was found on seal lip.
(Seal deformation from dismounting process was found.)

Roundness of bearing

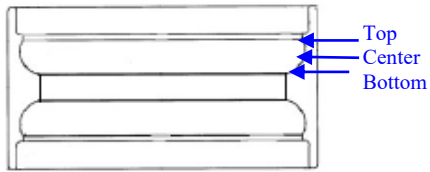

Outer ring




Inner ring

Bearing No. 1L			
Roundness: 1L A IB: 1.624µm Outer ring inboard side Roundness : 1.0 µm	Roundness: 1L A OB: 2.410µm Outer ring outboard side Roundness : 2.4 µm	Roundness: 1L B IB: 0.480µm Inner ring inboard side Roundness : 0.5 µm	Cannot be measured due to flaking. Inner ring outboard side Roundness : - µm
Bearing No. 3L			
Roundness: 3L A IB: 1.920µm Outer ring inboard side Roundness : 1.9 µm	Roundness: 3L A OB: 1.385µm Outer ring outboard side Roundness : 1.4 µm	Cannot be measured due to flaking. Inner ring inboard side Roundness : - µm	Roundness: 3L B OB: 0.361µm Inner ring outboard side Roundness : 0.4 µm
Bearing No. 4R			
Cannot be measured due to flaking. Outer ring inboard side Roundness : - µm	Cannot be measured due to flaking. Outer ring outboard side Roundness : - µm	Cannot be measured due to flaking. Inner ring inboard side Roundness : - µm	Cannot be measured due to flaking. Inner ring outboard side Roundness : - µm
Bearing No. 5R			
Roundness: 5R A IB: 1.529µm Outer ring inboard side Roundness : 1.5 µm	Roundness: 5R A OB: 1.037µm Outer ring outboard side Roundness : 1.0 µm	Cannot be measured due to flaking. Inner ring inboard side Roundness : - µm	Roundness: 5R B OB: 0.632µm Inner ring outboard side Roundness : 0.6 µm


- Indentation was found on bearing No. 1L, 3L and 5R.

Grease spectrum result [FTIR Analysis]

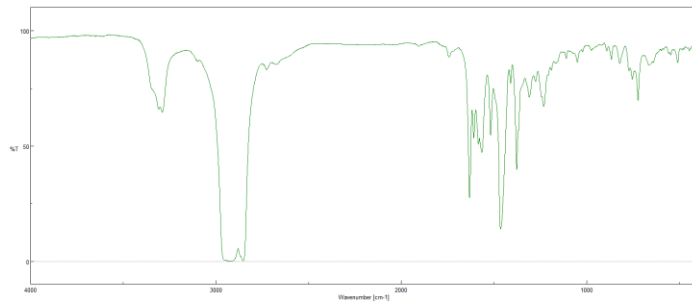


Spectrum of new JX Nippon Oil & Energy, Pyronoc Universal N6C grease

Bearing No. 1L

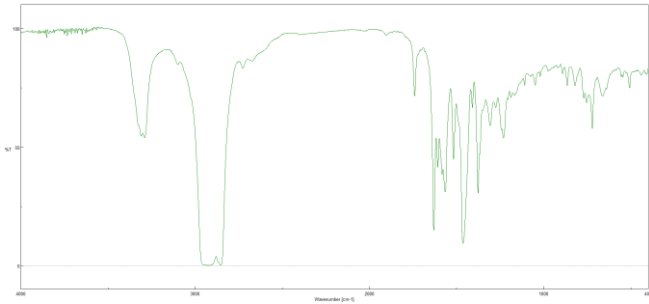


Spectrum of grease sample from inboard side.

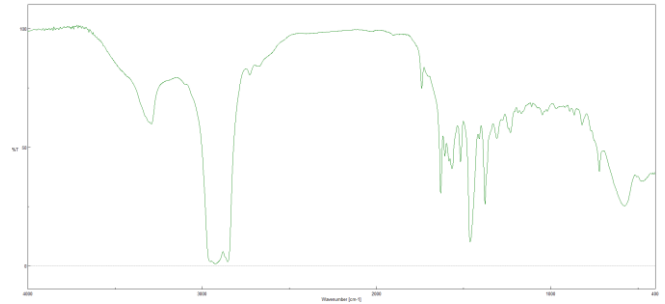


Spectrum of grease sample from outboard side.

Bearing No. 3L

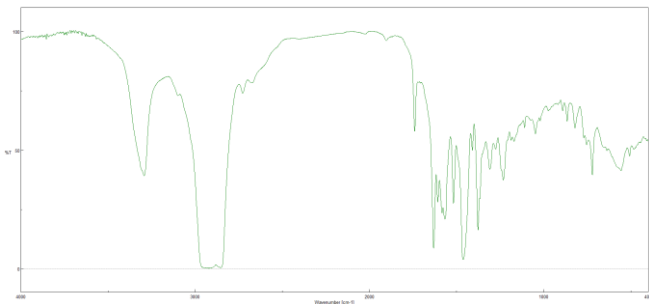


Spectrum of grease sample from inboard side.

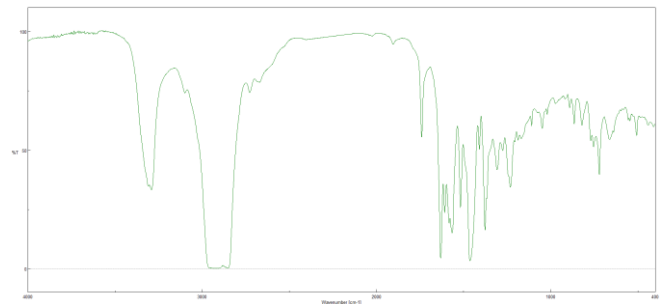


Spectrum of grease sample from outboard side.

Bearing No. 4R

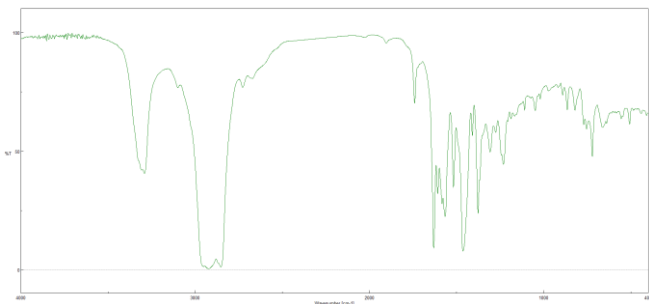


Spectrum of grease sample from inboard side.

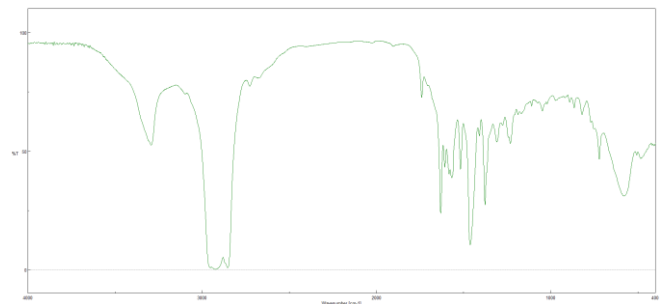


Spectrum of grease sample from outboard side.

Bearing No. 5R

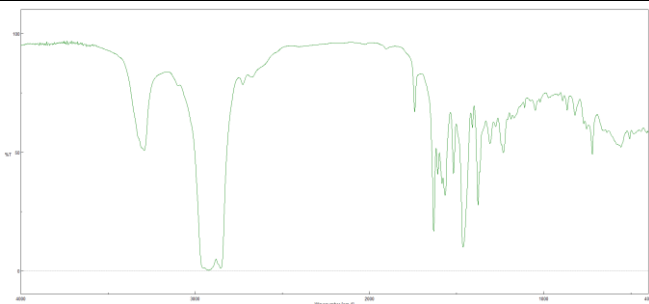

Spectrum of grease sample from inboard side.

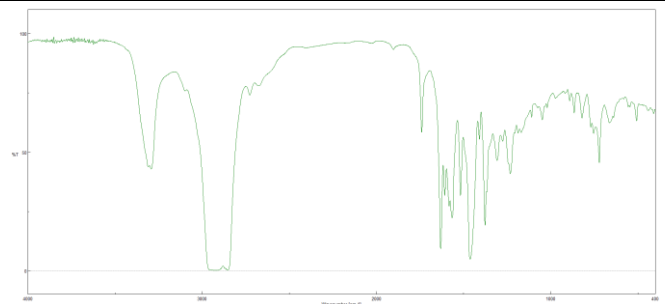

Spectrum of grease sample from outboard side.

- No abnormality was found.

HUB I BWD Investigation record

Investigate information:

Received date : 8/5/2026	Order info./ Ticket No. : C2T-26022126	Customer : HPM	Report No. : APTX 26124
Bearing model : 38BWD27R	Vehicle : MOBILIO	Quantity : A pcs.	

Item			New bearing	Equipment No. / Date	1L	3L	4R	5R
Bearing production date			-	-	CA24C2 27 Jan 18	DL12A1 12 Nov 19	CB01B1 01 Feb 18	DL12A1 12 Nov 19
Bearing rotating by hand			-	-	Smooth / rough	rough / smooth	rough / rough	rough / smooth
Bearing condition as received	Inboard	-	-	✓	✓	✓	✓	
	Outboard	-	-	✓	✓	✓	✓	
ABS signal or magnetic powder check			-	-	✓	- ✓	- ✓	- ✓
Bearing internal condition after disassembled	Inboard	-	-	NA	FL	FL	FL	
	Outboard	-	-	FL	NA	FL	NA	
Weight Before washing (g)			-	INV-BA-02 8/5/2026	686.14	687.27	688.32	687.72
Weight After washing (g)			-	↑	680.81	679.85	680.54	679.88
Outer ring	Raceway	Inboard	-	CCD 12/05/2026	NA ✓	IN ✓	FL	IN ✓
		Outboard	-	↑	IN ✓	NA ✓	FL	NA ✓
	Fitting surface	Inboard	-	↑	NA	NA	NA	NA
		Outboard	-	↑	NA	NA	NA	NA
Inner ring	Raceway	Inboard	-	↑	NA ✓	FL	FL	FL
		Outboard	-	↑	FL	NA ✓	FL	NA ✓
	Fitting surface	Inboard	-	↑	r	NA	NA	NA
		Outboard	-	↑	NA	NA	NA	NA
Balls condition		Inboard	-	↑	SC NA	SC IN	IN	IN
		Outboard	-	↑	IN	SC NA	IN	SC
Cage condition		Inboard	-	↑	NA	x Broken	NA	x Broken
		Outboard	-	↑	y Broken	NA	NA	NA
Seal, slinger or encoder condition		Inboard	-	↑	NA	NA	NA	NA
		Outboard	-	↑	y NA (seal Terry)	NA	NA	NA
Outer ring outside diameter			Ø 74	INV-DM-03 12/05/2026	-51/-4/-4 -4	-6/-8/-8 -7	-8/-8/-8 -8	-4/-6/-5 -5
Inner ring bore diameter (mm)		Inboard	Ø 36	INV-BG-04 12/05/2026	-21/-21/-22 -21	-16/-14/-15 -22	-24/-23/-23 -23	-20/-22/-22 -21
		Outboard		INV-BG-04 12/05/2026	-16/-14/-15 -15	-23/-24/-23 -23	-21/-20/-22 -21	-24/-24/-25 -24
Width outer ring (mm)			Ø 40	INV-DD-02 12/05/2026	-31/-30/-24 -22	-36/-38/-39 -38	-28/-29/-25 -29	-24/-23/-23 -23
Width inner ring (mm)		Inboard	Ø 20	INV-DD-02 12/05/2026	-44/-46/-45 -45	-23/-27/-28 -26	-26/-27/-26 -26	-20/-16/-21 -19
		Outboard		INV-DD-02 12/05/2026	-31/-38/-35 -37	-25/-27/-28 -27	-22/-23/-27 -24	-29/-33/-32 -31

HUB I BWD Investigation record

Investigate information:

Item		New bearing	Equipment No. / Date	1L	3L	4R	5R
Axial clearance (mm)			—	—*	—*	—*	—*
Grease remain (g)			—	7.33 32.9%	7.42 33.3%	7.78 35.0%	7.84 35.2%
Roundness outer ring (μm)	Inboard	-	INV-RT-01 12/05/2026	1.0	1.9	—*	1.5
	Outboard	-	↑	2.4	1.4	—*	1.0
Roundness inner ring (μm)	Inboard	-	↑	0.5	—*	—*	—*
	Outboard	-	↑	—*	0.4	—*	0.6
Grease spectrum [FTIR]	Inboard	-	INV-FT-01 12/05/2026	NA	NA (WA)	NA	NA
	Outboard	-	↑	NA (WA)	NA	NA (WA)	NA
Moisture content in grease (% wt)	Inboard	-	INV-WA-01 12/05/2026	0.03%	0.12%	0.07%	0.08%
	Outboard	-	↑	0.49%	0.04%	0.53%	0.19%
Sound pressure(dB)	Inboard	-	INV-SC02 12/05/2026	61.2	77.1	81.0	80.8
	Outboard	-	↑	83.4	64.3	85.7	60.1
Outer ring [HRC]			INV-HR-01 12/05/2026	63.1 / 63.1 / 63.1 63.1	62.9 / 62.9 / 62.8 62.9	62.8 / 62.8 / 62.9 62.8	62.9 / 62.9 / 63.0 62.9
Inner ring [HRC] [Inboard / Outboard]			↑	62.8 in 63.0 out 62.6 62.8 / 63.1 63.2 62.9 63.0	62.4 in 62.6 out 62.1 62.5 / 62.5 62.2 62.6 62.6 62.7	62.6 in 62.3 out 62.6 62.6 / 62.5 62.6 62.7 62.6 62.5	62.4 in 61.5 out 62.6 62.6 / 61.9 62.0 62.6 62.6 62.2
Balls [HRC] [Inboard / Outboard]			↑	62.5 in 63.1 out 62.6 63.4 62.0 62.7	62.5 in 62.6 out 62.1 62.1 62.6 62.7	62.4 in 63.6 out 62.4 62.6 62.9 62.6	61.5 in 62.9 out 62.5 62.5 62.7 62.7

64.3 65.5 64.3 64.4 64.2 65.4 63.3 64.7
 64.4 65.2 63.9 64.0 64.4 64.4 64.3 64.6
 63.9 65.5 64.4 64.5 64.4 64.4 64.5 64.5
 64.2 65.4 64.2 64.3 64.5 64.7 64.0 64.6

1L

Kartu Identifikasi Suku Cadang

September

psu



Nama Dealer : 0411-Honda Dewata Motor

No. Polisi : DK1396FBX

No. DWR : 411-2509-0018-DD4

Nama Suku Cadang : BRG ASSY_FR HUB

No. Suku Cadang : 44300-T9C-T51

Model : MOBILIO

No. Rangka : MHRDD4730PJ301152

No. Mesin : L15Z17381152

Odometer (KM) : 61,483

Tgl Garansi : 18 Dec 2023

Tgl Kerusakan : 09 Sep 2025

Tgl Mulai Perbaikan : 11 Sep 2025

Tgl Selesai Perbaikan : 11 Sep 2025

Tgl Siap Kirim Part : 12 Sep 2025

Pengaduan Pelanggan :

CEK BUNYI MENDENGUNG PADA RODA DEPAN KIRI

Analisa & Langkah Perbaikan :

SETELAH MELAKUKAN PENGECEKAN DENGAN CARA MEMEGANG SUSPensi DAN MEMUTAR RODA DEPAN KIRI DIDAPATKAN KERUSAKAN PADA LAGHER RODA DEPAN KIRI GANTI

HPM USED :

PEMOHON MQ

Tgl HPM Kirim ke DLR :

Tgl Terima ke HPM :

Tgl Terima ke MQ :

Qty Part / Ttl Part Minta : 1 / 1

Kode Barcode : BRC4112509-0051

3L**Kartu Identifikasi Suku Cadang**

February



Nama Dealer : 0411-Honda Dewata Motor
No. Polisi : DK1664FBX
No. DWR : 411-2602-0005-DD4
Nama Suku Cadang : BRG ASSY_FR-HUB
No. Suku Cadang : 44300-T9C-T51
Model : MOBILIO
No. Rangka : MHRDD4730PJ301221
No. Mesin : L15Z17381221
Odometer (KM) : 80,469
Tgl Garansi : 11 Jan 2024
Tgl Kerusakan : 06 Feb 2026
Tgl Mulai Perbaikan : 06 Feb 2026
Tgl Selesai Perbaikan : 09 Feb 2026
Tgl Siap Kirim Part : 12 Feb 2026

Pengaduan Pelanggan :

CEK SAAT BERKENDARA ADA BUNYI
MENDENGUNG DAN BUNYI TERDENGAR DI
DEPAN KIRI

Analisa & Langkah Perbaikan :

SETELAH DI LAKUKAN PENGECEKAN DENGAN
MEMUTAR RODA DAN MEMEGANG SHOCK
BEKER DEPAN KIRI DI DAPATKAN BUNYI DARI
BEARING RODA DEPAN KIRI DAN DI LAKUKAN

HPM USED :**PEMOHON MQ**

Tgl HPM Kirim ke DLR :

Tgl Terima ke HPM :

Tgl Terima ke MQ :

Qty Part / Ttl Part Minta : 1 / 1

Kode Barcode : BRC4112602-0013

4

4R

Kartu Identifikasi Suku Cadang

March



Nama Dealer : 0411-Honda Dewata Motor
No. Polisi : DK1652FBX
No. DWR : 411-2603-0003-DD4
Nama Suku Cadang : BRG ASSY,HUB
No. Suku Cadang : 44300-TF0-951
Model : MOBILIO
No. Rangka : MHRDD4730PJ301217
No. Mesin : L15Z17381217
Odometer (KM) : 86,338
Tgl Garansi : 11 Jan 2024
Tgl Kerusakan : 05 Mar 2026
Tgl Mulai Perbaikan : 05 Mar 2026
Tgl Selesai Perbaikan : 05 Mar 2026
Tgl Siap Kirim Part : 07 Mar 2026

Pengaduan Pelanggan :

ADA BUNYI ABNORMAL SAAT JALAN
TERDENGAR DI RODA DEPAN KANAN

Analisa & Langkah Perbaikan :

SETELAH MELAKUKAN PENGECEKAN BUNYI
DENGAN CARA MEMEGANG SUSPensi DAN
MEMUTAR RODA DEPAN KANAN DI TEMUKAN
BUNYI BERASAL DARI LAGHER RODA DEPAN

HPM USED :

PEMOHON MQ

Tgl HPM Kirim ke DLR :

Tgl Terima ke HPM :

Tgl Terima ke MQ :

Qty Part / Ttl Part Minta : 1 / 1

Kode Barcode : BRC4112603-0010



Kartu Identifikasi Suku Cadang

March



Nama Dealer : 0411-Honda Dewata Motor
No. Polisi : DK1435FBX
No. DWR : 411-2603-0019-DD4
Nama Suku Cadang : BRG ASSY_FR HUB
No. Suku Cadang : 44300-T9C-T51
Model : MOBILIO
No. Rangka : MHRDD4730PJ301185
No. Mesin : L15Z17381185
Odometer (KM) : 87,173
Tgl Garansi : 18 Dec 2023
Tgl Kerusakan : 31 Mar 2026
Tgl Mulai Perbaikan : 31 Mar 2026
Tgl Selesai Perbaikan : 31 Mar 2026
Tgl Siap Kirim Part : 01 Apr 2026

Pengaduan Pelanggan :

CEK BUNYI MENDENGUNG SAAT JALAN
TERDENGAR DI RODA DEPAN

Analisa & Langkah Perbaikan :

SETELAH MELAKUKAN PENGECEKAN BUNYI DI
RODA DEPAN KANAN DENGAN MEMEGANG
SUSPENSI DAN MEMUTAR RODANYA
TERDITEKSI KERUSAKAN DI LAGHER RODA

HPM USED :

PEMOHON MQ

Tgl HPM Kirim ke DLR :

Tgl Terima ke HPM :

Tgl Terima ke MQ :

Qty Part / Ttl Part Minta : 1 / 1

Kode Barcode : BRC4112603-0045

Opportunity Project - Sub-Project - Ticket

Ticket

HPM-HUB Bearing Market Claim Request Investigation Report

+ Follow

Attach Deliverables

Response

Submit for Approval

Ticket Close

Create Child Ticket

Opportunity Project

HPM Warranty Investigation (/lightning/r/ECM_Project...)

Sub-Project

After-Sales Management - HPM HUB Warranty Investigation (/lightning/r/ECM_Project...)

Data Clas...

RESTRICTED

P...

Requester

Alfy Sukma Alfy(Sukma Alfy) (/lightning/r/User/005J20...

Owner

A1_[APTC]HUB Bearings

Details

Ticket Information

Ticket name	HPM-HUB Bearing Market Claim Request Investigation Report	Owner	A1_[APTC]HUB Bearings
Ticket No.	CZT-26022126	Person in Charge(Se t after Reception)	ไชยลังกา พัสดรากรณ(Chailungka Pastraporn) (/lightning/r/User/005J2000000Mg3LIA S/view).
Ticket Category	Investigation	Person 2 in Charge(Se t after Reception)	
Request Category	Abnormality Investigation(with Quality Risks)	Person 3 in Charge(Se t after Reception)	
Contact Dept.		Ticket Status	In Progress
		Expected Ticket Close Date	22/5/2569
		Due Date of Tech Dept.	22/5/2569
		Due Date of Product Completion	
		Due Date of Product Delivery	
		Request/R esponse Status	Requested

Opportunity Project

Customer	I21300: PT HONDA PROSPECT MOTOR (/001J2000008C9oI).	Product Category	Automotive Components
Opportuni ty Project	HPM Warranty Investigation (/lightning/r/ECM_Project...c/a0sQ800000RO0NVIA1vi ew).	Project Industry	Automotive
Sub-Project	After-Sales Management - HPM HUB Warranty Investigation (/lightning/r/ECM_Project...c/a0sQ800000Res8cIAB/vie w).	Applicatio n 1	
		Applicatio n 2	
		Applicatio n 3	

Request Information

Requester	Alfy Sukma Alfy(Sukma Alfy) (/lightning/r/User/005J2000000MgfyIAC/view).	To Dept./Gro up	A1_[APTC]HUB Bearings
Requester Dept.	IDJK_IDN_[JK-NSK]	Comments by Approver	
Requester Region	AO		
Request Datetime	4/5/2569 14:04		

Child Ticket (/lightning/cmp/force_dynamicRelatedListViewAll?force_flexipageId=ECM_TicketPage&force_cmpld=lst_dynamicRelatedList2&fc...

Deliverables

File (0)

0 of 0 items

Title	Download	File Extens...	Owner	Last Modif...
No items to display.				

Attachments To Ticket

Upload Files Or drop files

File (0)

1 of 1 item

Title	Download	File Extens...	Owner	Last Modif...
Apr 2026 (/lightning/page/filePreview?selectedRecordId=069Q8000011D WU1).	Download (/sfc/servlet.shep herd/version/do wnload/068Q800 00150umn).	xlsx	Alfy Sukma Alfy(Sukma Alfy) (/lightning/r/User /005J2000000Mg fy/view).	4/5/2569 13:49

Approval History

Approval History (2) (/lightning/r/a0vQ800001CK401IAD/related/ProcessSteps/view)

2 items • Sorted by Is Pending • Updated 4 นาทีที่แล้ว

Step Name	Date	Status	Assigned To	Actua
承認/Approval (...)	4/5/2569 14:04	Approved	Edwin Saleh (/li...	Edwin
Approval Requ...	4/5/2569 13:49	Submitted	Alfy Sukma Alfy(...)	Alfy S

View All (/lightning/r/ECM_Ticket...c/a0vQ800001CK401IAD/related/ProcessSteps/view)

Chatter

<Notes on Chatter>
- @mentions cannot be copied and pasted. Pasted texts will no longer function as an active @mention.
- Users without access to this page cannot be @mentioned and will not receive any notifications.
 - When you try to @mention such users, a warning message will appear, and the @mention will be displayed in gray after posting.
- Even if you @mention a Group, the members without access to this page will not be notified.

Approver [Edwin Saleh \(/lightning/r/User/005/2000000MgfvIAC/view/\)](#)

Request Details

Request Details

Dear [APTC]Team,

[Background]
JK-NSK received Market/Warranty Hub Bearing Claim from PT. HONDA PROSPECT MOTOR Period of Apr , 2026.
Request for Investigation Report.

Please find below information ;
[1]
NSK PN : 38BWD27RCA75**SA**LFE N6CS
[Cust.PN \(https://cust.pn/\)](#): 44300-T9C-T51
Problem : Noise
Qty defect : 4 pcs

The defect BRG (4 Pcs) delivered to APTC-Thai

According to above info and claim JK-NSK Request :
1. Please support to check and make summary of part claim bearing condition :
a. Appearance
b. Noise
c. Inner side observation
d. Roundness inner ring and outer ring
e. Cage condition
f. ect.

2. Please investigate/analyst this problems and make judgment for the cause (conclusion).

3. Due date : 22-Apr, 2026 (send by email : alfy@nsk.com)

For more info, please don't hesitate to ask.
Thank you for your attention and fully support.

Best Regards,
Alfi

Project Background

Opportunity Background

*The use of the following template is recommended for NPDS Rank Decisions to be more efficient and accurate.
*You can delete it as necessary, such as when NPDS Rank Decisions are not required for.
*This template is subject to further revisions as part of COMETS improvements.

<Background of This Project>
*Please describe the background information of this Project.

<Overview of expected NSK PNs and Their Production Sites>
*Please indicate the NSK PNs and their production sites expected at the time of creating this Opportunity Project.
*Creation of Specification Forms is anticipated for more details as necessary.

<Overview of Expected Conditions of Use>
*Please indicate the expected conditions of use at the time of creating this Opportunity Project.
*Creation of Customer Requirements is anticipated for more details as necessary.

<Other Remarks>
*Please add comments or information relevant to this Opportunity Project.
*You can add paragraphs or sections as necessary.

Requirements & Specifications

Customer Requirement

Specification Form

NSK Part No.
(Temporarily)

Specification Form 2

NSK Part No.
(Temporarily) 2

Post

Share an update...

Share

Sort by:

Most Recent Activity

Search this feed...



Collaborate here!

Here's where you start talking with your colleagues about this record.

Specificati on Form 3	NSK Part No. (Temporar y) 3		
Specificati on Form 4	NSK Part No. (Temporar y) 4		
Specificati on Form 5	NSK Part No. (Temporar y) 5		
▼ Response Information			
Responde nt	Response Datetime		
Response Dept.			
▼ Response Contents			
Response			
▼ Notes By Department			
Notes by Sales Dept.			
Notes by Tech Dept.			
Notes by Plant			
▼ System			
Created By	Alfy Sukma Alfy(Sukma Alfy). ./lightning/r/User/005J2000000MgfylAC/view). 4/5/2569 13:43	Last Modified By (User)	Alfy Sukma Alfy(Sukma Alfy). ./lightning/r/User/005J2000000MgfylAC/view).
Opportuni ty Project shared regions	XAO	Last Modified Date (User)	11/5/2569 14:19
Access Provided To(Inter- Corporate)			