AIRBUS OPERATIONS · FTO2 / OLME · NC REVIEW · SEPTEMBER 2026


FTO2 NC Findings

Can we tag cable NCs?

● **Yes: 178 of 183 match**

Tracker fixes: remove 9 rows · fix 2 NC numbers · add 5 line NCs.

Tracker vs our cable tag, FTO2 extract (S01–S37)

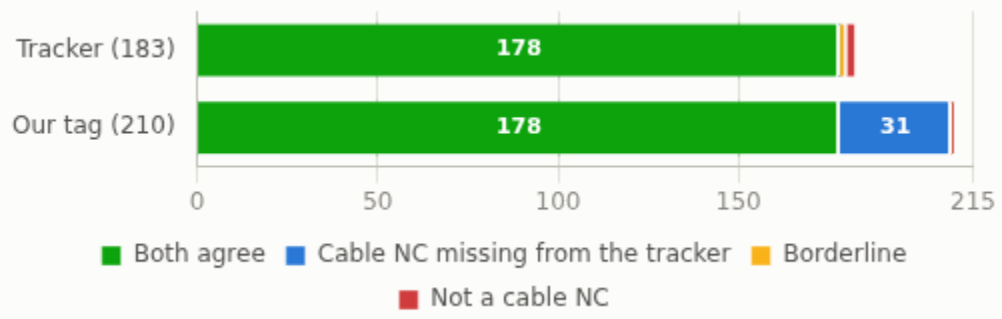

Cable NC = every defect in the NC is a cable defect.

The 6 NCs where someone is wrong

NC	WHAT IT IS	WRONG
216180778	Deformed rail (VT strip)	● Tracker
216958965	Non-conforming label plates	● Tracker
216931839	Number points to a ramp NC	● Tracker
216294895	Auto-soudeurs misplaced on 5883VB	● Borderline
216311784	Same, other 5883VB harness	● Borderline
218105723	Fibre too short from the support's orientation	● Our tag

31 cable NCs missing from the tracker

SAP status as of 6 July. "Not checked" = not in our files.

Line NCs to add · 5

NC	WHAT IT IS	SAP STATUS
216337073	A350 head A: 3 cables missing, supply requested	Not checked
216541701	A350: cable 4612-0370 “too short to be repaired”	Not checked
217140319	Request for the 2 BF24 cables of test NC 217055268 (same event)	Not checked
217447449	A330: cable too short after a crimping error, remake requested	Closed
218012174	A350: 2 cables cut too short, remake requested	Not checked

Same event as a tracker NC · 6

NC	WHAT IT IS	WHAT TO DO
216502898	Test NC; its cable request 216507151 is already in the tracker	Don’t add
216772989	Test NC; its cable request 216773861 is already in the tracker	Don’t add
217599035	Sampling NC for the same cable as 217601679, already in the tracker	Don’t add
217838827	Harness 4715VB, MSN 13697: the tracker row that has no NC number	Write this number in
217863110	Same 4715VB event as 217838827	Don’t add
217871420	Same 4715VB event as 217838827	Don’t add

Test-bench NCs · 20 · ask if in the tracker's scope


NC	WHAT IT IS	SAP STATUS
216074163	A330: 2 BF24 cables missing (2351-0458 / 0459)	Closed
216111281	A330: 2 BF24 cables missing (2351-0302 / 0303)	Closed
216195310	A330: 4 BF24 cables missing on 261VT	Closed
216310033	Nicked cable, “urgent, cable to change”	Not checked
216321686	Damaged quadrax cable, to order	Closed
216380858	2 cables to change (3CBB, 5CPD)	Not checked
216543752	Cable nicked at the shield termination	Not checked
216579161	Cable 3422-0293 damaged, to change	Closed
216773933	2 nicked cables (2799-0055, 2799-0073)	Not checked
216889831	Nicked cable (1608VC068A)	Not checked
216900574	Cable 3611-1593 too short after a wiring inversion	Not checked
217019027	Shunt BF24 3314-0919 missing (may not have been fitted)	Not checked
217042404	Cable 2797-1246 damaged, to change	Not checked
217054293	Damaged cable (500VT202)	Closed
217055268	2 BF24 cables missing, “not printed”; same event as 217140319	Closed
217123040	Cable damaged at the ferrule (300VT101)	Closed
217371996	Cut cable (1608VC062A)	Closed
217409137	Quadrax to change after a routing error	Not checked
218056821	Cable 3161-0860 damaged	Not checked
218069982	Shunts missing on indicator heads (may not have been fitted)	Not checked

Categories and families


8 Pareto groups · 19 categories

1 defect → 1 category (what to fix) → 1 Pareto group (what happened). Category blind check: 90% agreement.

Old "Workmanship" (821 defects), by new category

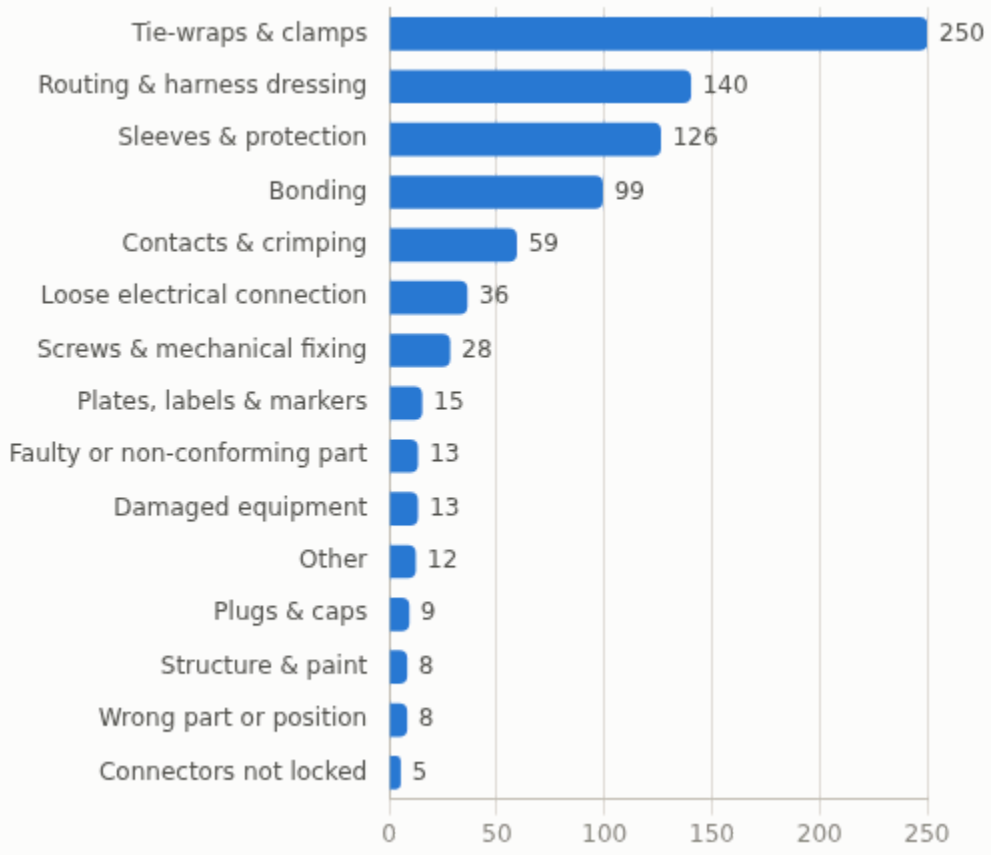

Old "Installation" (336 defects), by new category

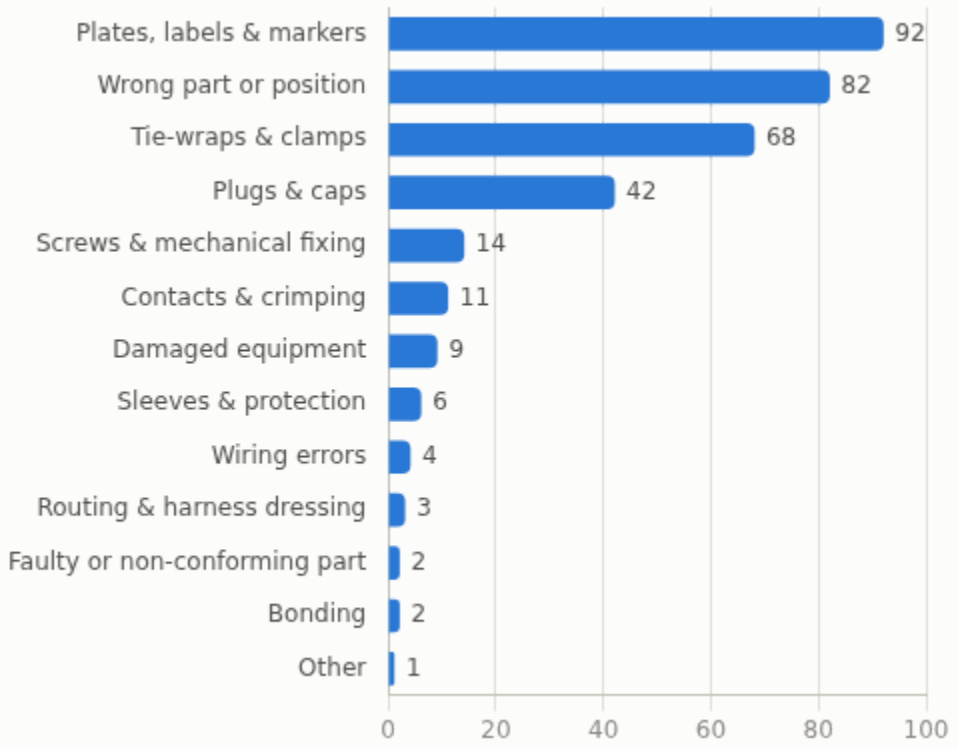


S01–S37, cable defects excluded.

Monthly topics and Pareto


● Câblage + Branchement = 72%

Program **All** | A330 | A350

MFT topics per month, January to June 2026

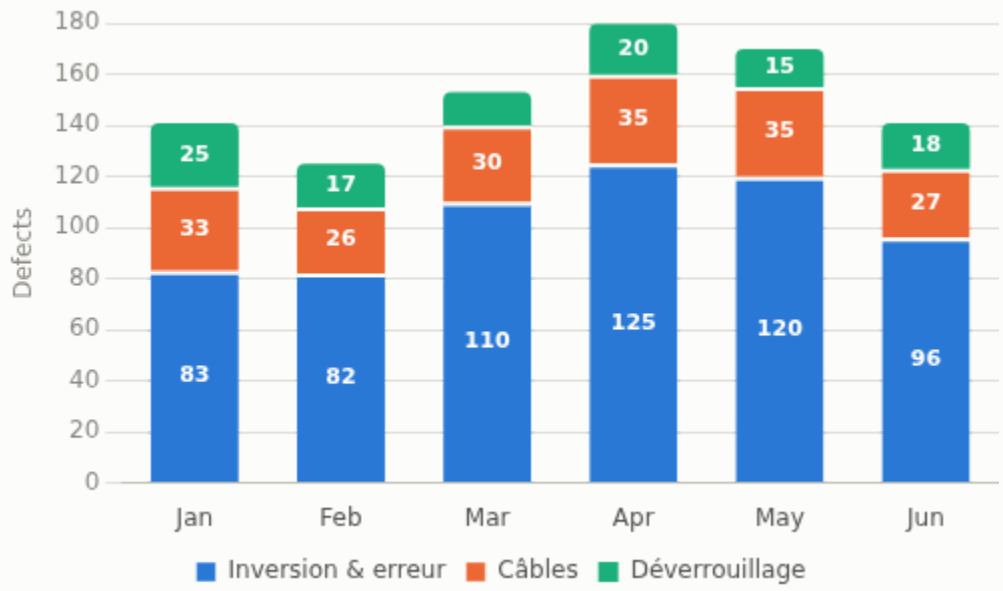


Pareto by group, 1 January to 6 July 2026

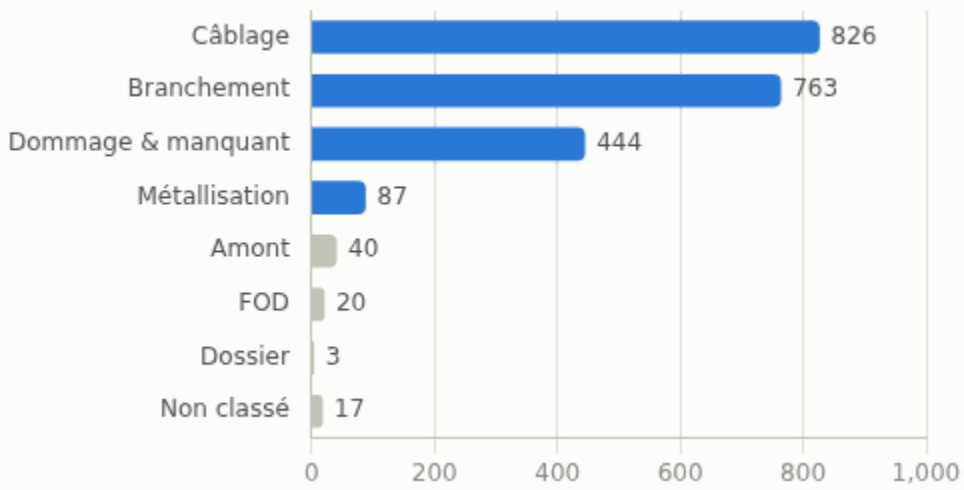

Top 3 groups = 92.4% of 2,200 defects · grey = aside.

Inside the group **Câblage**

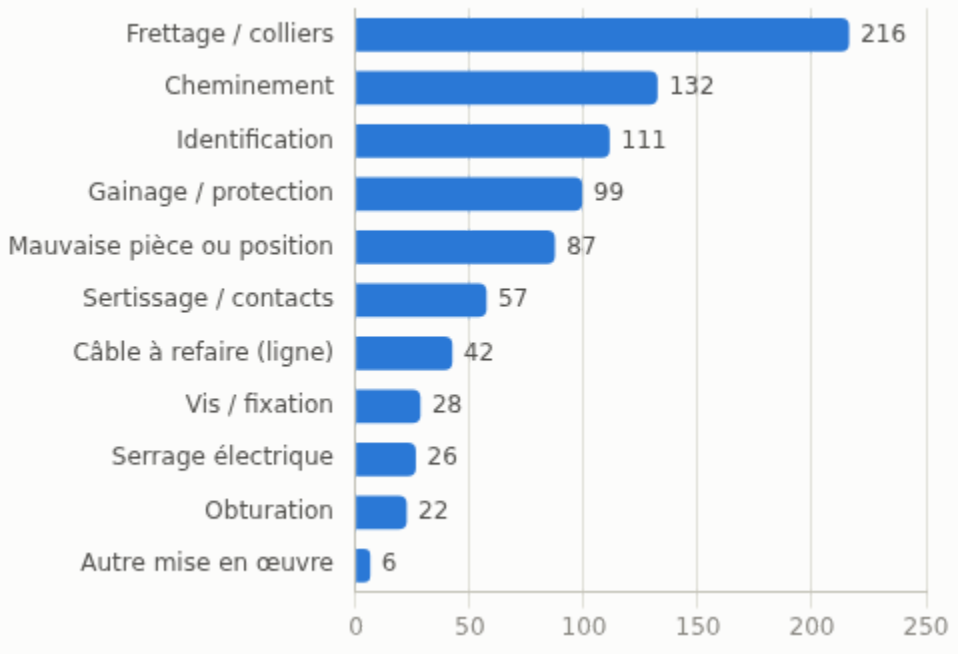


SAP dates · deleted and supplier NCs excluded · 1 defect = 1 count.

MFT topics

Too early: data stops 6 July


TOPIC	ACTION	START	OWNER	PER WEEK, JAN–JUN	CAN WE JUDGE IT?
A330-01 Damaged equipment 13CE/17CE (relay sockets)	Clamping support (étau) for the relay platine	1 Jul 2026	Team leader	0.4	Too early (1 week of data)
A330-02 Damaged fourreaux	New storage packaging, kanban resized	1 Aug 2026	Team leader / Logistique	0.1	Starts after our data
A330-03 Workmanship (mise en oeuvre)	Weekly MFT, line surveillance, tutors per shift	1 Sep 2026	QLS / Team leader	6.1	Starts after our data
A330-04 Bonding (métallisation)	Training, QA, qualified operators, SOI update	1 Sep 2026	QLS / Team leader / Training	0.2	Starts after our data
A350-01 Wiring errors and inversions	Tutoring: lighter load, aligned shifts	1 Jul 2026	Team leader	18.5	Too early (1 week of data)
A350-02 Connectors not locked	VT/VG recurrence, check tool, no trainees at integration	1 Jul 2026	Q + ST / Méthodes / Team leader	3.3	Too early (1 week of data)
A350-03 Mechanical defects found at final inspection	L2 check moved to the mechanical station	–	Qualité	3.6	No start date · rule to confirm
A350-04 Cables cut too short	RapidShare set back, knife cleaning	1 Jul 2026	Gimenez.M / Team leader	1.6	Too early (1 week of data)
A350-05 Cables damaged	Cable-tree structure, find the sub-assembly	1 Jul 2026	Team leader / ST / Q	1.0	Too early (1 week of data)

MFT topic: A350-01 · Wiring errors and inversions

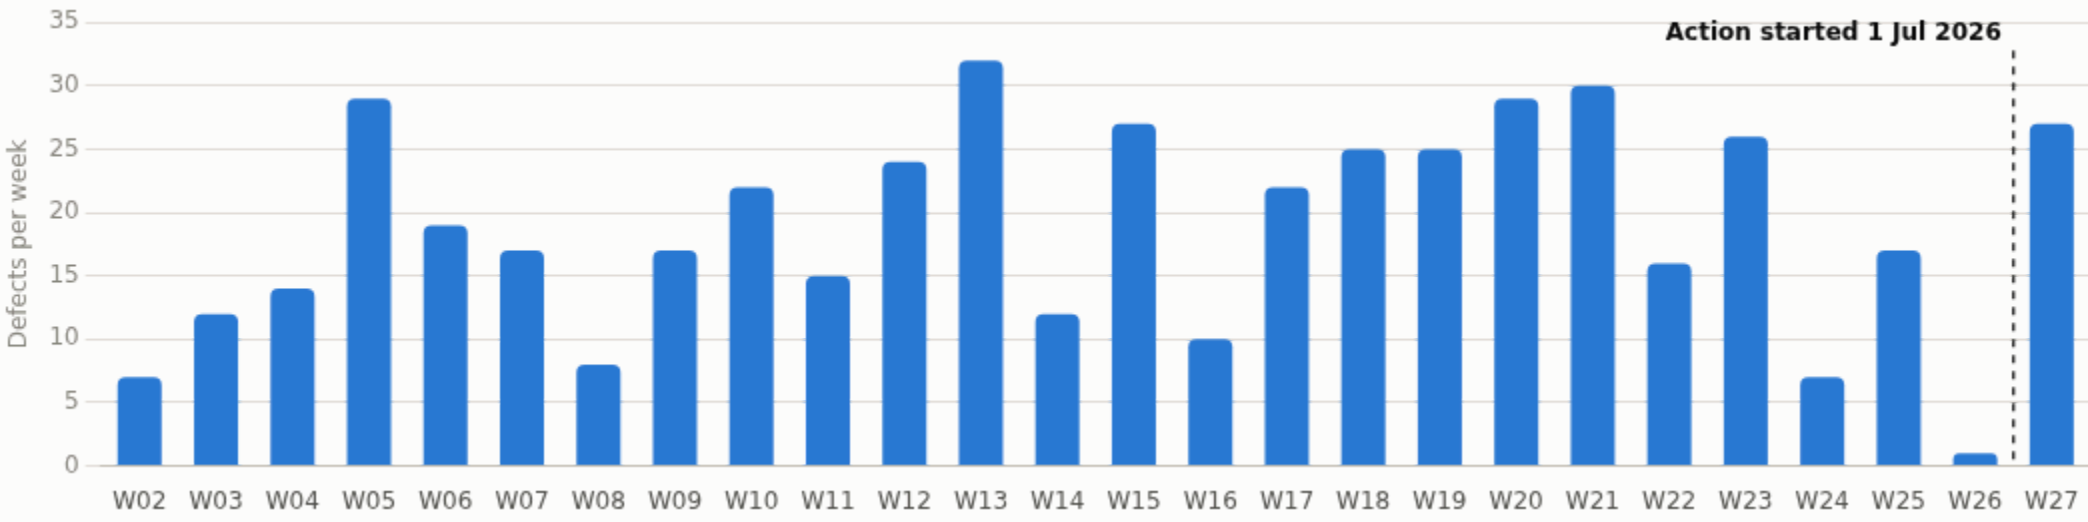


A350-01: 18.5 defects/week, Jan–Jun.

A350-02 · Unlocked connectors by FIN family

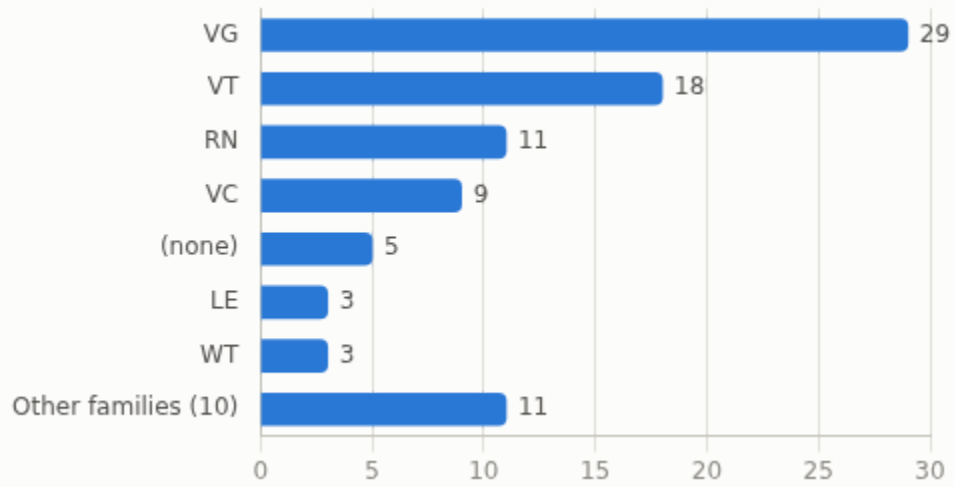


VT texts name the pin (300VT103: 1F, 1G, 2A, 2E, 2M); VG texts don't (0 of 29).

A330-03 · What "mise en oeuvre" is made of

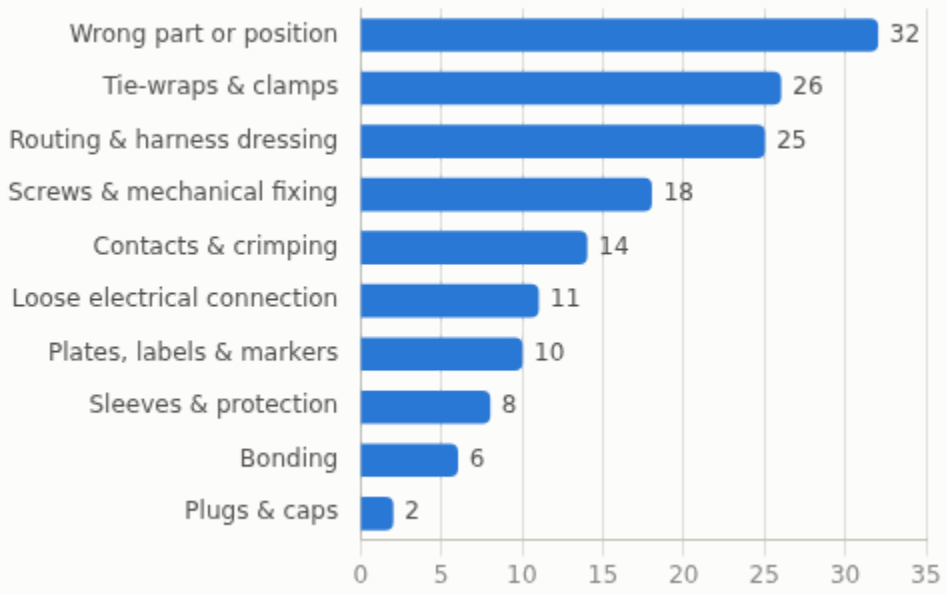

A330, Jan–Jun. On A350, tie-wraps lead instead.

A350-03 · What the A350 final inspection finds

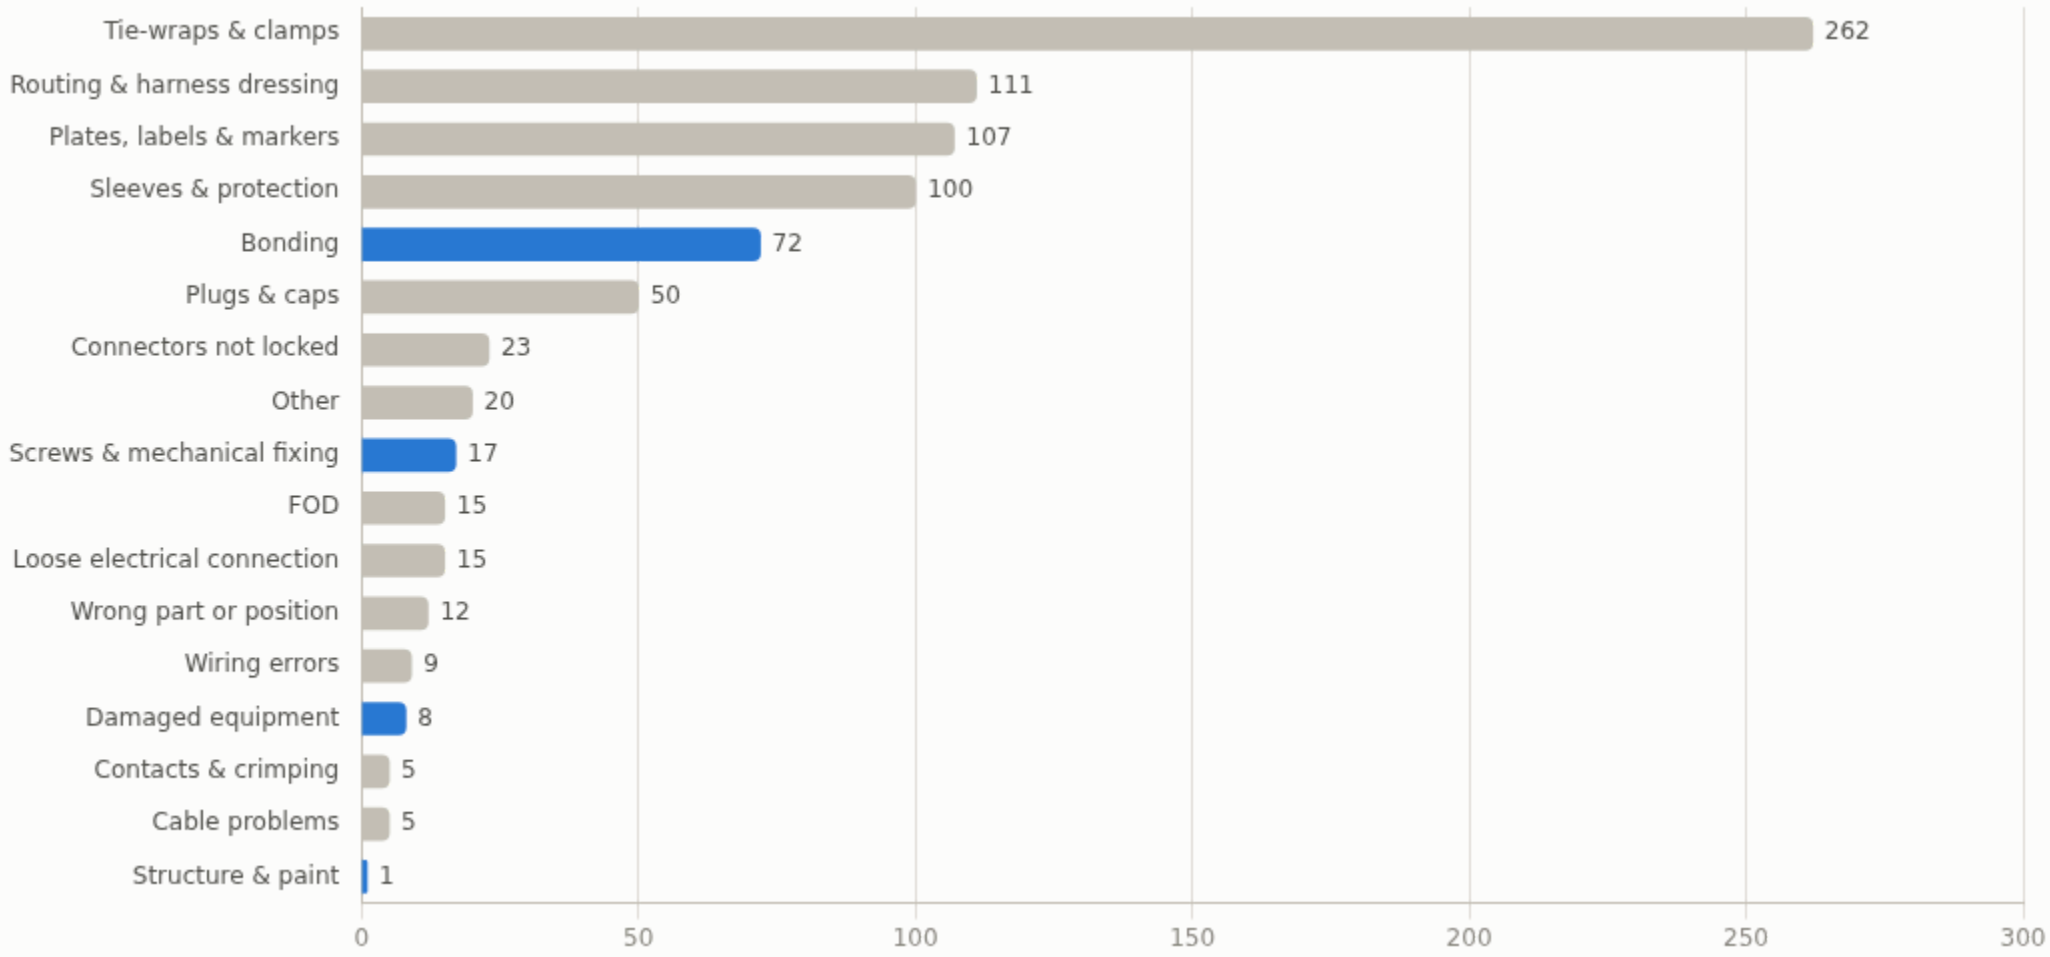

Jan–Jun. Highlighted = proposed mechanical-station scope (to confirm).


Client returns

● **Only 11 of 54 labelled CLIENT**

Plant ≠ FTO2 = found by the customer. No câbles or déverrouillage reached a customer.

54	49	11
NCs raised at other plants, 5 Jan – 6 Jul	not deleted	carry the team's CLIENT label

What they were, by group (defects)

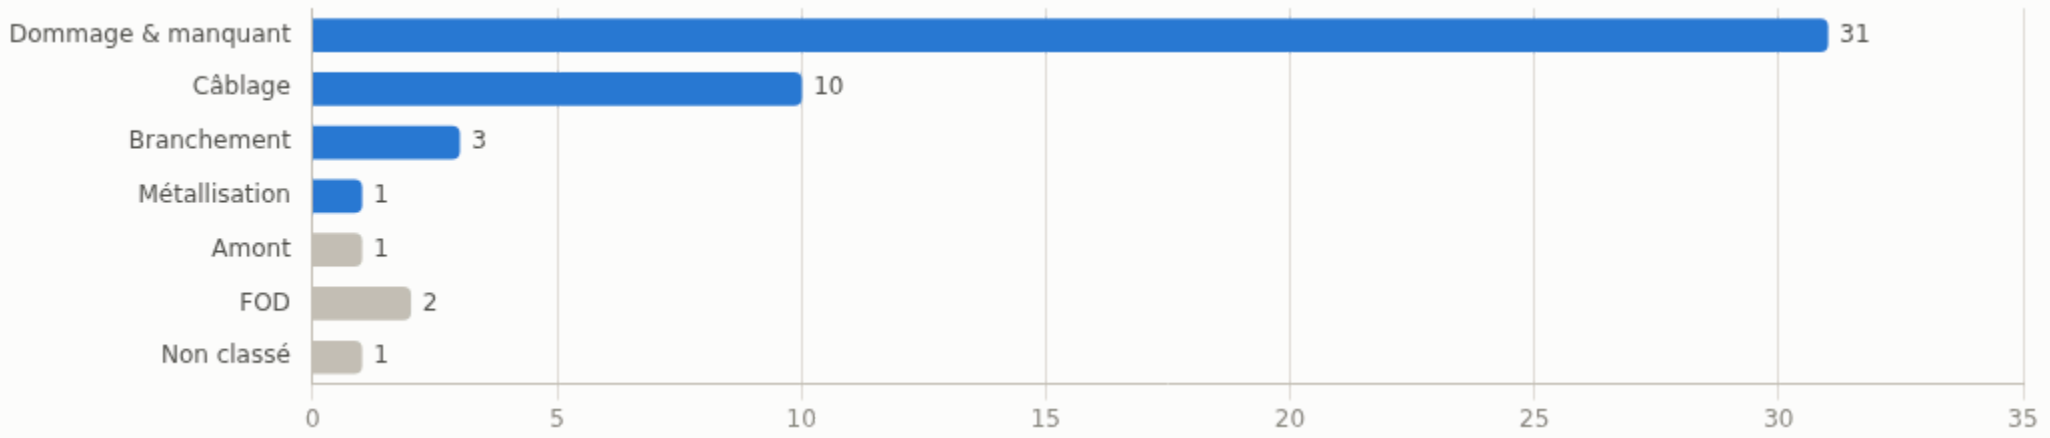


Supplier-liable NCs

● **Label catches 49 of 94**

Excluded from the main counts. FOURNISSEUR label also sits on 10 non-supplier NCs.

94	64	49
supplier-liable NCs, 5 Jan – 6 Jul	not deleted	carry the team's FOURNISSEUR label

What they were, by group (defects)

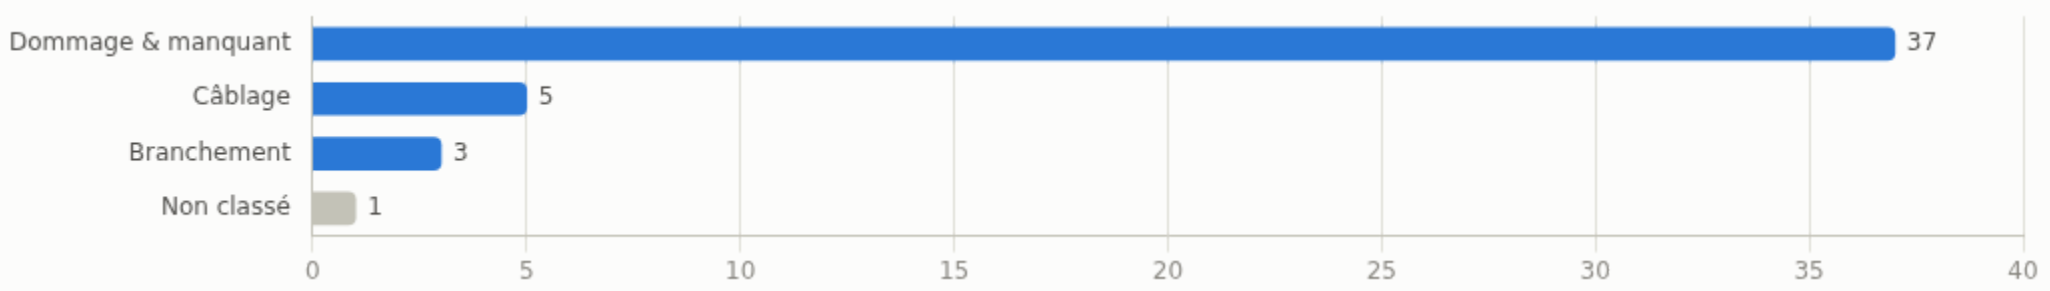

Sources: SAP extract 5 Jan – 6 Jul 2026 (807 NCs), parser v4.5 · FTO2 extract S01–S37 (876 NCs) · cable tracker · MFT trackers A330/A350.