

Property Condition Assessment

8330 Power Inn Road, Sacramento, CA 95826

Site visit: 2026-06-18

Delta Building Consultants, Inc.

1. Executive Summary

This report presents the findings of a property condition assessment of the subject property at 8330 Power Inn Road, Sacramento, CA 95826, an approximately 20,000-square-foot, eight-suite small-bay industrial building. The site visit was conducted on 2026-06-18. The assessment covers the roof, HVAC equipment, electrical service, plumbing, and paved areas.

The roof is the original built-up membrane installed in 2001, with no documented replacement since. Ponding water and membrane blistering were observed; replacement is recommended within 12 to 24 months at a budget of \$85,000 to \$95,000.

Eight packaged rooftop HVAC units serve the building. Six units, installed between 2014 and 2019, are in good working order. Two units, serving suites 103 and 106, date to 1998 and are beyond typical service life; both were operational at the time of inspection.

Electrical and plumbing systems were found to be serviceable with no immediate deficiencies. The asphalt paving shows typical wear and would benefit from a seal coat and restriping within 3 to 5 years.

Cost ranges and timeframes for all items identified in this assessment are summarized in the findings table in Section 6.

2. Roof Assessment

The roof is a low-slope built-up roof (BUR) membrane, gravel-surfaced, covering the full building footprint. Roofing permit and vendor records on file with the owner indicate the membrane is original to the building's 2001 construction; no documented replacement, recover, or full re-roof has occurred since that date. The membrane is well past its typical 20-year service life for this roof type.

Ponding water was observed at the northeast corner of the roof during the site visit, consistent with a drainage deficiency in that area. Ponding accelerates membrane deterioration and should be corrected as part of any re-roofing scope.



Photo 1: ponding water, NE corner, approx. 1/2 inch after 48 dry hours

In addition to the ponding condition, the membrane surface shows widespread blistering and at least one open seam, observed near the suite 105 HVAC curb. Blistering indicates trapped moisture beneath the membrane and, combined with an open seam, creates an active leak risk at that location.

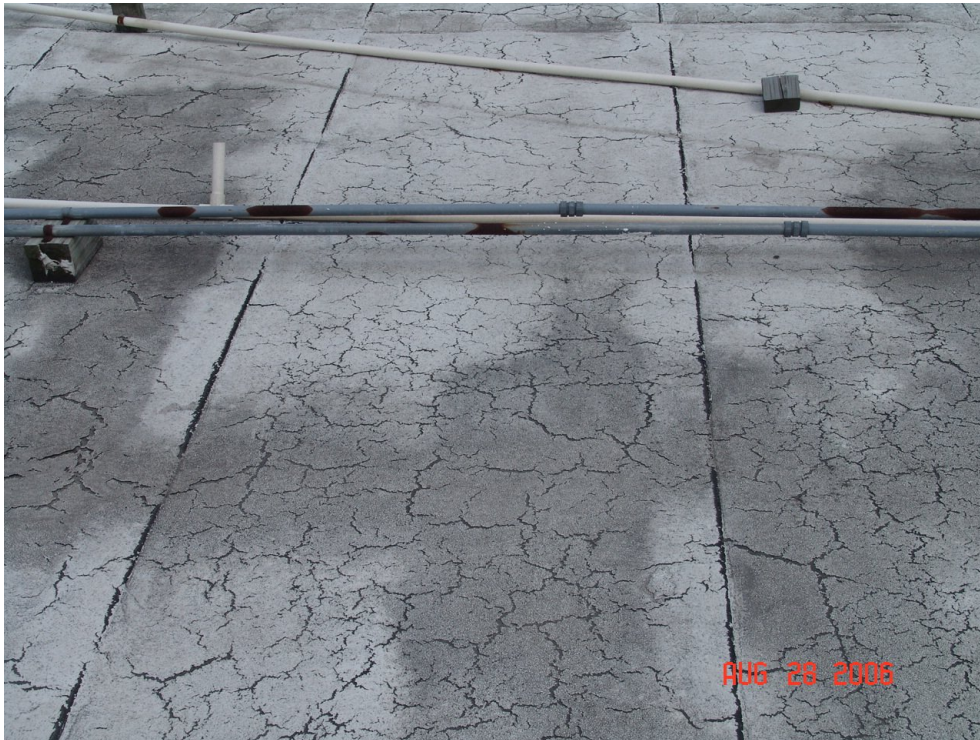


Photo 2: membrane blistering and open seam near suite 105 HVAC curb

Recommendation

Given the roof's age (original to 2001, no documented replacement), the observed ponding, and the membrane blistering and open seam, we recommend full roof replacement within 12 to 24 months. Budget \$85,000 to \$95,000 for a like-for-like built-up or single-ply replacement, including correction of the NE corner drainage deficiency.

3. HVAC Assessment

Eight rooftop packaged HVAC units serve the building, one per suite. Unit condition was assessed visually and by nameplate data where accessible; no units were opened for internal inspection. All eight units were operational at the time of the site visit.



Photo 3: rooftop packaged HVAC units

Unit	Suite	Install year	Condition / notes
1	101	2016	Operational; routine maintenance
2	102	2015	Operational; routine maintenance
3	103	1998	Beyond typical service life; operational at inspection
4	104	2017	Operational; routine maintenance
5	105	2014	Operational; routine maintenance
6	106	1998	Beyond typical service life; operational at inspection
7	107	2018	Operational; routine maintenance
8	108	2019	Operational; routine maintenance

The units serving suites 103 and 106 are original 1998 packaged units and are beyond typical service life (typical service life for packaged rooftop units is 15 to 20 years). Both units were operational at the time of inspection with no immediate signs of failure. Budget replacement of these two units within 3 to 5 years, at \$14,000 to \$18,000 each.

4. Electrical

Electrical service appears original to the building. Panels are labeled and accessible in each suite. No exposed wiring, overheating, or other deficiencies were observed. No immediate capital needs are identified for the electrical system.

5. Plumbing

Plumbing fixtures and visible supply and waste lines were serviceable at the time of inspection. No active leaks, corrosion, or deficiencies were noted in the suites accessed. No immediate capital needs are identified for the plumbing system.

6. Paving

The asphalt parking and loading areas show typical wear, including surface cracking and faded striping. No structural (base) failures were observed. Recommend a seal coat and restripe within 3 to 5 years, budget \$6,000 to \$8,000.

7. Summary of Findings

The table below summarizes the capital items identified in this assessment, with cost ranges and recommended timeframes.

Item	Cost range	Timeframe
Roof replacement (original 2001 BUR membrane)	\$85,000 - \$95,000	12 - 24 months
HVAC replacement, suites 103 & 106 (1998 units, \$14k-\$18k each)	\$28,000 - \$36,000	3 - 5 years
Electrical	None identified	N/A
Plumbing	None identified	N/A
Paving seal coat and restripe	\$6,000 - \$8,000	3 - 5 years

This report reflects physical conditions observed on the date of the site visit only, limited to the roof, HVAC, electrical, plumbing, and paving scope described above.