

MobilTM

Alert

Unit ID: 4-RK-1

Asset ID: 50074762

Description: Kiln 2 Drive Trunion Bearing 3

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25342227021

Service Level: Essential

Bottle ID: a037280486

Tested Lubricant: MOBIL SHC 636

Asset Class: Circulating System





Manufacturer:

Model:

Lubricant: MOBIL SHC 636

Sample Data & Trends

Sample Info	Report Status	Normal	Alert	Normal	Normal	Alert
	Sample ID	24330183022	25044280022	25069424012	25147132045	25342227021
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a033563097	a033592180	a003619436	a033683530	a037280486
	Tested Lubricant	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636	MOBIL SHC 636
	Sampled	13 Nov 2024	03 Feb 2025	04 Mar 2025	18 May 2025	03 Dec 2025
	Reported	27 Nov 2024	18 Feb 2025	12 Mar 2025	29 May 2025	10 Dec 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed		Yes			
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Caution
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Alert	Normal	Normal	Alert
	Visc@40C (cSt)	685.8	491.2	635.5	580.3	496.8
	TAN (mg KOH/g)	0.42	0.42	0.43	0.42	0.47
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	0	1	1	2	24
	Fe (Iron)	0	0	10	1	0
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	0	0	0	0
	Sn (Tin)	0	0	0	2	0
Contaminant (ppm)	K (Potassium)	0	1	0	0	1
	Na (Sodium)	0	1	0	0	0
	Si (Silicon)	19	22	26	34	37
	B (Boron)	0	0	1	0	0
Additive (ppm)	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	3	2	13	17	24
	Mg (Magnesium)	0	0	1	0	0
	P (Phosphorus)	377	392	441	452	463
	Zn (Zinc)	3	0	3	14	33

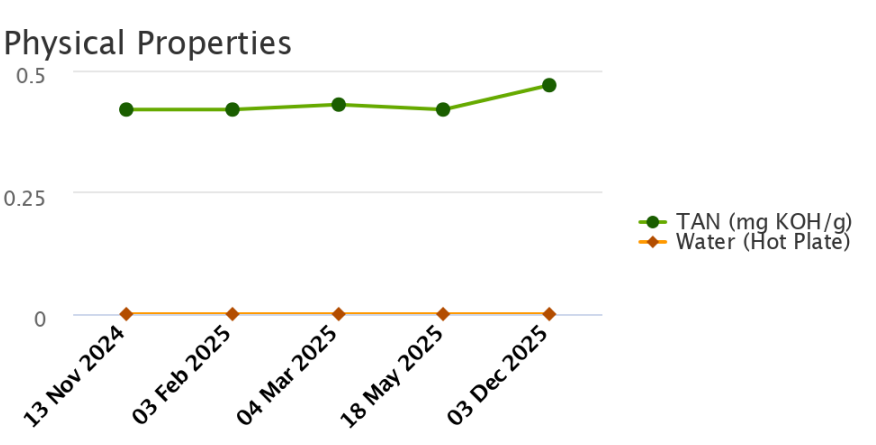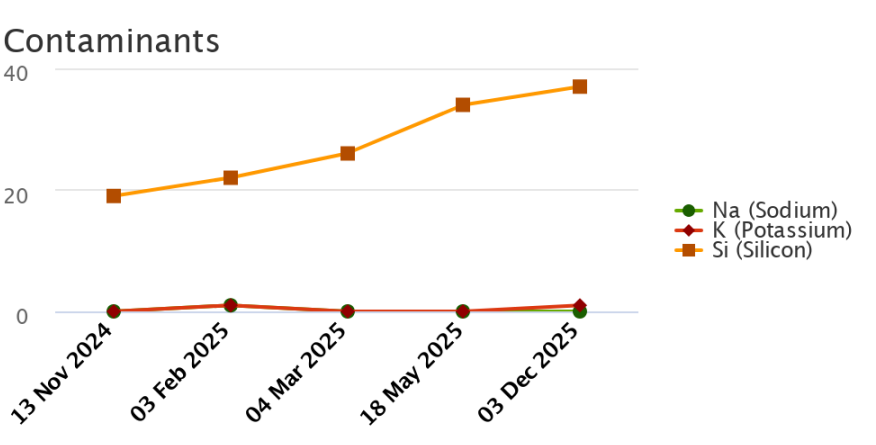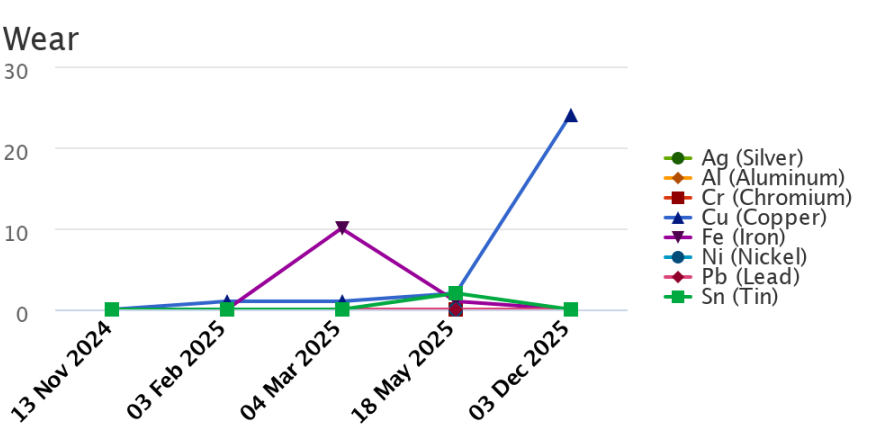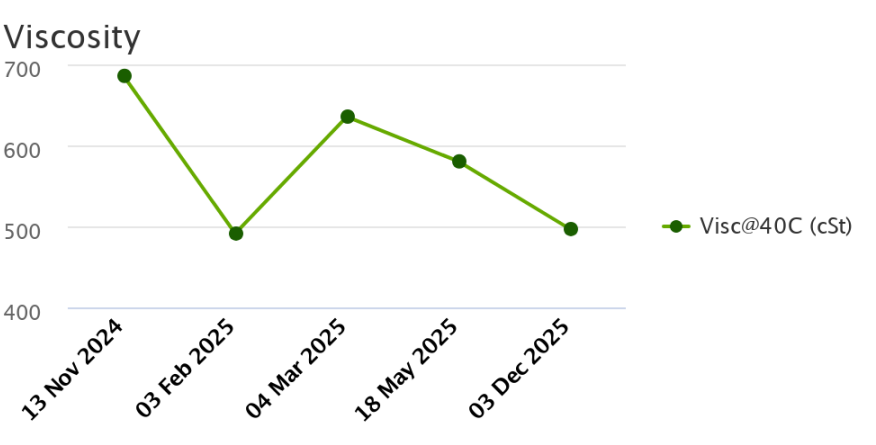

	Alert	
	Unit ID: 4-RK-1	Asset ID: 50074762
	Description: Kiln 2 Drive Trunion Bearing 3	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25342227021 Service Level: Essential Bottle ID: a037280486 Tested Lubricant: MOBIL SHC 636	Asset Class: Circulating System Manufacturer: Model: Lubricant: MOBIL SHC 636
Continued		
Recommendation/Comments		

CAUTION - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metal levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt remaining in equipment due to ineffective purification and / or filtration; b. Faulty seals, breather, fill caps; c. Improper sampling techniques that result in dirt contaminating the sample. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - REDUCED OIL VISCOSITY. Determine cause of reduced oil viscosity and take corrective action. Reduced viscosities can impair the lubricant's ability to protect the equipment. Possible causes of reduced viscosity include: a. Initial fill or contact with oil that has a lower viscosity; b. Contamination with a fuel or solvent; c. Incorrectly labeled sampled. Inspect the system for signs of fuel or coolant ingression. Resample the oil after corrective actions have been implemented. If the condition continues or escalates, recharge the system with new oil. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 03 Dec 2025 10:20 PM UTC - Shawn Turner - In Service Oil Sample Comments: Photo: