

MobilTM

Alert

Unit ID: 7-BL-1 DriveAsset ID: 51875464

Description: Blower

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308280032

Service Level: Essential

Bottle ID: a003615799

Tested Lubricant: MOBIL SHC 630

Asset Class: Compressor


Manufacturer:

Model:

Lubricant: MOBIL SHC 630

Sample Data & Trends

Sample Info	Report Status	Alert
	Sample ID	25308280032
	Service Level	Essential
	Bottle ID	a003615799
	Tested Lubricant	MOBIL SHC 630
	Sampled	22 Oct 2025
	Reported	06 Nov 2025
	Equipment Age	
	Oil Age	
	Make-up Volume	
	Oil Changed	
	Filter Changed	
Lubricant	Contamination Rating	Alert
	Equipment Rating	Alert
	Lubricant Rating	Alert
	Visc@40C (cSt)	265.6
	TAN (mg KOH/g)	1.22
	Water (Hot Plate)	Detected
Wear (ppm)	Coolant Indicator	NotDetected
	Ag (Silver)	0
	Al (Aluminum)	3
	Cr (Chromium)	2
	Cu (Copper)	1
	Fe (Iron)	756
	Mo (Molybdenum)	0
	Ni (Nickel)	0
	Pb (Lead)	0
	Sn (Tin)	0
Contaminant (ppm)	K (Potassium)	2
	Na (Sodium)	8
	Si (Silicon)	24
Additive (ppm)	B (Boron)	6
	Ba (Barium)	4
	Ca (Calcium)	34
	Mg (Magnesium)	9
	P (Phosphorus)	510
	Zn (Zinc)	15

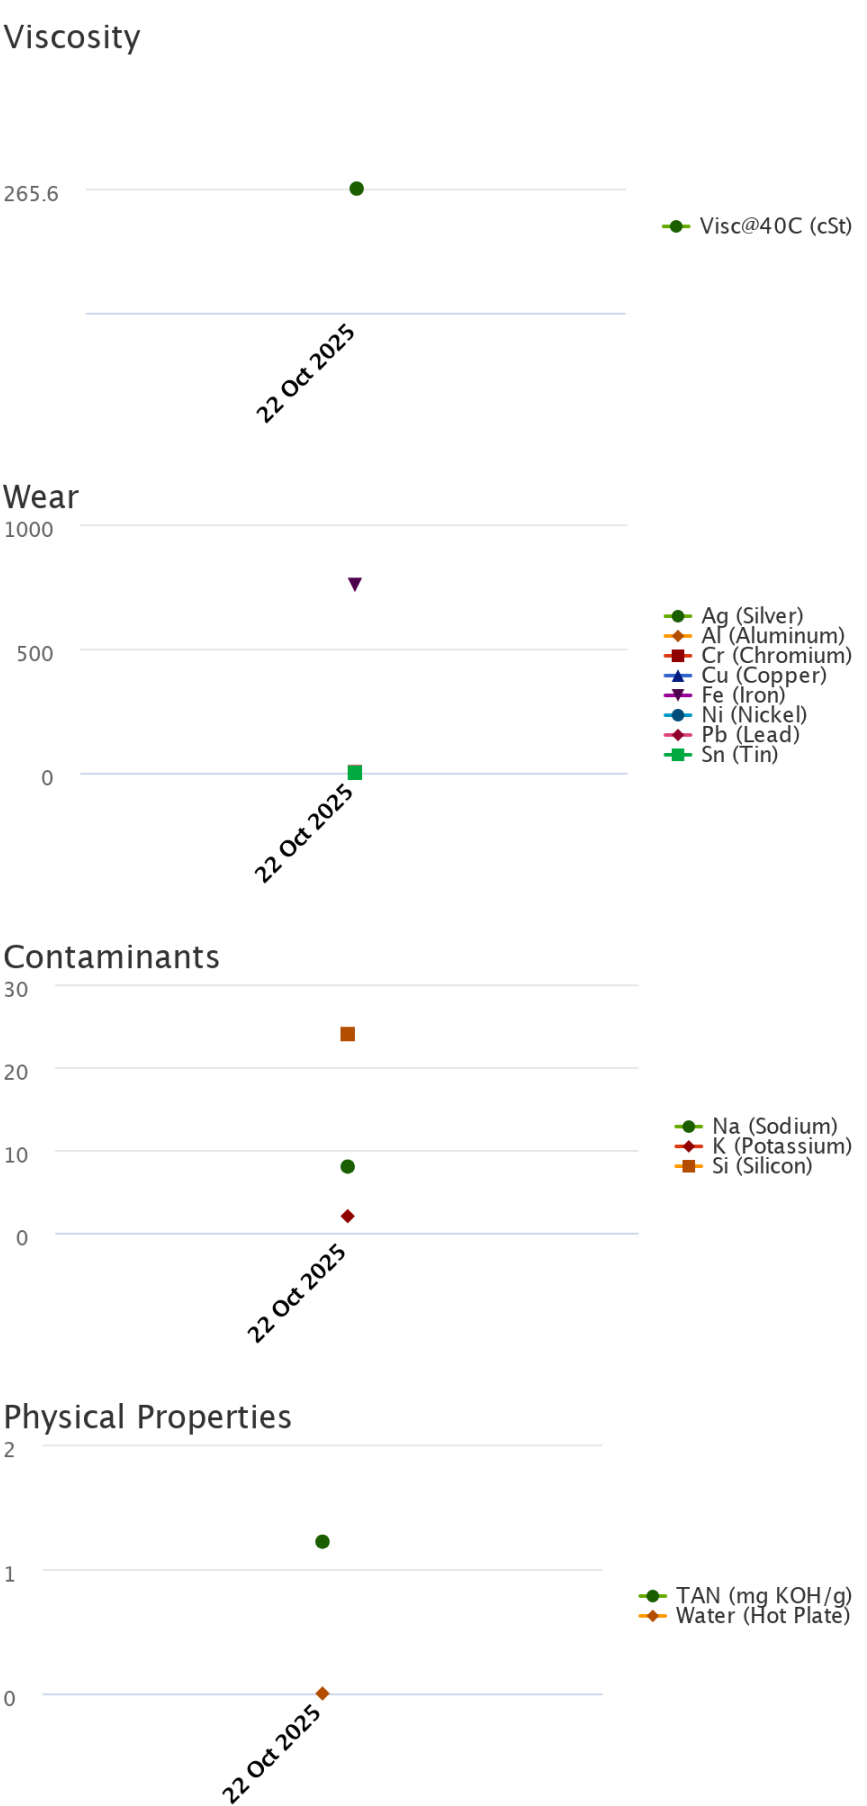

	Alert	
	Unit ID: 7-BL-1 Drive	Asset ID: 51875464
	Description: Blower	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25308280032 Service Level: Essential Bottle ID: a003615799 Tested Lubricant: MOBIL SHC 630	Asset Class: Compressor Manufacturer: Model: Lubricant: MOBIL SHC 630
Continued		
Recommendation/Comments		

ACTION REQUIRED - ELEVATED IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Possible sources of iron include: a. Machinery component wear; b. Metal-to-metal contact; c. Corrosion; d. Abrasive dirt contamination. The oil may be unfit for continued use and should be closely monitored for further condition regressions. Inspect the equipment for signs of damage. Change the oil after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - EXCESSIVE IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is excessive for the first time with no history of an increasing trend, then resample immediately to confirm condition. The oil and filter are unfit for continued use. Change the filter immediately and either centrifuge or change the oil. Prolonged usage of oil with excessive iron levels can adversely affect product performance and damage the equipment. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - EXCESSIVE WATER CONTAMINATION. Determine source of water and take corrective action. Analyze the oil with an on-site water test if accessible. Possible sources of water include: a. Leaking seals; b. Condensation resulting from low operating temperatures or prolonged shutdowns; c. Compromised oil cooler; d. Direct exposure to atmosphere as a result of compromises to system components (i.e. improperly sealed tank fill access point). Remove water from oil using centrifuges or dehydration units, or drain the oil and recharge the system with new oil. Resample the system after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 22 Oct 2025 9:26 PM UTC - Brad Roy - In Service Oil Sample Comments: Photo: