



Bridge Inspection Report

180430K00170001

SANDEN BLVD

over

MUDDY CREEK



Inspection Date: 03/19/2023

Inspected By: Modjeski and Masters, Inc.

Anthony Schoenecker, PE (Team Leader) (Team Leader)
Michael Parr, PE

Inspection Type(s): Routine




5/18/2023

Modjeski and Masters, Inc. prepared for Srinteg Corporation | Contract No. 88-2IDP5044 | Work Authorization No. 1

DO NOT DISCLOSE – INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND
SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

TABLE OF CONTENTS

	PAGE NUMBER
LOCATION MAP	1
BRIDGE INSPECTION FOLLOW-UP ACTION	2
LOAD POSTING INFORMATION	10
BRIDGE INSPECTION RECORD (1085)	11
BRIDGE INVENTORY RECORD	14
CHANNEL CROSS-SECTION MEASUREMENT RECORD	15
CHANNEL CROSS-SECTION	17
PICTURES	18

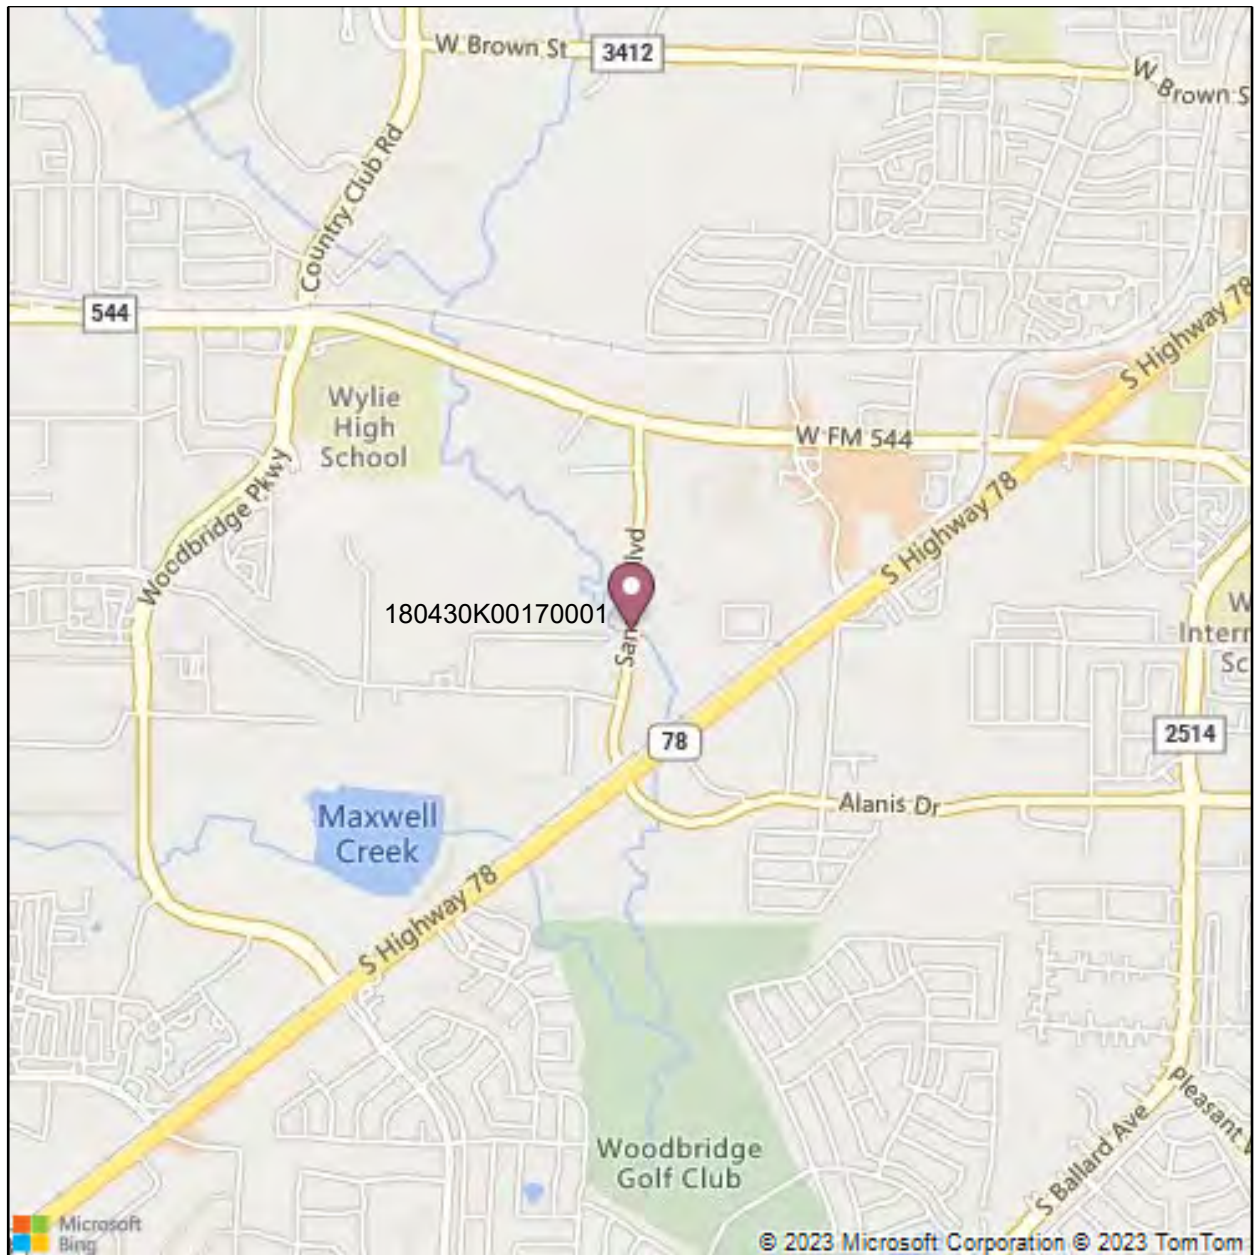

Latitude: 33.00205942

Longitude: -96.56141288

Bridge Inspection Follow-Up Action

Initial Finding Information

Location Information

Bridge ID# 180430K00170001 **Latitude** 33.00205942 **Longitude** -96.56141288 **County** 043-COLLIN **Location** 0.40 MI S OF FM 544
Facility Carried SANDEN BLVD **Feature Crossed** MUDDY CREEK

Ownership/Responsibility

District DAL **Area Office** **Maintenance Section** 07 **Control - Section** K001 - 70
System Designation 2 **Bridge Owner** City of Wylie **Precinct**

Maintenance Information

Inspection Date 03/19/2023 **Rec Type** Level 3 **Previously Recommended?** Y **Critical Finding?** N

Bridge Component Approaches **Repair Category** Provide Standard Delineation/Object Markers at Structure

Other:

Description of Issue and Recommendation

No object markers are present.

Recommendation: Provide standard object markers at all four corners of the structure in accordance with TxDOT standards.

District Bridge Office Comments

Comments By _____ Date _____

District Area or Assigned Maintenance Office Comments

Comments By _____ Date _____

Follow-up Action Resolution Comments

Work to be Completed Via: +Project Status: +District Estimated Letting Date:
 +District Proposed Funding Source: +CSJ / WO / Project ID: +Optional Fields

Action Taken: Verified By Date

+Additional Comments if Necessary:

CRITICAL FINDING FOLLOW UP INFORMATION (BLANK IF FOLLOW UP ACTION IS NOT A CRITICAL FINDING)

Condition Rating (Affected elements only) Overall Recommendation: New Load Rating / Analysis Required?

Follow Up Inspection Information:

Automated Email Sent To:
 Date Bridge Division notified of Critical Finding: Date Bridge Owner notified of Critical Finding: Concur with findings:
 TxDOT Inspector: Co-Inspection Date w/ Bridge Owner: Bridge Owner Rep:
 Comments:

Temporary Repair Information:

TxDOT Inspector: Date Temporary Recommended Repair(s) Discussed w/Bridge Owner:
 Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:
 Temp Repair In Place: Date Temporary Repair was Installed: Date Bridge Division notified of Temp Repair:
 Comments:

Permanent Repair Information:

TxDOT Inspector: Permanent Repair Target Date:
 Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:
 Date Permanent Recommended Repair(s) Discussed w/Bridge Owner: Permanent Repair Construction Date: Date Bridge Division notified of Permanent Repair:
 Comments:

DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: James Costigan

Structure Number: 180430K00170001

Inspection Date:

Facility Carried:

Bridge Inspection Report

Pictures



PHOTO 1 Recommended Maintenance Needs

Description No object markers are present, looking north.

Bridge Inspection Follow-Up Action

Initial Finding Information

Location Information

Bridge ID# 180430K00170001 **Latitude** 33.00205942 **Longitude** -96.56141288 **County** 043-COLLIN **FUA ID** 660246
Location 0.40 MI S OF FM 544
Facility Carried SANDEN BLVD **Feature Crossed** MUDDY CREEK

Ownership/Responsibility

District DAL **Area Office** **Maintenance Section** 07 **Control - Section** K001 - 70
System Designation 2 **Bridge Owner** City of Wylie **Precinct**

Maintenance Information

Inspection Date 03/19/2023 **Rec Type** Level 3 **Previously Recommended?** Y **Critical Finding?** N

Bridge Component Approaches **Repair Category** Repair Erosion - Approach

Other:

Description of Issue and Recommendation

Sidewalk on east side is undermined at south ends. North approach slab undermined at west corner at past foam injection repair location. South approach slab is undermined ~ 1' deep on the west side with more than 8' of penetration.
 Recommendation: Repair erosion with backfill of concrete.

District Bridge Office Comments

Comments By _____ Date _____

District Area or Assigned Maintenance Office Comments

Comments By _____ Date _____

Follow-up Action Resolution Comments

Work to be Completed Via: +Project Status: +District Estimated Letting Date:
 +District Proposed Funding Source: +CSJ / WO / Project ID: +Optional Fields

Action Taken: Verified By Date

+Additional Comments if Necessary:

CRITICAL FINDING FOLLOW UP INFORMATION (BLANK IF FOLLOW UP ACTION IS NOT A CRITICAL FINDING)

Condition Rating (Affected elements only) Overall Recommendation: New Load Rating / Analysis Required?

Follow Up Inspection Information:

Automated Email Sent To:
 Date Bridge Division notified of Critical Finding: Date Bridge Owner notified of Critical Finding: Concur with findings:
 TxDOT Inspector: Co-Inspection Date w/ Bridge Owner: Bridge Owner Rep:
 Comments:

Temporary Repair Information:

TxDOT Inspector: Date Temporary Recommended Repair(s) Discussed w/Bridge Owner:
 Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:
 Temp Repair In Place: Date Temporary Repair was Installed: Date Bridge Division notified of Temp Repair:
 Comments:

Permanent Repair Information:

TxDOT Inspector: Permanent Repair Target Date:
 Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:
 Date Permanent Recommended Repair(s) Discussed w/Bridge Owner: Permanent Repair Construction Date: Date Bridge Division notified of Permanent Repair:
 Comments:

DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: James Costigan

Structure Number:

180430K00170001

Inspection Date:

Facility Carried:

Bridge Inspection Report

Pictures



PHOTO 1 Recommended Maintenance Needs

Description Sidewalk on east side is undermined at south ends, looking south.



PHOTO 2 Recommended Maintenance Needs

Description North approach slab undermined at west corner at past foam injection repair location, looking southeast.

Bridge Inspection Follow-Up Action

Initial Finding Information

Location Information

Bridge ID# 180430K00170001 **Latitude** 33.00205942 **Longitude** -96.56141288 **County** 043-COLLIN **FUA ID** 660245
Location 0.40 MI S OF FM 544
Facility Carried SANDEN BLVD **Feature Crossed** MUDDY CREEK

Ownership/Responsibility

District DAL **Area Office** **Maintenance Section** 07 **Control - Section** K001 - 70
System Designation 2 **Bridge Owner** City of Wylie **Precinct**

Maintenance Information

Inspection Date 03/19/2023 **Rec Type** Level 3 **Previously Recommended?** Y **Critical Finding?** N

Bridge Component Deck **Repair Category** Repair Armor Joint

Other:

Description of Issue and Recommendation

An ~ 8' section of joint armor missing at south abutment joint with minor spalling along the approach slab.

Recommendation: Repair Armor Joint

District Bridge Office Comments

Comments By _____ Date _____

District Area or Assigned Maintenance Office Comments

Comments By _____ Date _____

Follow-up Action Resolution Comments

Work to be Completed Via: +Project Status: +District Estimated Letting Date:
 +District Proposed Funding Source: +CSJ / WO / Project ID: +Optional Fields

Action Taken: _____ Verified By _____ Date _____

+Additional Comments if Necessary:

CRITICAL FINDING FOLLOW UP INFORMATION (BLANK IF FOLLOW UP ACTION IS NOT A CRITICAL FINDING)

Condition Rating (Affected elements only) Overall Recommendation: New Load Rating / Analysis Required?

Follow Up Inspection Information:

Automated Email Sent To:

Date Bridge Division notified of Critical Finding: Date Bridge Owner notified of Critical Finding: Concur with findings:

TxDOT Inspector: Co-Inspection Date w/ Bridge Owner: Bridge Owner Rep:

Comments:

Temporary Repair Information:

TxDOT Inspector: Date Temporary Recommended Repair(s) Discussed w/Bridge Owner:

Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:

Temp Repair In Place: Date Temporary Repair was Installed: Date Bridge Division notified of Temp Repair:

Comments:

Permanent Repair Information:

TxDOT Inspector: Permanent Repair Target Date:

Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:

Date Permanent Recommended Repair(s) Discussed w/Bridge Owner: Permanent Repair Construction Date: Date Bridge Division notified of Permanent Repair:

Comments:

DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: James Costigan

Structure Number:

180430K00170001

Inspection Date:

Facility Carried:

Bridge Inspection Report

Pictures



PHOTO 1 Recommended Maintenance Needs

Description An ~ 8' section of joint armor missing at south abutment joint with minor spalling along the approach slab, looking west.

Bridge Inspection Follow-Up Action

Initial Finding Information

Location Information

Bridge ID# 180430K00170001 **Latitude** 33.00205942 **Longitude** -96.56141288 **County** 043-COLLIN **FUA ID** 660243
Location 0.40 MI S OF FM 544
Facility Carried SANDEN BLVD **Feature Crossed** MUDDY CREEK

Ownership/Responsibility

District DAL **Area Office** **Maintenance Section** 07 **Control - Section** K001 - 70
System Designation 2 **Bridge Owner** City of Wylie **Precinct**

Maintenance Information

Inspection Date 03/19/2023 **Rec Type** Level 3 **Previously Recommended?** Y **Critical Finding?** N

Bridge Component Substructure **Repair Category** Perform Concrete Repair to Spalls (Horizontal, Vertical, Overhead)

Other:

Description of Issue and Recommendation

Large delaminations and spalling with exposed reinforcing steel in south abutment backwall near the east end and at west corner connection to wingwall.

Recommendation: Perform Concrete Repair to Spalls.

District Bridge Office Comments

Comments By _____ Date _____

District Area or Assigned Maintenance Office Comments

Comments By _____ Date _____

Follow-up Action Resolution Comments

Work to be Completed Via: +Project Status: +District Estimated Letting Date:
 +District Proposed Funding Source: +CSJ / WO / Project ID: +Optional Fields

Action Taken: Verified By Date

+Additional Comments if Necessary:

CRITICAL FINDING FOLLOW UP INFORMATION (BLANK IF FOLLOW UP ACTION IS NOT A CRITICAL FINDING)

Condition Rating (Affected elements only) Overall Recommendation: New Load Rating / Analysis Required?

Follow Up Inspection Information:

Automated Email Sent To:

Date Bridge Division notified of Critical Finding: Date Bridge Owner notified of Critical Finding: Concur with findings:

TxDOT Inspector: Co-Inspection Date w/ Bridge Owner: Bridge Owner Rep:

Comments:

Temporary Repair Information:

TxDOT Inspector: Date Temporary Recommended Repair(s) Discussed w/Bridge Owner:

Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:

Temp Repair In Place: Date Temporary Repair was Installed: Date Bridge Division notified of Temp Repair:

Comments:

Permanent Repair Information:

TxDOT Inspector: Permanent Repair Target Date:

Bridge Owner Rep: Co-Inspection Date w/Bridge Owner:

Date Permanent Recommended Repair(s) Discussed w/Bridge Owner: Permanent Repair Construction Date: Date Bridge Division notified of Permanent Repair:

Comments:

DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: James Costigan

Structure Number:

180430K00170001

Inspection Date:

Facility Carried:

Bridge Inspection Report

Pictures



PHOTO 1 Recommended Maintenance Needs

Description Large delaminations and spalling with exposed reinforcing steel in south abutment backwall near the east end, looking southwest.



LOAD POSTING INFORMATION

Structure Number
Facility Carried
Feature Intersected

180430K00170001
SANDEN BLVD
MUDDY CREEK

Inspector
Inspection Date
Maint. Section

Schoenecker,Anthony
03/19/2023
07

Components & Ratings:

	Component Rating	Inventory LR		Operating LR	
		H	HS	H	HS
Deck (Item 58)	7				
Superstructure (Item 59)	6		20		33.4
Substructure (Item 60)	6				
Culvert (Item 62)	N				

☐ Posting Requirement Exception: The governing condition rating is controlled by a non-load path element. Therefore, load posting is not recommended.

Seal:

Signature & Date:

Prime Firm Name & Number:

Sub Firm Name & Number:

Load Posting Limits:

	Sign Type	Limit (lbs)					
		Gross	Single Axle	Tandem Axle	Axle or Tandem	Comb. Vehicle	Single Unit Veh. X + Axles
Current Rec. ()							
Prev. Recommended							
Observed Posting							

Material Needed:

Sign Type

Quantity


Sign Type

Quantity

Posts

Hardware Sets

Decals

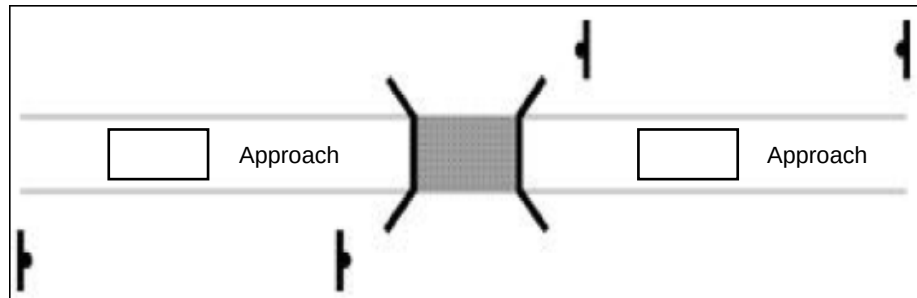

Approach Roadway:	<u>Sign Ty.</u>	<u>Condition Code</u>	<u>Maintenance Need</u>
Advance Warning			
Advance Warning			
Approach			

Approach Roadway:	<u>Sign Ty.</u>	<u>Condition Code</u>	<u>Maintenance Need</u>
Advance Warning			
Advance Warning			
Approach			

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.



BRIDGE INSPECTION RECORD

Structure Number
Facility Carried
Feature Intersected

180430K00170001
SANDEN BLVD
MUDDY CREEK

Inspector
Inspection Date
Maint. Section

Schoenecker, Anthony
03/19/2023
07

Condition Rating	Description*
N	Not Applicable
9	Excellent Condition
8	Very Good Condition - no problems noted
7	Good Condition - some minor problems
6	Satisfactory Condition - minor deterioration of structural elements (limited)
5	Fair Condition - minor deterioration of structural elements (extensive)
4	Poor Condition - deterioration significantly affects structural capacity
3	Serious Condition - deterioration seriously affects structural capacity, local failures possible
2	Critical Condition - advance deterioration of primary elements, bridge should be closed until repaired
1	Failing Condition - bridge closed but repairable
0	Failed Condition - bridge closed and beyond repair

*These descriptions are for items 58, 59, 60 and 65. Code Items 61 and 62 according to the TxDOT Coding Guide.

Bridge Description:

2 - Simple Span Prestressed Concrete I-Beam Bridge on Concrete Bents

Seal:

Signature & Date:

Prime Firm Name & Number:

Sub Firm Name & Number:

General Comments:

Span Configuration: 61.5' - 61.5'
Inventory Direction: North to South

DECK (ITEM 58)

Structure ID: 180430K00170001

Inspection Date:

03/19/2023

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Deck - Component Rating		1	7	
Wearing Surface	None	6	N	Hairline Transverse and isolated longitudinal cracking (< 0.012" wide) on deck surface, primarily near or at joints. Minor spalling and delaminations with some asphalt patching in both spans along joint over Bent 2 . Transverse cracking (< 0.012" wide) in underside of overhangs.
Surfacing Thickness:	inches			
Fill Height:	inches			
Joints, Expansion, Open		6	N	Joint seals have failed. An ~ 8' section of joint armor missing at south abutment joint with minor spalling along the approach slab. North abutment joint has minor deformation of the joint armor and spalling and patching of the deck surface and approach slab along the joint.
Joints, Expansion, Sealed		6	6	
Joints, Other		6	N	
Drainage System		6	8	
Curbs, Sidewalk & Parapets		6	8	
Median Barrier		6	N	
Railings	Non-std. Concrete & Aluminum	6	8	
Railing Type:				
Railing Protective Coating		7	N	
Delineation		7	N	
Other		-	N	

SUPERSTRUCTURE (ITEM 59)

Structure ID: 180430K00170001

Inspection Date:

03/19/2023

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Main Members - Steel		0	N	

Main Members - Concrete	0	6	West exterior I-beams over Bent 2 appear to have hairline horizontal cracking in the bottom flange and diagonal cracking in the web. Several girders at the South Abutment have 1-3/4" loss of bearing pad area due to longitudinal misalignment between the bearing pad and the girder bottom flange.
Main Members - Timber	0	N	
Main Members - Connections	0	N	
Floor System Members	1	N	
Floor System Connections	1	N	
Secondary Members	5	8	
Secondary Mem. Connections	5	N	
Expansion Bearings	6	8	
Fixed Bearings	6	N	
Steel Protective Coating	6	N	
Other	-	N	
Overall Component Rating	6		

SUBSTRUCTURE (ITEM 60)

Structure ID: 180430K00170001 Inspection Date: 03/19/2023
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Abutment Caps		0	7	Abutment caps have vertical cracking (< 0.012" wide) with small diameter spalling at riprap interface.
Above Ground		0	N	
Below Ground or Foundation		0	8	
Backwalls & Wingwalls		0	6	Large delaminations and spalling with exposed reinforcing steel in south abutment backwall near the east end and at west corner connection to wingwall. Minor spalling with isolated exposed reinforcing steel and delaminations at west end of north backwall. Vertical cracking (up to ~ 1/8" wide) at east end of north backwall at connection to wingwall.
Intermediate Supports:				
Caps - Concrete		-	7	Hairline flexure cracks at midpoints between columns at interior cap.
Caps - Steel		-	N	
Caps - Timber		-	N	
Above Ground - Concrete		-	8	
Above Ground - Steel		-	N	
Above Ground - Timber		-	N	
Above Ground - Masonry		-	N	
Below Ground or Foundation		-	8	
Collision Protection System		5	N	
Steel Protective Coating		6	N	
Overall Component Rating	6			

CHANNEL (ITEM 61)

Structure ID: 180430K00170001 Inspection Date: 03/19/2023
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Channel Banks		0	8	
Channel Bed		0	7	Scour hole ~ 15' dia. x 6' deep at outfall of drainage pipe in riprap under north abutment. Tree growing under the bridge has come in contact with east exterior I-beam and deck overhang. Flood drift caught on trees and brush growing in the channel under the bridge.
Rip Rap, Toe Walls & Apron		5	8	
Dikes		5	N	
Jetties		5	N	
Other		-	N	
Overall Component Rating	7			

CULVERTS (ITEM 62)

Structure ID: 180430K00170001 Inspection Date: 03/19/2023
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Top Slabs		0	N	
Bottom Slab or Footing		0	N	

Abutments, Intermed. Supports	0	N
Headwalls & WingWalls	5	N
Other	-	N

Overall Component Rating	N
---------------------------------	----------

APPROACHES (ITEM 65)

Structure ID: 180430K00170001 Inspection Date: 03/19/2023
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Embankments		0	6	Moderate erosion at all corners of the bridge. Sidewalk on east side is undermined at the north and south ends. South approach slab is undermined ~ 1' deep on the west side with more than 8' of penetration. North approach slab undermined at west corner at past foam injection repair location.
Embankment Retaining Walls		4	N	
Slope Protection		5	6	Moderate erosion at all corners of the bridge. Sidewalk on east side is undermined at the north and south ends. South approach slab is undermined ~ 1' deep on the west side with more than 8' of penetration. North approach slab undermined at west corner at past foam injection repair location.
Roadway		5	6	South approach slab is undermined ~ 1' deep on the west side with more than 8' of penetration. North approach slab undermined at west corner at past foam injection repair location. Concrete roadways at both approaches have transverse cracking with minor abrasion in wheel paths. Minor spalling of approach slab at both approaches along the abutment joints.
Relief Joints		6	N	
Drainage		6	8	
Guardfence		6	7	Minor impact damage to approach rail at northwest corner of bridge, flexbeam is deformed and one post is detached. Approach rail at northeast corner of bridge leans away from the roadway and two posts are missing. Minor weathering and decay of timber posts.
Delineation		7	N	No object markers.
Sight Distance		7	8	
Other		-	N	
Overall Component Rating			6	

MISCELLANEOUS

Structure ID: 180430K00170001 Inspection Date: 03/19/2023
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

Component	Description	Min.	Rating	Comment
Signs		N	N	
Illumination		N	N	
Warning Devices		N	N	
Utility Lines		7	N	
Other		N	N	

APPRAISAL RATINGS

Structure ID: 180430K00170001 Inspection Date: 03/19/2023
DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.

TRAFFIC SAFETY FEATURES (ITEM 36)		Rating	Comment
0 - Does not meet current standards	Bridge Rails:	0	Nonstandard Concrete & Aluminum
1 - Meets current standards	Transitions:	0	Guardfence improperly attached to railing.
N - Not applicable	Appr. Rails:	0	No Blockouts
	Appr. Rail Ends:	0	Turndowns
WATERWAY ADEQUACY (ITEM 71)		7	Est. Deck Overtopping Freq: 11-100 yrs. Est. Approach Overtopping Freq: 11-100 yrs.
APPROACH ROADWAY ALIGNMENT (ITEM 72)		8	Regulatory/Advisory Speeds: 45 mph/None



BRIDGE INVENTORY RECORD


Structure Number	180430K00170001	Inspector	Schoenecker, Anthony
Facility Carried	SANDEN BLVD	Inspection Date	03/19/2023
Feature Intersected	MUDDY CREEK	Maint. Section	07

District	18-Dallas	County	043-COLLIN	Latitude	33.00205942	Seal:
Milepoint	01.200	System	2 - Off System	Longitude	-96.56141288	
General Description:						
2 - Simple Span Prestressed Concrete I-Beam Bridge on Concrete Bents						
Bridge Length (ft.)	123	Deck Width (ft.)	44.5			Signature & Date:
Skew Angle (degrees)	0	Clear Width Between (ft.)	36.0			
Right / Left Forward		Measurement Feature	Curbs			
Vertical Over-Clearance	99.99	☒ Unimpaired Over-Clearance				
Surfacing Type	None	Deck Type	See entry for 107.1			Prime Firm Name & Number:
Lanes On	02	Lanes Under	00			Sub Firm Name & Number:
Bridge Rail	42" Concrete and Aluminum	Approach Roadway Width (ft.)	36.0			

Superstructure:	Spans	1 - 2			
Main:	Type	Prestressed Concrete I-Beam	Size	Type C	Number 6
	Spacing	8'	Controlling Span Length (C-C bearings)	61	
Superstructure:	Spans				
Major Approach:	Type		Size	Number	
	Spacing		Controlling Span Length (C-C bearings)		
Superstructure:	Spans				
Minor Approach:	Type		Size	Number	
	Spacing		Controlling Span Length (C-C bearings)		

Estimated Deck Overtopping Frequency	11 - 100	Comments:
Estimated Approach Overtopping Frequency	11 - 100	
Horizontal / Vertical Alignment	Good	/ Good
Regulatory / Advisory Speeds	45 mph / None	
Year Built	1989	Year(s) Widened
Posted Load Restriction	NNN	☒ No Restriction
Design Load	5 - HS 20 (Also used for plans with MS 18 and H 20-S16)	
Design Method	LFD	

DO NOT DISCLOSE. THIS INFORMATION IS CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT & 23 U.S.C SECTION 409, SAFETY SENSITIVE INFORMATION.



Comments:

Company Name: Chempo Sincroval Eng. Inc. Signature: [Signature] Date: 4/26/2019

Comments:

None

Company Name: Modjeski and Masters, Inc. for Strintec Corp. Signature:  Date: 03/18/2023

Comments: No significant changes.

Company Name: _____ Signature: _____ Date: _____

Comments:

Channel Measurement

Date of Channel Measurements: 3/19/2023

Number of Fixed Objects in Channel: 3

Distance Measured From:

Water Level: 16.9


Depth Measured From:

High Water Mark:

Number of Measurement Points Taken: 8

Measurement Type:

Depth from Reference Point

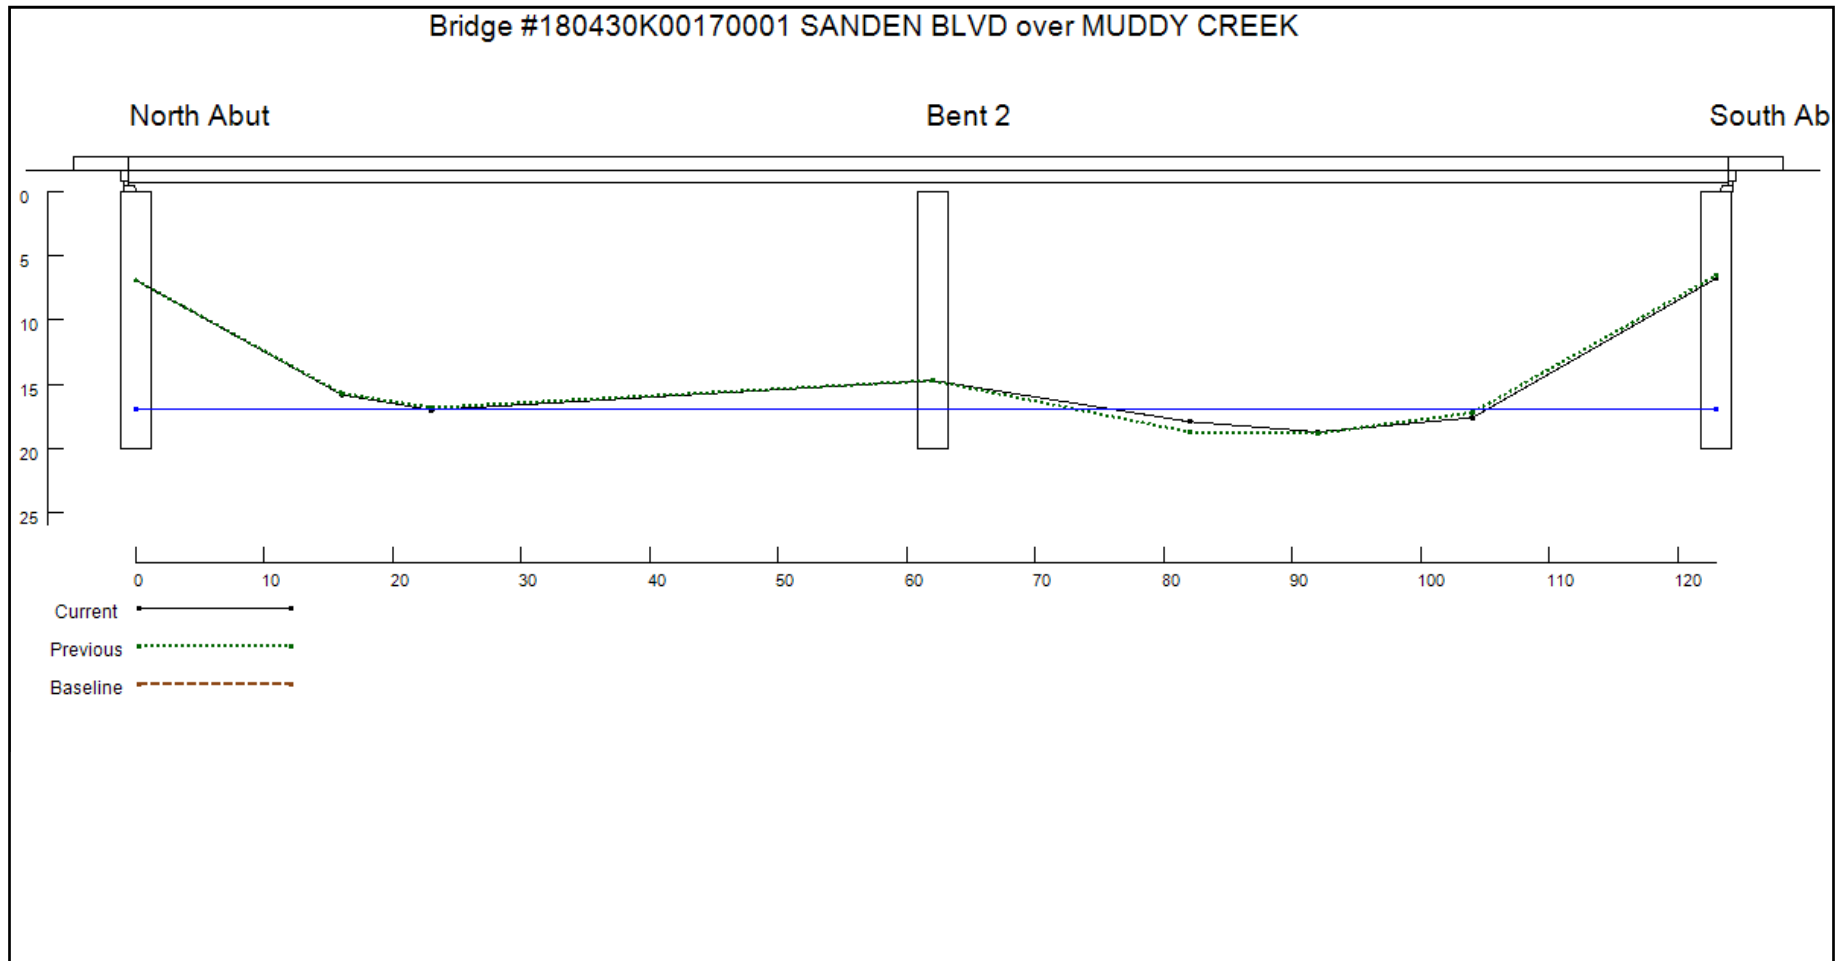

DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: Anthony Schoenecker

Inspection Date: 03/19/2023

Structure Number:

180430K00170001

Facility Carried:

SANDEN BLVD

Bridge Inspection Report

Pictures



PHOTO 1 Roadway View

Description Roadway (Sanden BLVD) view, looking south.



PHOTO 2 Elevation View

Description East bridge elevation view, looking northwest.

Inspector: Anthony Schoenecker

Structure Number:

180430K00170001

Inspection Date: 03/19/2023

Facility Carried:

SANDEN BLVD

Bridge Inspection Report

Pictures



PHOTO 3 Superstructure View

Description Superstructure under view, looking south.



PHOTO 4 Stream Under View

Description Stream under view, looking east.

Inspector: Anthony Schoenecker

Structure Number:

180430K00170001

Inspection Date: 03/19/2023

Facility Carried:

SANDEN BLVD

Bridge Inspection Report

Pictures



PHOTO 5 Upstream View

Description Upstream view, looking west.



PHOTO 6 Downstream View

Description Downstream view, looking east.

Inspector: Anthony Schoenecker

Structure Number:

180430K00170001

Inspection Date: 03/19/2023

Facility Carried:

SANDEN BLVD

Bridge Inspection Report

Pictures



PHOTO 7 Defect

Description Minor spalling and delaminations with some asphalt patching in both spans along joint over Bent 2, looking west. (Condition Rating: 7)



PHOTO 8 Defect

Description An ~ 8' section of joint armor missing at south abutment joint with minor spalling along the approach slab, looking west. (Condition Rating: 6)

Inspector: Anthony Schoenecker

Structure Number:

180430K00170001

Inspection Date: 03/19/2023

Facility Carried:

SANDEN BLVD

Bridge Inspection Report

Pictures



PHOTO 9 Defect

Description Girders at the South Abutment with 1-3/4" loss of bearing pad area due to longitudinal misalignment between the bearing pad and the girder bottom flange, looking east. (Condition Rating 6)



PHOTO 10 Defect

Description Large delaminations and spalling with exposed reinforcing steel in south abutment backwall near the east end, looking southwest. (Condition Rating: 6)

DO NOT DISCLOSE - INFORMATION CONFIDENTIAL UNDER THE TEXAS HOMELAND SECURITY ACT AND 23 USC SECTION 409, SAFETY SENSITIVE INFORMATION

Inspector: Anthony Schoenecker

Inspection Date: 03/19/2023

Structure Number:

180430K00170001

Facility Carried:

SANDEN BLVD

Bridge Inspection Report

Pictures



PHOTO 11 Defect

Description Sidewalk on east side is undermined at south ends, looking south. (Condition Rating: 7)



PHOTO 12 Defect

Description North approach slab undermined at west corner at past foam injection repair location, looking southeast. (Condition Rating: 6)