

QER11749

QER : JULIMAR DEVELOPMENT PHASE 3 SF301229C002.03 - Zeta wire damaged



Pipe section / Details

Item	Traceability / identification
Project number	301229C002
Project name	JULIMAR DEVELOPMENT PHASE 3
Pipe section	SF301229C002.03
ST number	ST203.72124
Affected layer / equipment	Zeta Pressure Vault
Length affected	768.2m
Drawing number / MP code / STA / Dimension	ZETA wire 6.2 FI09 (MP205)

Overview of anomaly

Problem Description :-

During the zeta spiraling of JULIMAR DEVELOPMENT PHASE 3 SF301229C002.03 (ST203.72124), zeta wire damage was detected after accumulator at length 768.2m.

Root Cause :-

The root cause was identified due to zeta wire offset/dislocated from roller accumulator and lead the wire damaged. The wire was dislocated due to gap for adjustment roller is too big (Original Design).

CA:

Fabricate new design for accumulator adjustment shaft.

Problem Handling:-

Production performed un-spiralling, removed affected wires and re-weld before proceeding spiralling process. Dimension after repaired are all within criteria and accepted as per DP-QCP-08DAQT001.

Defect Photos

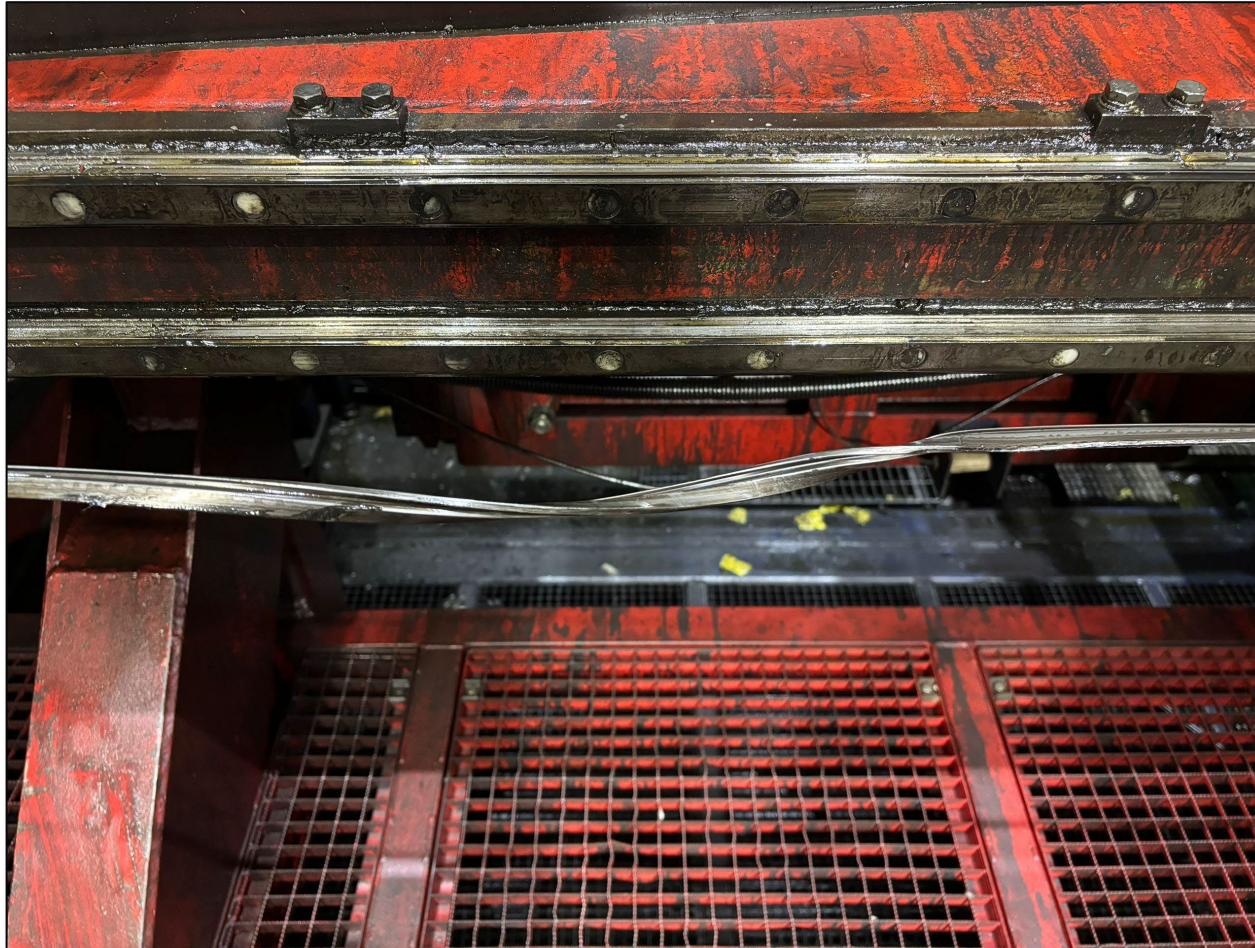


Figure 1 : Zeta wire damage was detected after accumulator at length 768.2m.

Root Cause

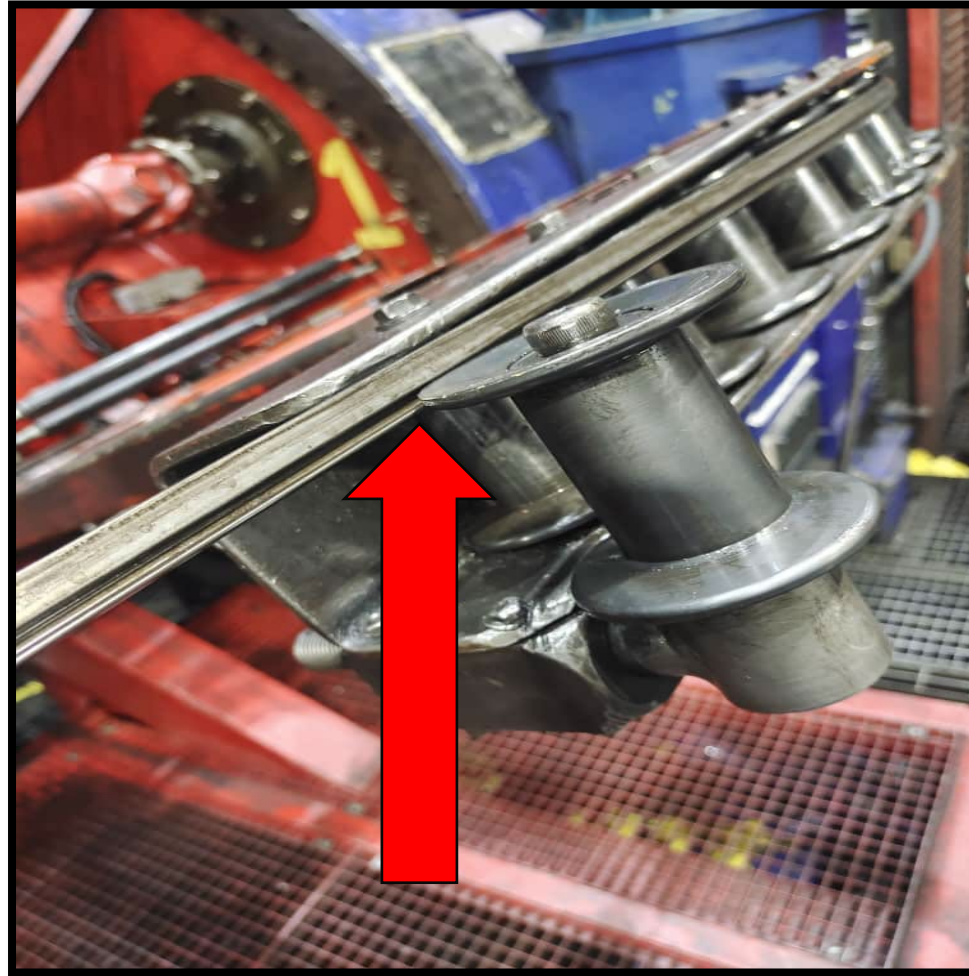


Figure 2 : The root cause was identified due to zeta wire offset/dislocated from roller accumulator and lead the wire damaged.

Photo After Repaired



Figure 3 : Production performed un-spiralling, removed affected wires and re-weld before proceeding spiralling process. Dimension after repaired are all within criteria and accepted as per DP-QCP-08DAQT001.

THANK YOU

