

QER 10553

QER: MERAKES EAST PROJECT SF216608C002.03 – Intermittent superficial scratches

Rev 0



Pipe section / Details

Item	Traceability / identification
Project number	SF216608C002
Project name	MERAKES EAST PROJECT
Pipe section	SF216608C002.03
ST number	ST254.72048
Affected layer / equipment	Zeta vault spiralling
Length affected	662.4m until 664m
Drawing number / MP code / STA / Dimension	ZETA 12 FI 11(MP746)

Overview of anomaly

Problem Description :-

During the zeta spiraling of MERAKES EAST PROJECT SF216608C002.03 (ST254.72048), intermittent superficial scratch due to roller mark on the zeta wire was detected at start length 662.4m until 664m on pipe.

The details of measurement are as per below.

- Depth: 15um
- Upsetting: 23um

Root Cause :-

The root cause was due to the roller phosphating coating is not suitable for FI11 wire grade.

Problem Handling:-

According to project acceptance criteria CD_216608C002_str25472048_TR01-09_rev0_An_Pressure vault, the maximum allowable criteria for the depth of longitudinal scratch in red areas is 100um and for the maximum upsetting is 50um. Thus, this defect was accepted as it is.

Defect Photo



Figure 1 : Intermittent superficial scratch due to roller mark on the zeta wire was detected at start length 662.4m until 664m on pipe.

Plastic copy measurement

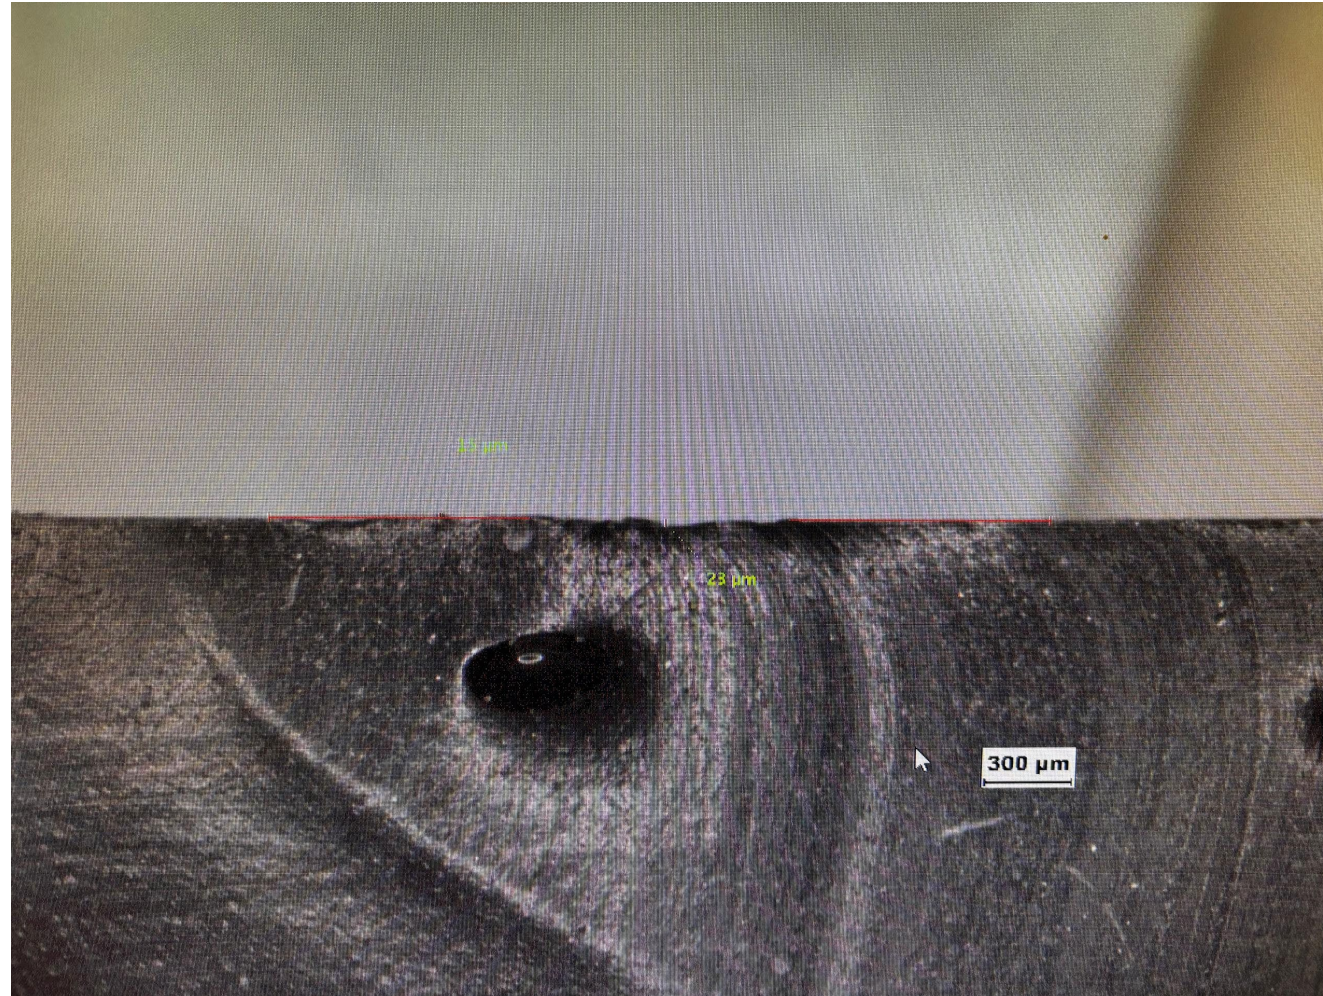


Figure 2 : According to project acceptance criteria CD_216608C002_str25472048_TR01-09_rev0_An_Pressure vault, the maximum allowable criteria for the depth of longitudinal scratch in red areas is 100μm and for the maximum upsetting is 50μm. Thus, this defect was accepted as it is.

Defected roller 3B



Figure 3 : The defect was generated due to wear of roller 3B table 1.

THANK YOU

