

QER 11066

QER: MERAKES EAST PROJECT SF216608C002.06 - Longitudinal scratches on zeta wire



Pipe section / details

Item	Traceability / identification
Project number	SF216608C002
Project name	MERAKES EAST PROJECT
Pipe section	SF216608C002.06
ST number	ST254.72048
Affected layer / equipment	Zeta vault spiralling
Length affected	806.8m until 809.4m
Drawing number / MP code / STA / Dimension	ZETA 12 FI 11(MP746)

Overview of anomaly

Problem Description:-

During the zeta spiraling of MERAKES EAST PROJECT SF216608C002.06 (ST254.72048), longitudinal scratches on zeta wire was detected at start length 806.8m until 809.4m on pipe.

The details of measurement are as per below.

- Depth: 57um
- Upsetting: 68um

Root Cause:-

The Scratches was observed from incoming wire in bobbin #011, Therefore, the bobbin was replaced and quarantine for further investigation.

The root causes are as below:

1. Suspect wire escape from path of roller and make contact to locking roller at accumulator
2. Suspect wire escape from path of roller at straightener roller.

Problem Handling:-

According to project acceptance criteria CD_216608C002_str25472048_TR01-09_rev0_An_Pressure vault, the maximum allowable criteria for the depth of surface defects is 100um and for the maximum upsetting is 50um. Thus, this defect depth was accepted as it is. However, the upsetting defect has been removed by buffing.

Longitudinal scratches on zeta wire

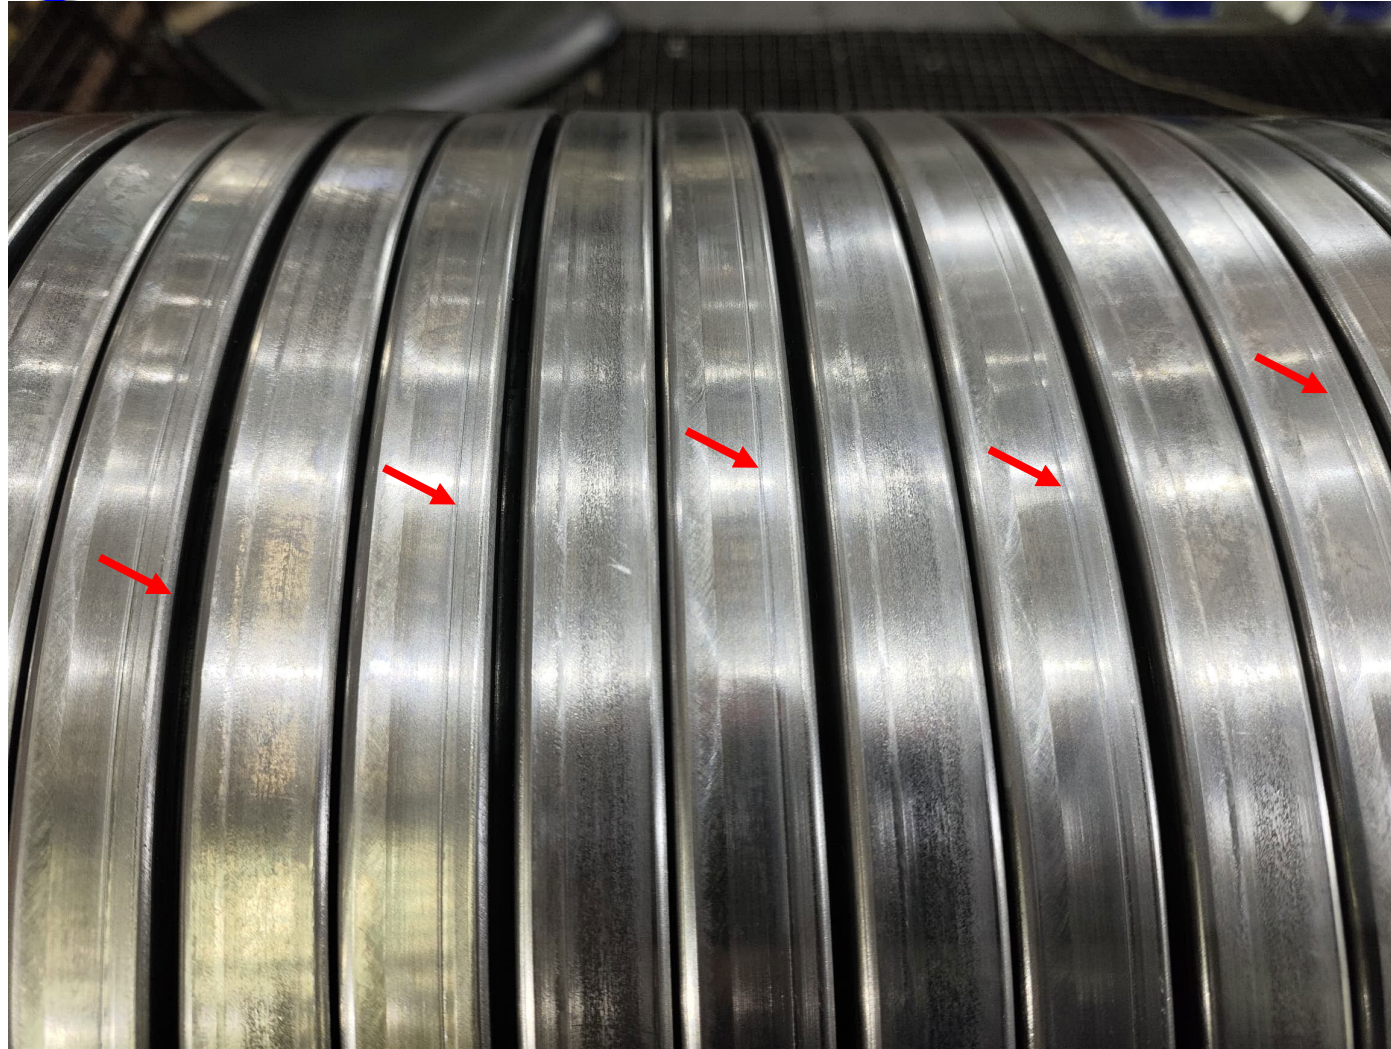


Figure 1 : Longitudinal scratches on zeta wire was detected at start length 806.8m until 809.4m on pipe.

Root Cause

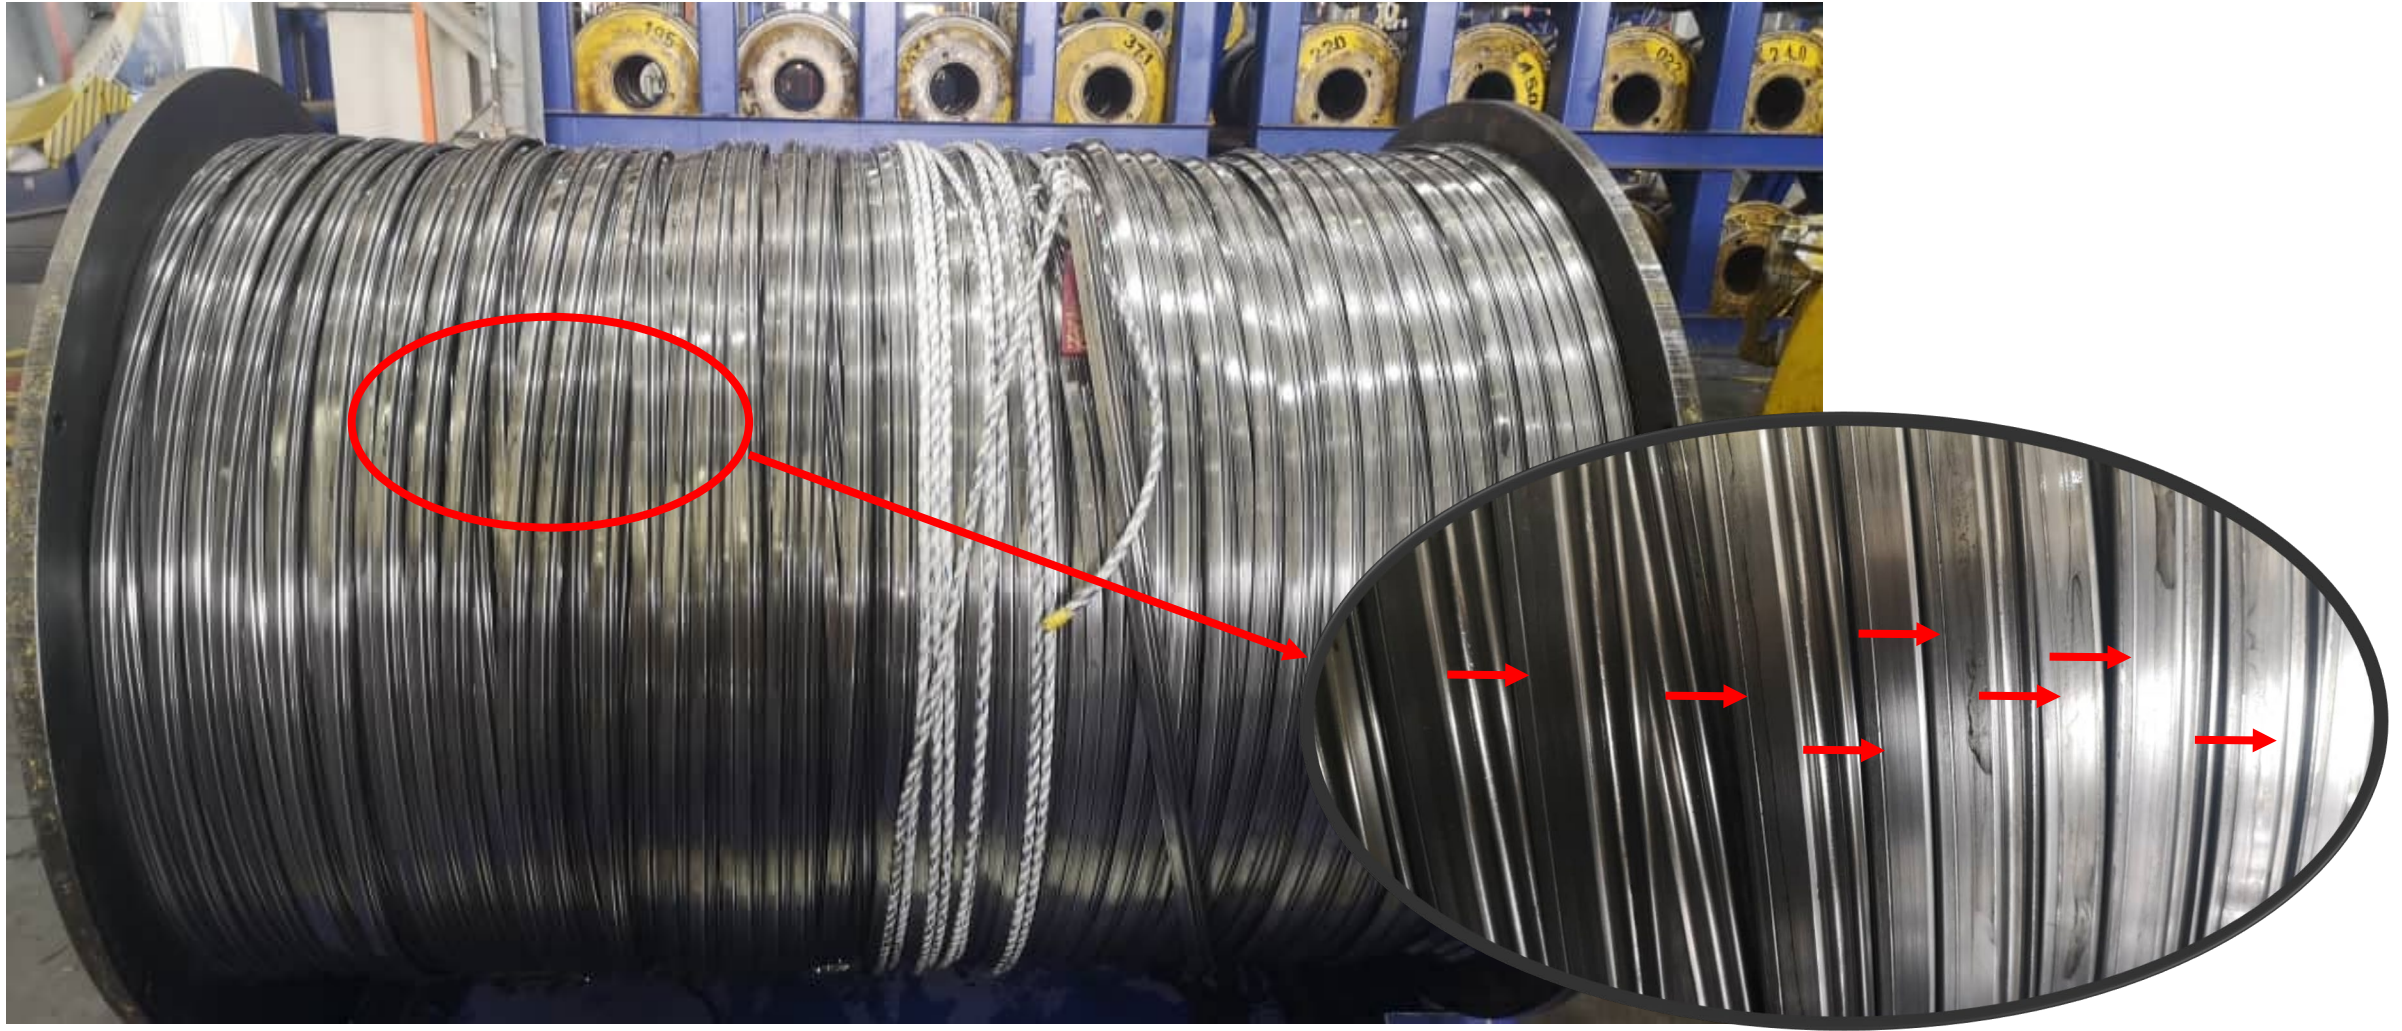


Figure 2 : The Scratches was observed from incoming wire in bobbin #011, Therefore, the bobbin was replaced and quarantine for further investigation.

Plastic copy measurement

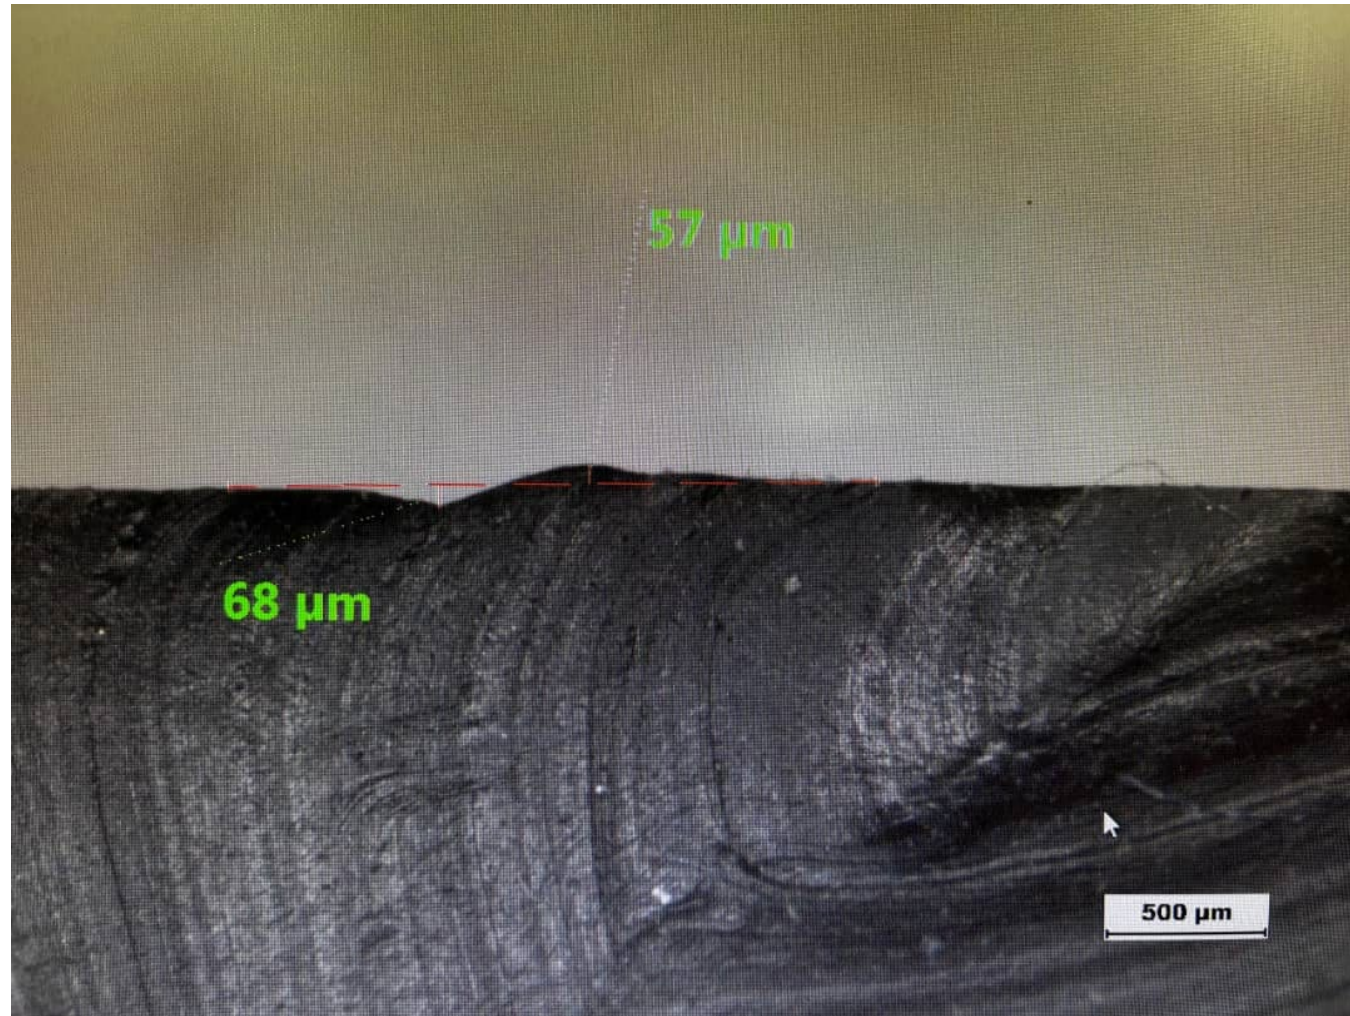


Figure 3 : According to project acceptance criteria CD_216608C002_str25472048_TR01-09_rev0_An_Pressure vault, the maximum allowable criteria for the depth of surface defects is 100μm and for the maximum upsetting is 50μm.

Repaired photo



Figure 4 : Defect depth was accepted as it is. However, the upsetting defect has been removed by buffing.

THANK YOU

