

QER- 10719

QER: AGOGO FULL FIELD DEVELOPMENT (NDUNGU) SF300824C005.F1-F8 - Zeta wires unlocking



Pipe section / Details

Item	Traceability / identification
Project number	SF300824C005
Project name	AGOGO FULL FIELD DEVELOPMENT (NDUNGU)
Pipe section	SF300824C005.F1 – F8
ST number	ST050.10529
Affected layer / equipment	Zeta pressure vault spiraling
Length affected	1336.8m till 1336.9m
Drawing number / MP code / STA / Dimension	Zeta wire 6.2 FI09 (MP205)

Overview of anomaly

Problem Description :-

During the zeta spiraling of AGOGO FULL FIELD DEVELOPMENT (NDUNGU) SF300824C005.F1-F8 (ST050.10529), zeta wire unlocked was detected at length 1336.8m to 1336.9m on the pipe.

Root Cause :-

The suspected root cause was due to:

1. Unbalance brake tension between 2 bobbins.
2. Pipe unstable during running with max speed 100% due to issue with mousetrap no.1 (the shaft bent cause motor trip).

Problem Handling:-

Reparation by un-spiral has been performed to re-position the wires to be in a good spiral. Thus, this reparation was accepted as it is and the dimensional after the repair is within the criteria.

Defect Photo

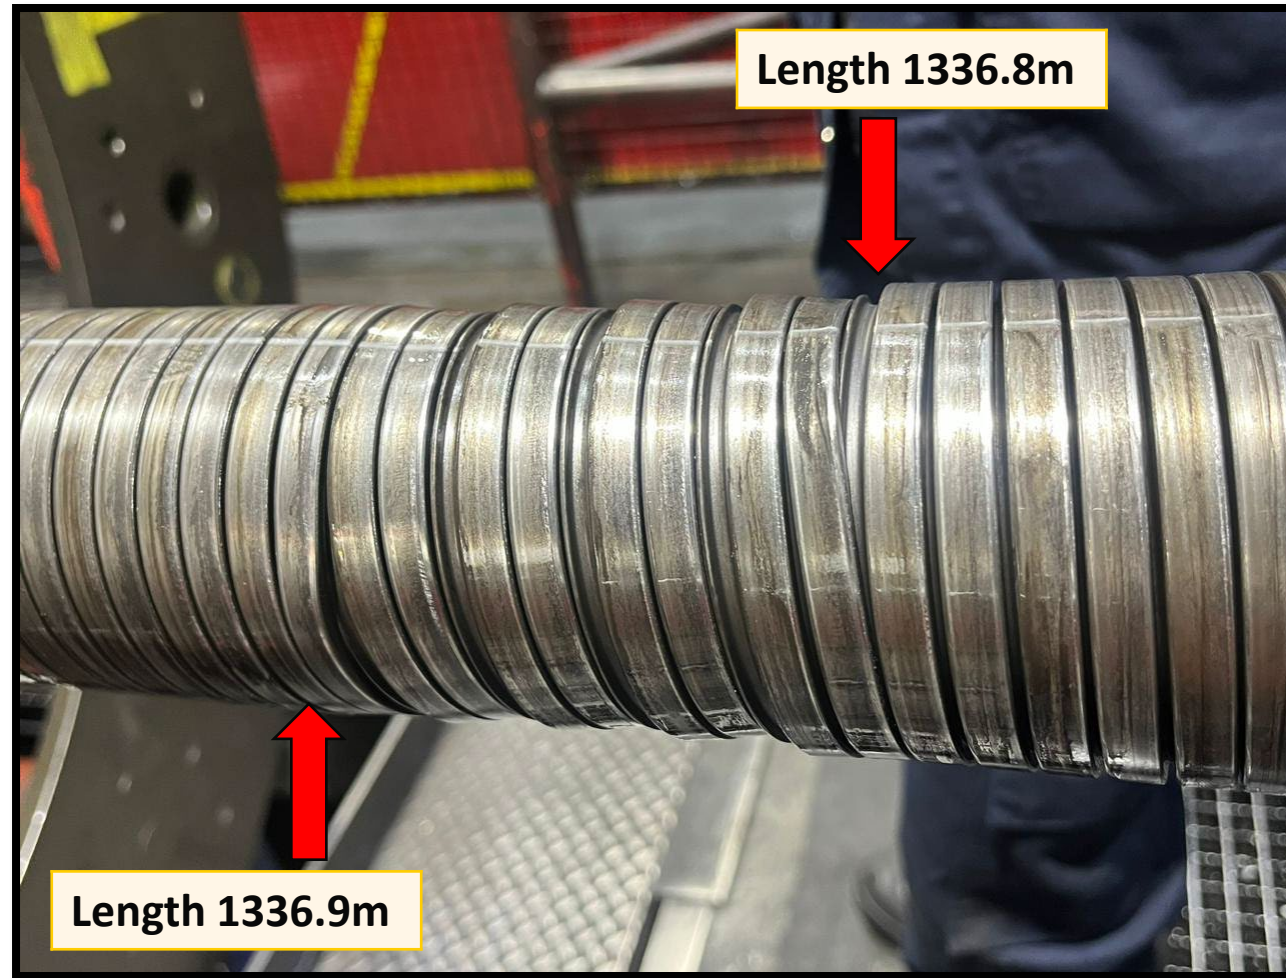


Figure 1 : Zeta wire unlocked was detected at length 1336.8m to 1336.9m on the pipe.

Pressure Sheath Surface



Figure 2 : Surface condition of pressure sheath after complete un-spiral.

Photo After Repaired

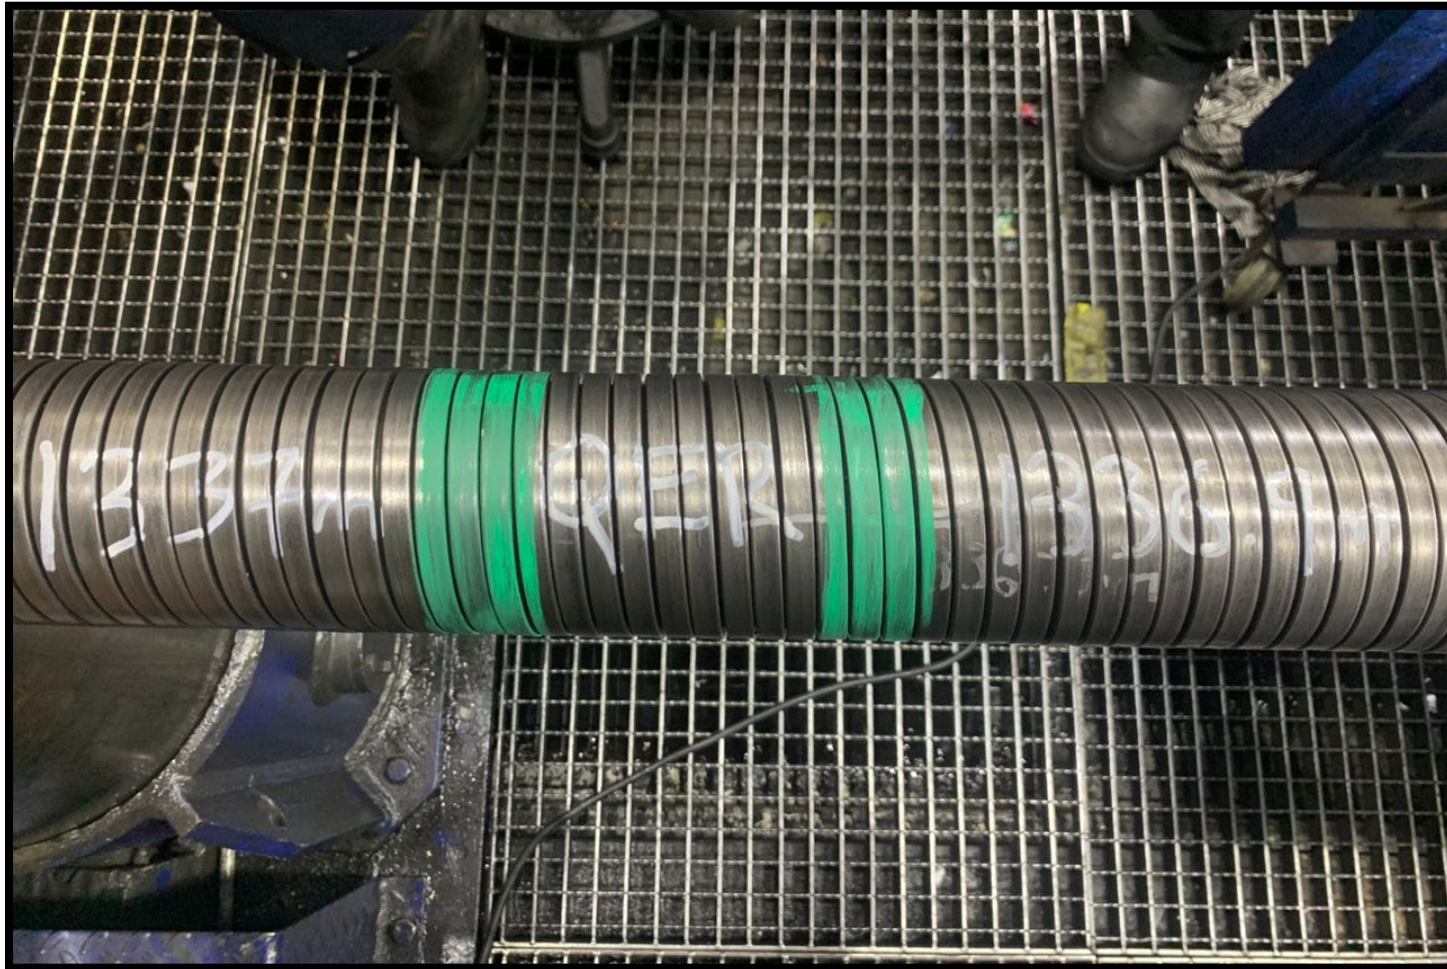


Figure 3 : Reparation by un-spiral has been performed to re-position the wires to be in a good spiral. Thus, this reparation was accepted as it is and the dimensional after the repair is within the criteria.

THANK YOU

