

QER11691

QER: JULIMAR DEVELOPMENT PHASE 3 SF301229C002.05+06+07 - Zeta wires unlocked



Pipe section / Details

Item	Traceability / identification
Project number	SF301229C002
Project name	JULIMAR DEVELOPMENT PHASE 3
Pipe section	SF301229C002.05+06+07
ST number	ST203.72124
Affected layer / equipment	Zeta Pressure Vault
Length affected	44.8mm
Drawing number / MP code / STA / Dimension	ZETA 6.2 FI09 (MP205)

Overview of anomaly

Problem Description :-

During the zeta spiraling of JULIMAR DEVELOPMENT PHASE 3 SF301229C002.05+06+07 (ST203.72124), zeta wire unlocked was detected at length 44.8m on the pipe.

Root Cause :-

The root cause due to wires entangled in bobbin #002 during running causing wire damage and wire unlock at laying point.

CA:

Re-brief to the winding crew on the importance of wire arrangement in bobbin during winding process.

Problem Handling:-

Reparation by un-spiral has been performed to re-position the wires to be in a good spiral. Thus, this reparation was accepted as it is and the dimensional after the repair are within the criteria.

Defect Photos



Figure 1 : Zeta wire unlocked was detected at length 44.8m on the pipe.

Wire damaged due to entangled

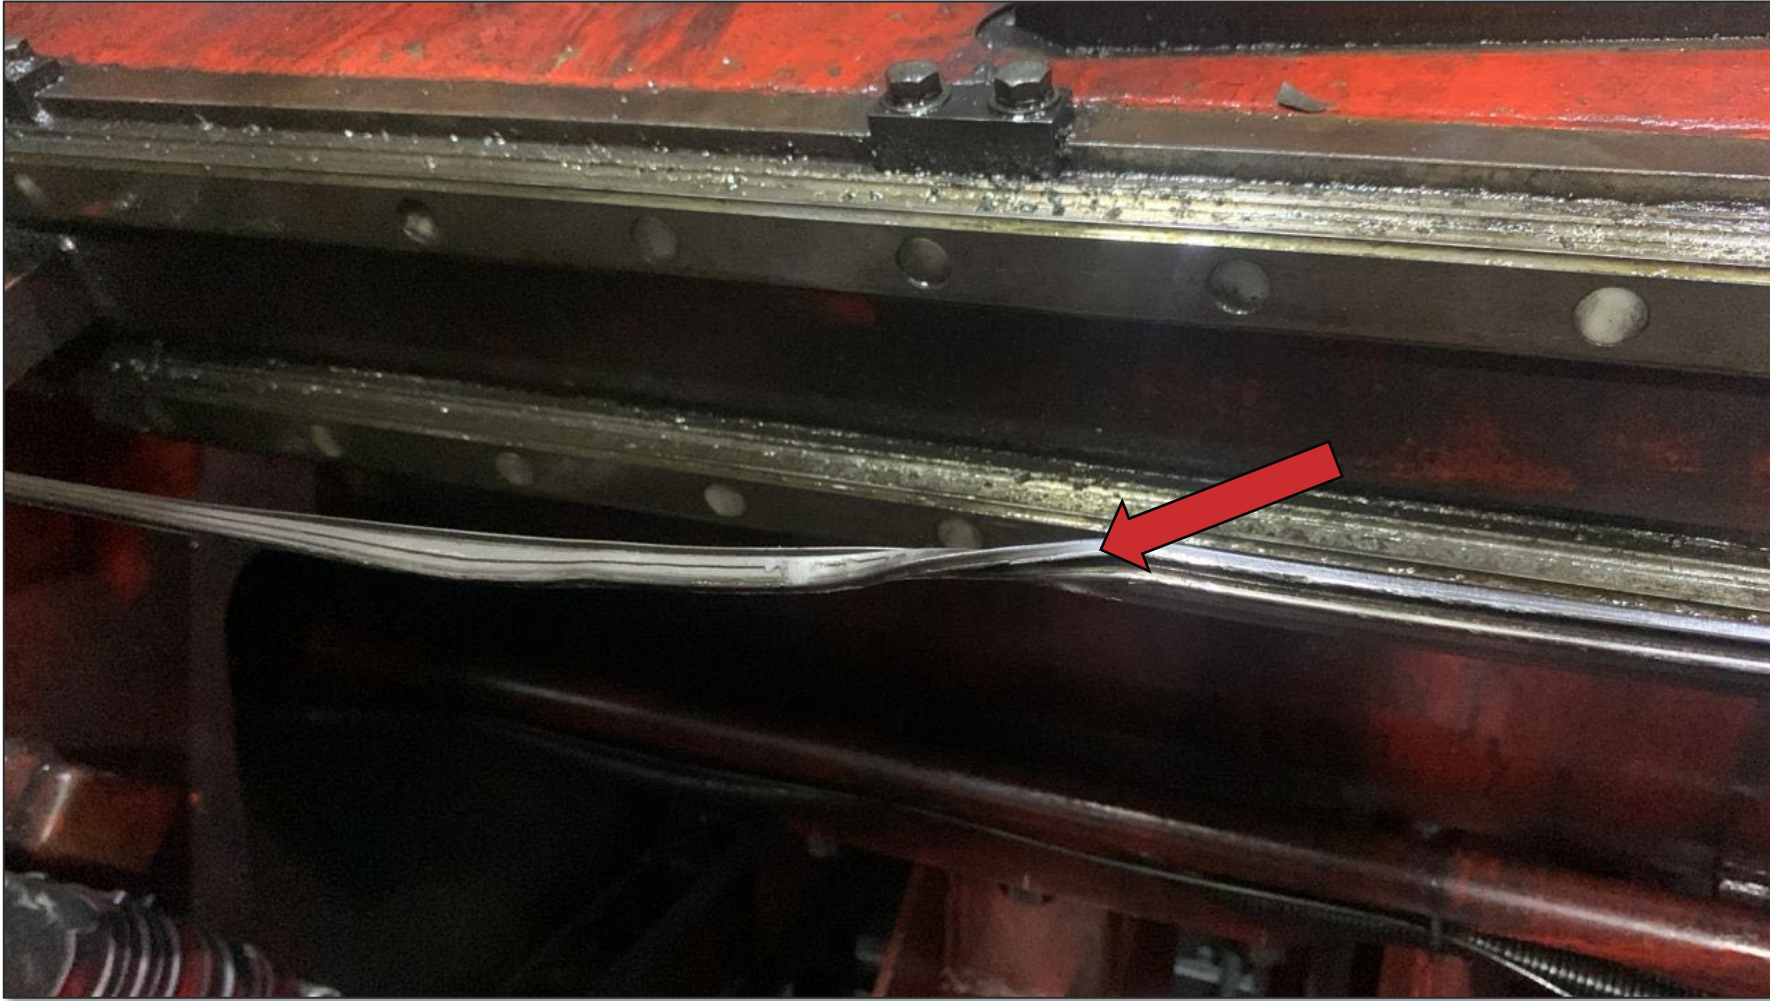


Figure 2 : Damage wire detected due to entangled during running

After repaired

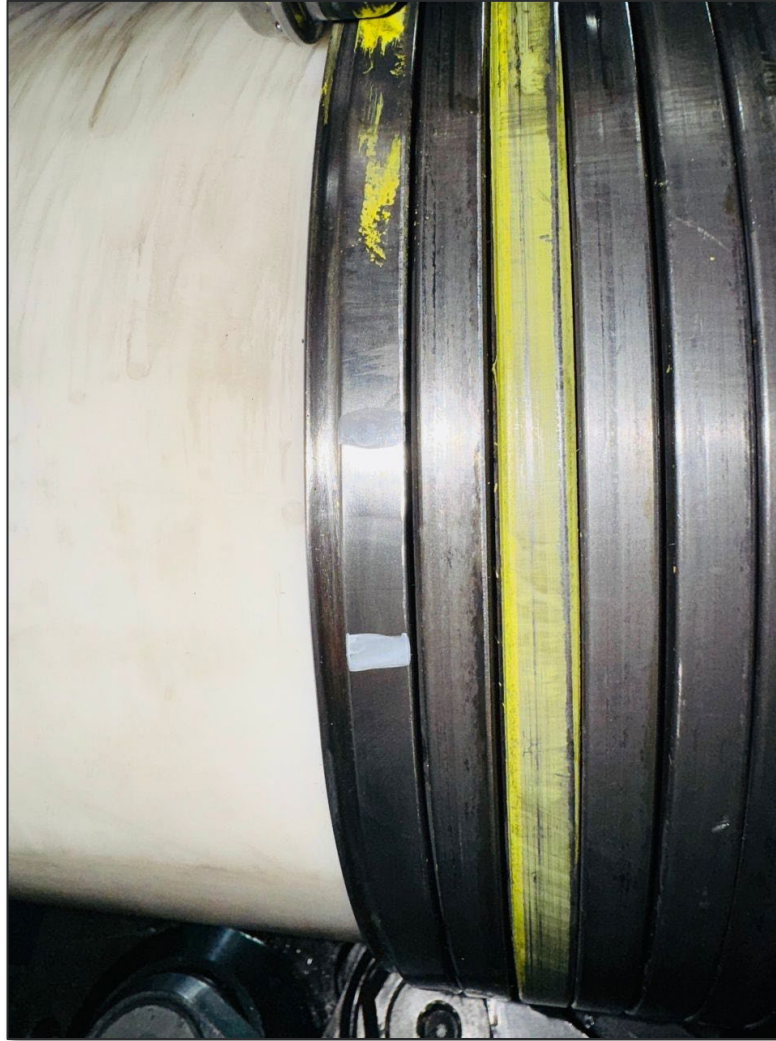


Figure 3 : Reparation by un-spiral has been performed to re-position the wires to be in a good spiral. Thus, this reparation was accepted as it is and the dimensional after the repair is within the criteria.

THANK YOU

