UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles ROAA	**Date:**	10.08.22 – 11.08.22
Site Address:	54 Templar Rd, Erskine Park NSW 2759	**Site Contact:**	Trent Cleminson
		Phone:	0438287226
Customer PO #:		**Internal Job #:**	2383

Subject: Check platformer 9x8 VSP tool

Equipment Type:	Serial Number:	Customer Line # (if applicable):	Area
Platformer	A17A-11614	Line 4	Meat processing room

Equipment condition:

Normal

Work Performed:

Wednesday 10/08/22

Attend the site.
Inspect the top tool found no level between plate.

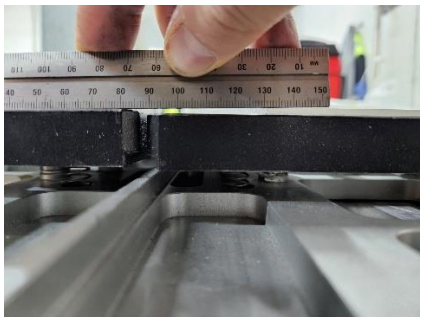

Undo folding plate and found that columns were different lengths.
Tried compensating level by washes so it needs to order the whole set plus spare

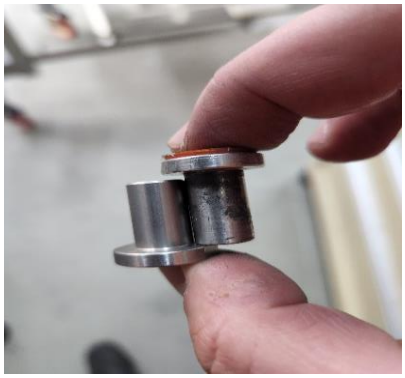

Undo plate from folding plate and found not enough springs only 6 but according to the drawing it should be 10 in each so totally 50 pcs. Put extra springs (use customer stock).

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

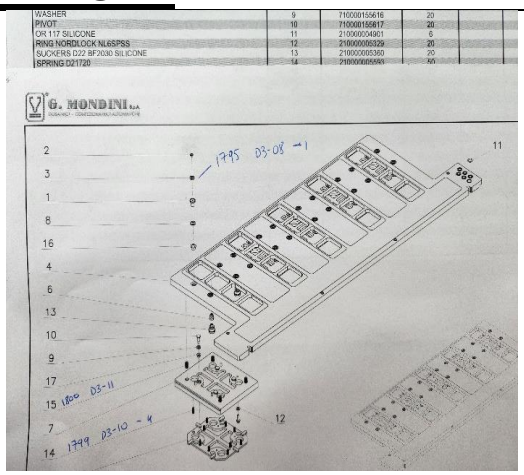

Replaced worn dampers (Use customer stock)
Replaced worn springs (use customer stock)
Cleaned all bushes
Installed all folding plates back to the frame and level up.
Inspect bottom tool
Replaced t-seal and found worn moulding.

Thursday 11/08/22

Attend the site

- Monitored production on start-up
- Adjusted the following settings and saved
    1. Adjust pressure for blow air to moulding from 6Bar to 3Bar, this allow a better and softer forming.
    2. Adjust the blow air timing by increasing to help push film off pre-heater
    3. Adjust the height for lower tool from 80mm to 70mm.
    4. Increased the pre-heater temperature from 123C to 130C

- We would like to change the distance belt conveyor size to wider which will prevent film sheets from slipping, quote to be send.

GENERAL SERVICE REPORT

- The linear bearing need to be replace with too much play and affect the P&P loading position.
- The foam for loading P&P needs replacing ASAP or next service.
- Recipes for Medium DOT were deleted and now only 2 recipes to be used.
- Service for Platformer and Trave 590 to be arranged
- Wait until production operator changed film three times and no issue.

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
710000150722	Damper	5	Yes ☐	No☒
210000005594	Spring	14	Yes☐	No☒
210000005593	Spring	21	Yes☐	No☒

STATUS		
Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments: Full service of platformer

RECOMMENDED SPARE PARTS

UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Tray pack Line 2 Trave 1000		
Part Number:	**Description:**	**Qty:**
210000002269	Plates (bearings)	4
710000151063	Plate mousse	1
710000152137	Belt XVT	1
710000151064	mousse	1
710000145753	column	30
210000005593	Spring D21720	20
210000005594	Springs D22010	20

TECHNICIAN HOURS					
Vlad	**10/08/22**			**11/08/22**	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	08:00	08:30		04:30	05:00
Onsite:	08:30	17:00		05:00	09:00
Travel From Site:	17:00	17:30		09:00	09:30
Travel To Site:					
Onsite:					
Travel From Site:					

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:		X	
Technician:	Vlad Smagin		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au