UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles ROAA	**Date:**	12th and 13th February
Site Address:	54 Templar Rd, Erskine Park NSW 2759	**Site Contact:**	Alan Villa
		Phone:	0410 556 153
Customer PO #:		**Internal Job #:**	4357

Subject: XT500 film trial Platformer

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590	A17A-11614	Line 4
Platformer	A17A-11614	Line 4

Equipment condition:

Work Performed:

Monday 12th

- *Production stopped for the afternoon shift so we could do some work in getting all four plate working and some repair work.*
- *With the production stopping we could fully test the new film and understand how to run at a lower temperature.*
- *We had to drill and install threaded inserts on heater plate no4 to install bracket clips for Diffuser.*
- *Two of the Diffuser arrived from recoating but the holes needed to be opened so maintenance started working on opening the holes.*
- *The two diffuser sent away for recoating were damaged by opened the holes too big of which we had to try clean up to use for our trials.*
- *We started testing the film with low temperature and noticed the vacuum switches off when the diffuser turns at 90 degrees and then back on causing the film to slip off.*
- *Normally we only need to pulse the vacuum to hold the film in place but with this film we need to hold the vacuum on for the full cycle, due to the film lifting on the corners loosing vacuum.*
- *The parameter 47 "vacuum pulse time for maintain film" had to be set at "0" to keep the vacuum on through the turning cycle.*
- *So we manage the run all four diffuser and back plate at a low temperature which ran okay*
- *The distance belt was adjusted to try get a good balance between all trays.*

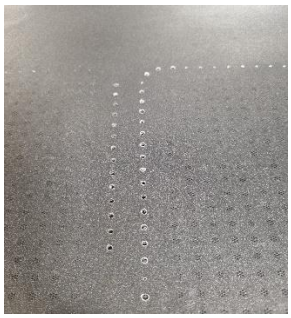

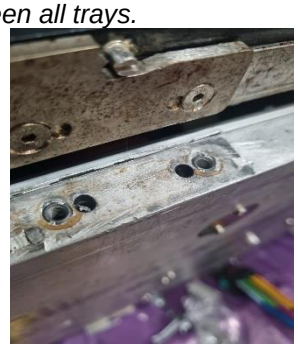

Tuesday 13th

- *We started up with production running on XT500 lower film which ran well with very little changes.*
- *We changed over to running off two plates number 2 and 4 with good results*
- *Pack speed on 2 plates was set at 40ppm.*
- *Trays seem to look better with only two plates then four indicating the film prefers low heat.*
- *We then moved over to the Trave 590 to understand the cycle as they were getting some reworks.*
- *The recipe was adjusted to try understand what's the best outcome of an aggressive compensation or soft compensation in relaxing the film.*

GENERAL SERVICE REPORT

- *Due to the product too big for the trays we found the best result was an aggressive compensation and now that the film is forming at a lower temperature the trays are forming better.*
- *The reworks will still need to be monitored over time to see the outcome.*

Note: *1 hour for report time and recoil parts to be charged.*

Marc Ashford	**TECHNICIAN HOURS Monday 12th**			**Tuesday 13th**	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	13:00	14:00		05:30	06:30
Onsite:	14:00	23:00		06:30	16:00
Travel From Site:	23:00	23:30		16:00	17:00

Paolo Orisio	**TECHNICIAN HOURS Monday 12th**			**Tuesday 13th**	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	13:00	14:00		05:30	06:30
Onsite:	14:00	23:00		06:30	14:00
Travel From Site:	23:00	23:30		14:00	15:00

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:		X _____	13th February
Technician:	Marc Ashford		