UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Bindaree Food Group	**Date:**	11.05.2024
Site Address:	6 Taree St Burleigh Heads	**Site Contact:**	Leonard Dunn
		Phone:	0417 651 247
Customer PO #:		**Internal Job #:**	4538

Subject: Gas Mixer Callout

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590	A/21/A-12629	2

Equipment condition:

Line 2 – Machine operating, on arrival

Work Performed:

Line 2

- Received call regarding issue with gas mixer on the Mondini night before
- Arrived onsite machine was running in production
- Remove Dansensor unit from Mondini, which requires removing the pusher arm end panel
- Take Dansensor to workshop and dismantle fittings only
- Clean out debris found throughout fittings and seal back into the machine
- Re install Dansensor and close off pusher arm cabinet
- Install 2 of the same regulators on the supply lines c02 & 02
- Isolate 1 of the 02 lines and T piece off the remaining 02 line to supply both ports. This way we are controlling the 02 accurately
- Dampen the c02 & 02 pressure to be 8.7 bar. This means any fluctuations above these values will remain consistent as we previous suspect fluctuations between 10-12 bar may be causing some dramas
- Adjust and test Dansensor unit in empty packs, test with analyser
- On last visit the readings on Dansensor were 66% 02 & 34% c02 to achieve 80% 02 & 20% c02 in pack
- After cleaning out the Dansensor out values came closer in line to 70% 02 & 30% c02 to achieve 80% 02 & 20%
- Run machine in production for 1 hour before leaving site with no issues

GENERAL SERVICE REPORT

Gas testing before running line in production

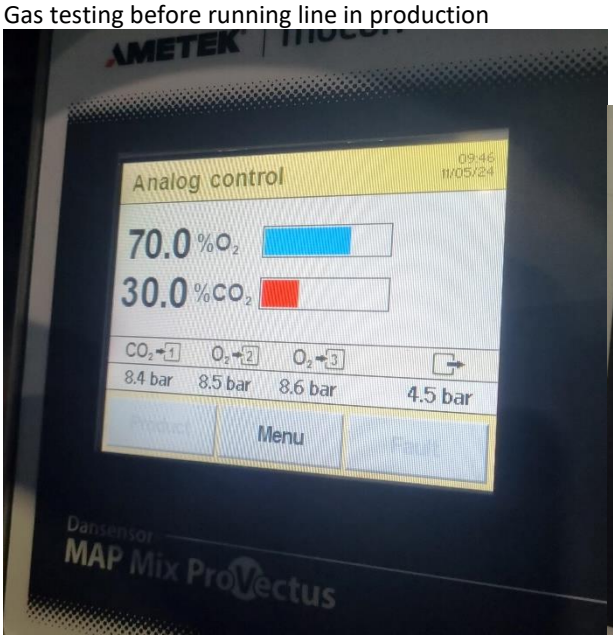

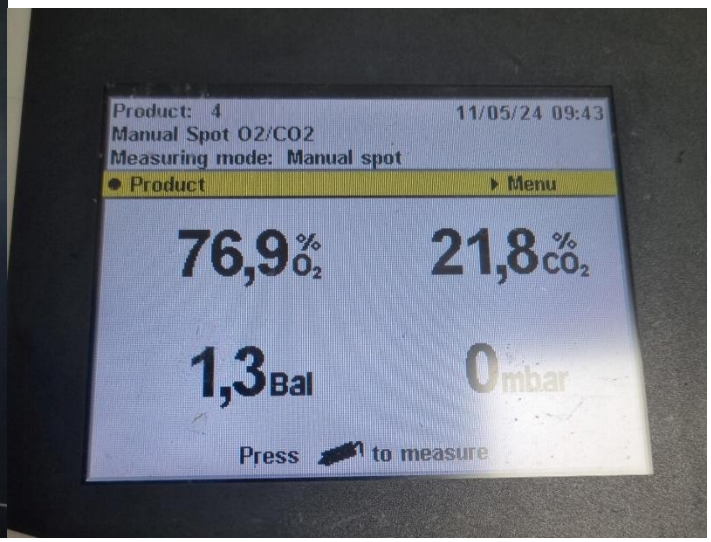

UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes ☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Tested in production		
Revisit Required?	Yes☐	No☒
Comments:		

RECOMMENDATIONS
Comments: Contact Dansensor and put in contact directly with Bindaree on visiting site and potentially sending a spare to site to service the unit in the Mondini

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	06:30	08:00			
Onsite:	08:00	11:00			
Travel From Site:	11:00	12:45			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Leonard Dunn	X _____	11.05.24
Technician:	Anthony		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au