UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Hilton	**Date:**	04/12/2025
Site Address:	22 Seena Place, Heathwood	**Site Contact:**	Kane Burnet
		Phone:	
Customer PO #:		**Internal Job #:**	5863

Subject: **Production Support various lines**

Equipment Type:	Serial Number:	Customer Line # (if applicable):

Equipment condition:

Work Performed:

- Travel to site to assist with any production related issues on all lines.

Line 6.

- Line 6 dp pacer upstream of deviator clips the trays. Adjusted the delay closing. All good

Line 9.

- Line 9 one side is sealing good other side deformation of trays badly. See the tray depth different for the 2 sides

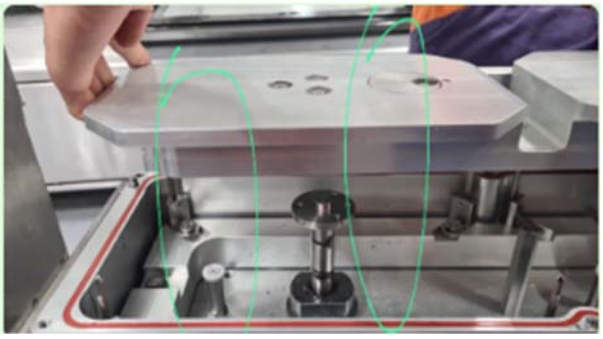

- The stopper counter plates was wrong orientation.

Line 4.

- Spoek with Martina about taking the tool out of line 4 to inspect the water leak issue from the bottom tool.
- Pulled the tool out and found some problems on the o rings and the bottom tool.

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

-

- O rings worn and the tool had some build up of some sort. I polished it of and changed the o rings and tested afterwards ok.
- I also changed the Home pposition for the tool change recipe to be the same as the Liquid tool recipe and saved it.

Line 1.

- Line 1 came up with film not ready in very random spots. Eventually I saw it made the film end sensor. Decreased film real speed from 85 to 80.

Line 3.

- Sealing issues. No matter what changes I make in the parameters. I cannot create magic to fix this problem. There is nowhere for the film to go under a product that is too hard to press down.
-

GENERAL SERVICE REPORT

Workshop.

- Checked the shuttle that is still lying in pieces and see all the shuttle plates are in bad condition and needs to be sent for recoating.
- Went upstairs and found some recoated plates upstairs. Started to put the plates together with other parts with help from the tool team.

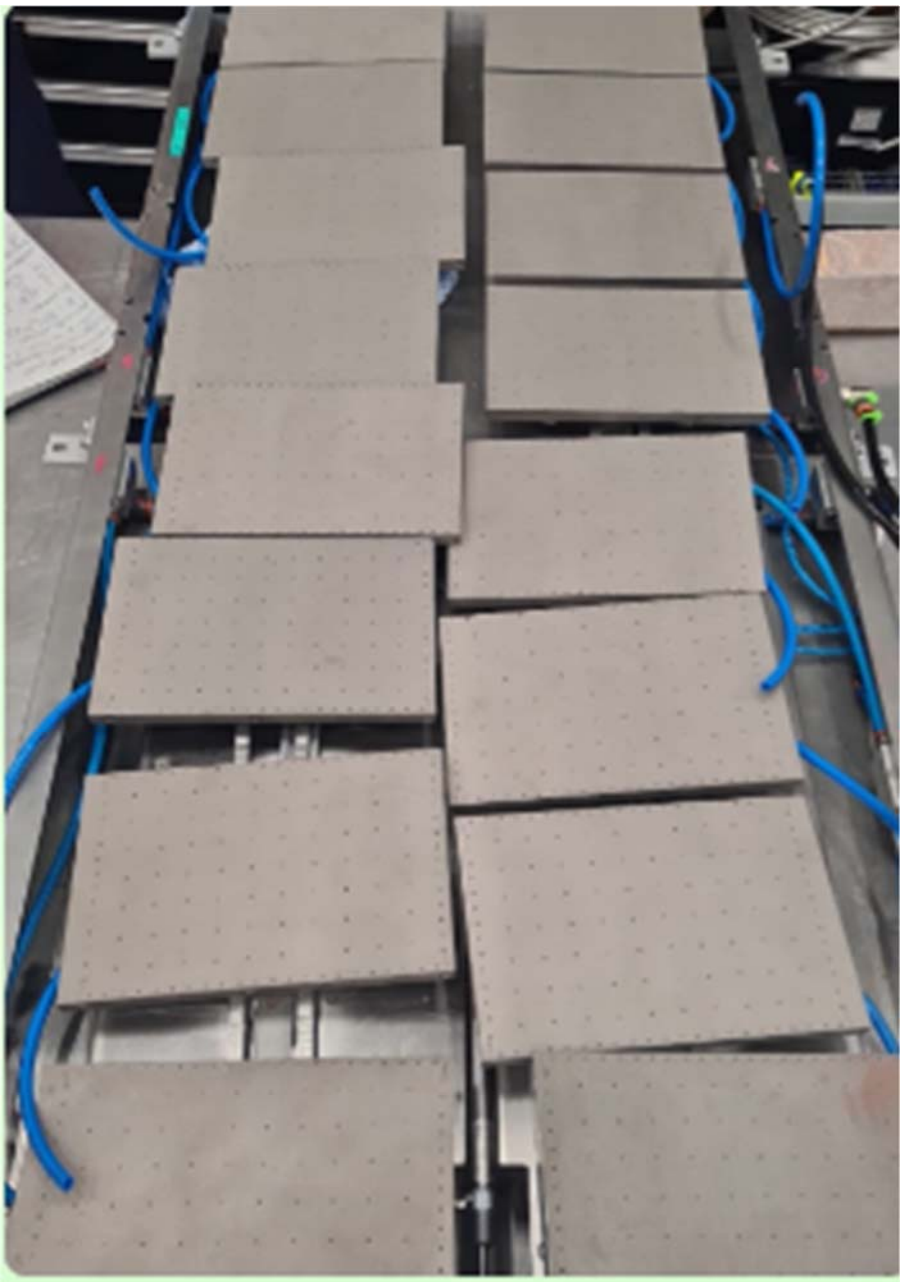

Found some recoted plates for the small skin shuttle of line 1. Hea 1057

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Good		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS	**Jacques**	
Time	**Start**	**Finish**
Travel To Site:	05:00	06:00
Onsite:	06:00	14:00
Travel From Site:	14:00	15:00
Remote assistance:		
Report writing:	30 Min	
Overnight stay	☐	
Overnight stay with flights	☐	

TECHNICIAN HOURS	**Paolo**	
Time	**Start**	**Finish**
Travel To Site:		
Onsite:		
Travel From Site:		
Remote assistance:		
Report writing:		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

Overnight stay	☐
Overnight stay with flights	☐

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Kane Burnet, Diego Arguello	X	05/12/2025
Technician:	Jacques		