UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles ROAA	**Date:**	5/10/2022
Site Address:	54 Templar Rd, Erskine Park NSW 2759	**Site Contact:**	Trent Cleminson
		Phone:	0438 287 226
Customer PO #:		**Internal Job #:**	3696

Subject: New film trial

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590	A17A-11614	Line 4
Platformer	A17A-11614	Line 4

Equipment condition:

Called in to look at the Trave not sealing and Platformer not forming.

Work Performed:

Trave 590;

- They were running okay when I arrived and found they start with wrong recipe reason for sealing problems, once the correct film was loaded they ran well.
- While they ran we noticed one of the shuttle pre-heater plate was not fully dropping down and heating the film, this indicated the cylinder needs replacing. The tool was still running okay but will need to replace the cylinders once they change over.

Platformer

- The Platfomer was running but trays are not in the best condition and can be due to the following problems, which need looking into as follows
  1. The pick and place foam needs replacing, this plays an important part of the cycle to lay the sheets even.

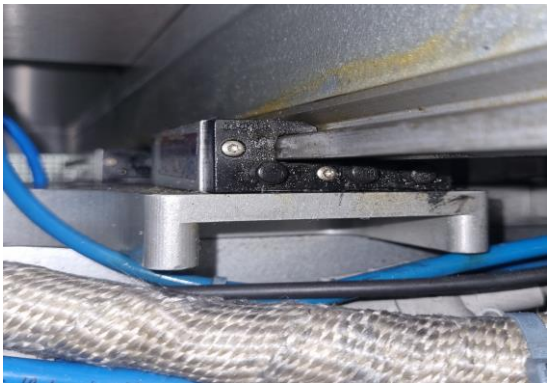

  2. The pick and place linear bearings need replacing, this plays an important part for correct positioning of film sheets.
  3. The Preheater plates damaged due to worn dampers on the pick and unload plates, this could have been prevented with regular services
  4. The Preheater plates have blocked vacuum ports due to melted film and contamination; this plays an important part of the forming trays

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

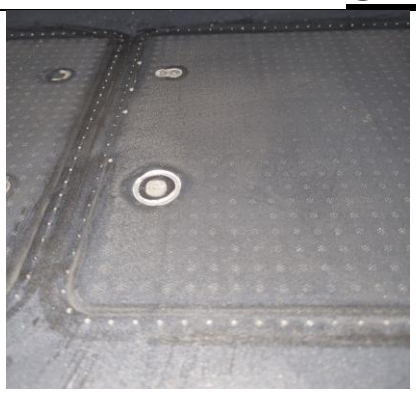

5. Lower mould tool has bad score markings that can affect sealing process for forming.
6. The pick and unload plates are all uneven indicating damage springs or bend.
7. The complete frame for pick and unloading needs replacing which has been taped-up due to vacuum leaks.

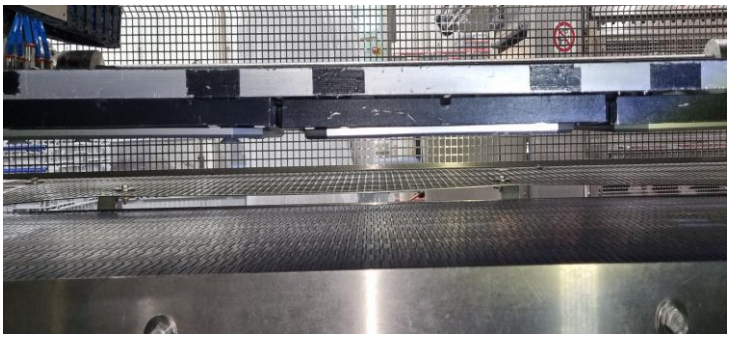

Please Note all above play an important part for forming trays.

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:
The mondini tools need service and machine

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS Wednesday 5th					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	07:30	08:30			
Onsite:	08:30	10:30			
Travel From Site:	10:30	11:30			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:		X _____	5/10/2022
Technician:	Marc Ashford		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au