UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

Audit done by: Marc Ashford **Date:** 6/03/2022

RROA Coles

Mondini line A17A-11614

Platformer

Med DOT 9x8 tool

- *The lower moulding tool needs a full service which will include replacing all gaskets and springs.*
- *Lower moulding tool will need a full wash down*
- *Upper pre-heaters a total of four plates need major work, the Teflon is coming off, bad score markings as well blocked vacuum holes.*

- *Plate no 2 and 4 can't be used as they too badly damaged with blocked vacuum holes and damaged gaskets, the complete plates need replacing.*

- *Plate no 1 and 3 are still okay but starting to build up with contamination, please note the contamination is from the type film been used, if you compare to Trave DOT*

tooling which has no contamination on seal bars which run on the same principle but different film.

- *Missing stud pins which important for tool change over.*

- *Shuttle plate for pick and place after moulding needs a full service, this would include inspection of the plates and replacement of bushings, springs and inc.*

Large DOT tool

- *The lower moulding tool needs major service with missing end rubbers and Gaskets will need replacing as all springs.*

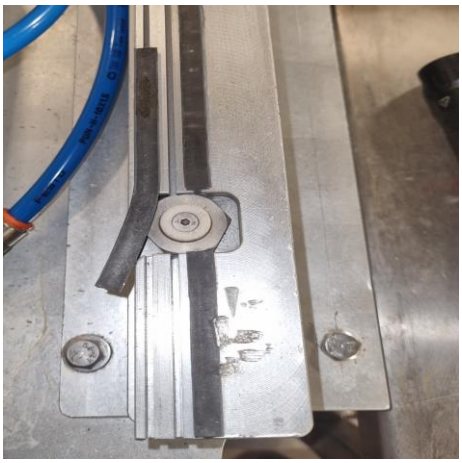

- *Lower moulding tool will need a full wash down.*
- *The upper pre-heater plates need replacing or send away for Teflon coating.*
- *The upper pre-heaters have bad score markings and missing studs.*
- *Shuttle pick and place after moulding needs major work with damaged springs' bend forming plates and dampers.*

- *This tool needs a complete check over to determine what parts need replacing.*

Large MAP tooling

- *The lower moulding tool needs a full service which will include replacing all gaskets.*
- *The springs will need inspection and might still be okay as this tool is hardly used.*
- *The upper pre-heaters have some bad markings due to worn dampers on pick and place.*

- *The upper pre-heater Teflon is worn and some vacuum hole blocked.*

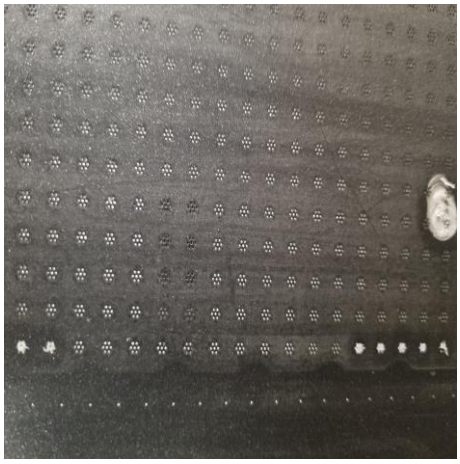

- *Shuttle pick and place after moulding is damaged and bend.*

- *Shuttle pre-heater tool needs major service to determine what needs replacing or repaired.*

Platformer machine

- *Back pre-heater plates have damaged insulation foam, but this part of the machine is not used when running on two upper pre-heaters*

- *The upper pre-heater need a good clean and some of magnet plate covers replaced.*

- *Inspect all magnets and found very few not working but still okay for now*
- *Need to replace the latches for plate to original type because one of the pre-heater plate fell and this might be because we not using original parts.*

- *The pick and unload insulation foam needs replacing*

- *The film roller bearings need replacing*

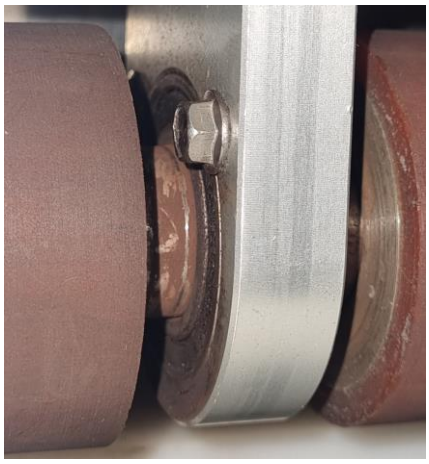

- *White nylon block under distance belt needs replacing, this part in important for the correct position of sheets.*

- *The complete machine needs full service*

<u>Trave 590 XL</u>

- *Deviator conveyor needs to be shorten*

- *Once the conveyor is removed bearings can be inspected*
- *Deviator cover to be removed and internal parts inspected*
- *Turning conveyor idle and drive bearings inspected*
- *Infeed and spacer belt bearings replaced*
- *Infeed and spacer belt nylon gears and drive gear bearings replaced*

- *Main air switch needs inspecting which should dump when safety doors open, not working.*
- *Full inspection will be needed on the Trave 590XL*
- *Gummy roller gasket needs replacing*

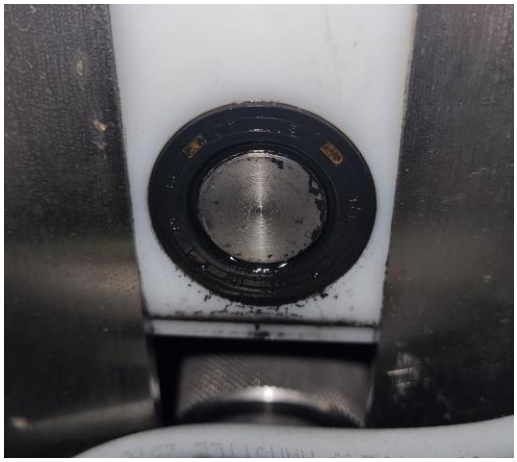

- *Gummy rollers and drive roller need wash down and starting to flatten out*

- *Scrap rewind gearbox oil needs replacing.*

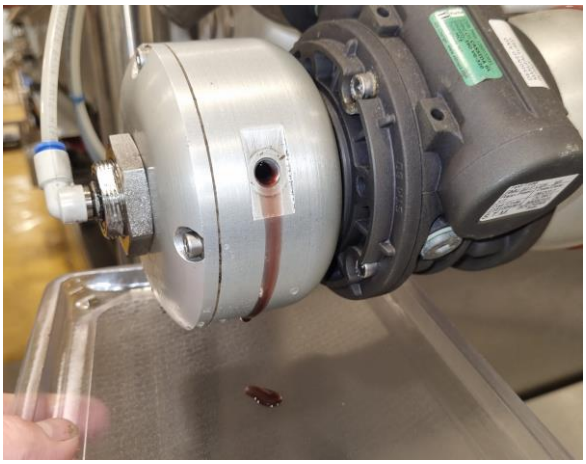

- *Vacuum pump filter was inspected and cleaned out*

- *Film roller circlip missing which can affect tracking.*

<u>Small DOT tooling and big DOT tooling</u>

- *The lower tool needs a full service by removing all counter tooling and hosed down.*
- *The lower tool O-rings and gaskets need replacing*
- *The lower tool needs full lubrication and all moving parts inspected*
- *The lower tool punching vacuum knifes need inspecting*
- *The lower tool springs need inspecting.*

- *Top head needs a full inspection*

- *Top head vacuum hoses need inspecting*
- *Top head needs lubrication*
- *Top head seal bars need full clean and Teflon coating*
- *Shuttle system need a major service where all vacuum ports need to be cleaned out.*
- *Shuttle plates need cleaning*
- *Shuttle plate pneumatics need inspecting*

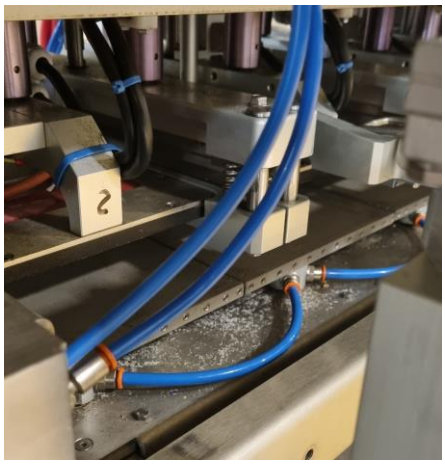

MAP tooling

- *The top head needs to be open and internal parts inspected*
- *Knifes need inspection*
- *Seal bars need cleaning and free of contamination*
- *Lower tool has a missing stopper.*

- *Lower tool counter tools need to be removed and inspected*
- *Foot plate and springs need inspecting.*

Big DOT tooling

- *The lower tool needs a full service by removing all counter tooling and hosed down.*
- *The lower tool O-rings and gaskets need replacing*
- *The lower tool needs full lubrication and all moving parts inspected*

- *The lower tool punching vacuum knifes need inspecting*
- *The lower tool springs need inspecting.*
- *Top head needs a full inspection*

- *Top head vacuum hoses need inspecting*
- *Top head needs lubrication*
- *Top head seal bars need full clean and Teflon coating*
- *Shuttle system need a major service where all vacuum ports need to be cleaned out.*
- *Shuttle plates need cleaning*
- *Shuttle plate pneumatics need inspecting*