UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Bindaree Beef	**Date:**	05/10/2025
Site Address:	6 Taree Street Burleigh Heads	**Site Contact:**	Joseph Brown
		Phone:	0434077565
Customer PO #:		**Internal Job #:**	5744

Subject: Line 2 breakdown – Meat belt not running

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590VGXL-S	A21/A12629	Line 2

Equipment condition:

Work Performed:

- After the onsite visit the previous Friday, during which the drive was replaced and the meat belt was brought back into operation, the belt unfortunately went into fault again after approximately five hours of production.
- The issue reported was the same — the belt was not running, yet no fault was displayed on the newly replaced drive.
- The client then replaced the drive again and also changed the motor, which showed signs of oil contamination inside the stator. The oil appeared to be leaking from the gearbox above. However, these actions did not resolve the issue, and the belt still failed to run.
- When I arrived onsite, I rechecked all the connections and found everything within specification. The motor tested electrically sound, and the drive safety circuit was confirmed to be functioning correctly. I then decided to test the belt motor independently, which was successful — the motor ran properly when powered directly (see photo with the cable connection).

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

- At this point, I decided to connect to the PLC, and after a few checks, I identified the issue: the motor was unable to run because the running cycle was being blocked by the photocell's **ON** state, which indicated a constant presence of meat.
- Although the photocell appeared to be working correctly, an internal short circuit was causing it to send a continuous **ON** signal.
- Once the photocell was replaced, the system operated normally again.

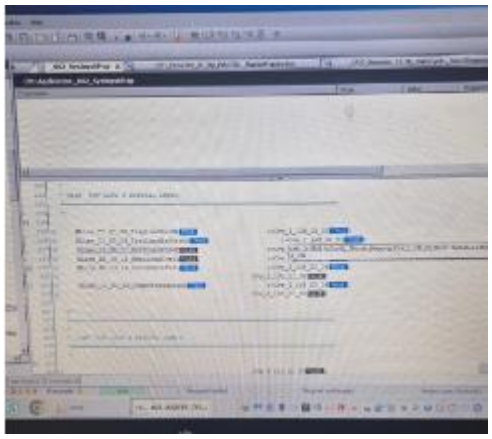

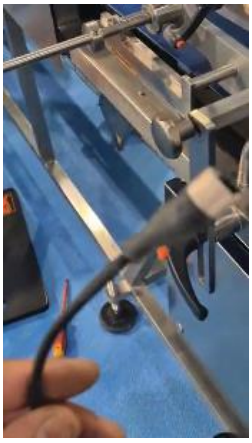

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Good		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS	Jacques	
Time	**Start**	**Finish**
Travel To Site:	05:30	07:00
Onsite:	07:00	10:00
Travel From Site:	10:00	11:30
Remote assistance:	0	
Report writing:	30 Min	
Overnight stay	☐	
Overnight stay with flights	☐	

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Joseph Brown	X _____	05/10/2025
Technician:	Gianpaolo Orisio		