UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles	**Date:**	22/03/2023
Site Address:	72 Templar Road Erskine Park NSW	**Site Contact:**	Trent Cleminson
		Phone:	
Customer PO #:		**Internal Job #:**	3820

Subject: Shuttle 9x8 clamp issue

Equipment Type:	Serial Number:	Customer Line # (if applicable):

Equipment condition:

Work Performed:

- Call out for shuttle 9x8 issue. Fixed clamp failed to clamp the film in place
  Team said, problem rectified when lid shuttle release position was setting 2mm longer, but next problem happened because lid won't be center to dome.
- Tested fixed and mobile clamp cylinder function, they are working properly
- Checked red o-cords on clamps, they are all in place and proper condition.
- Mobile plate was already identified bending from last service, it may affecting the transfer and clamp cycle. We will resend the quote for this item

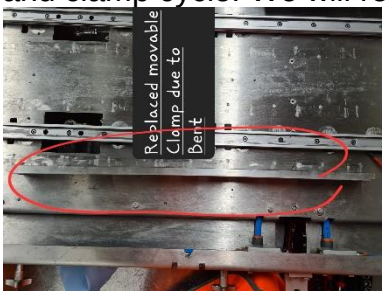

- Adjusted the mechanical stopper of mobile clamp cylinder about 3mm longer such film will be transferred farther to fixed clamp.

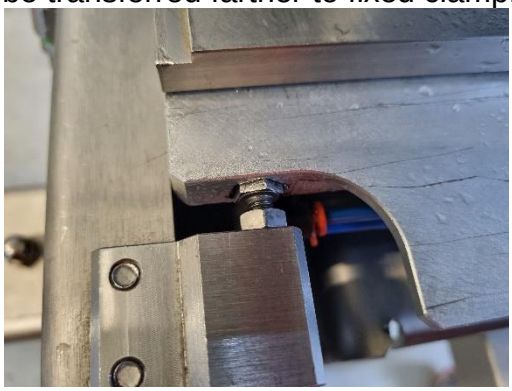

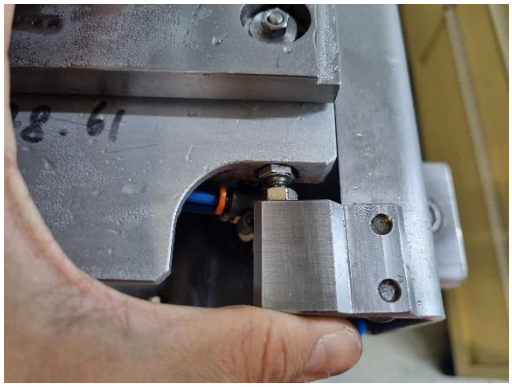

- Found base plate for mobile clamp was worn out on left and right stopper. Need to be replaced.

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

- Tested shuttle on machine, the clamps was good on both side but not on the middle. Suspected due to bent mobile clamp.

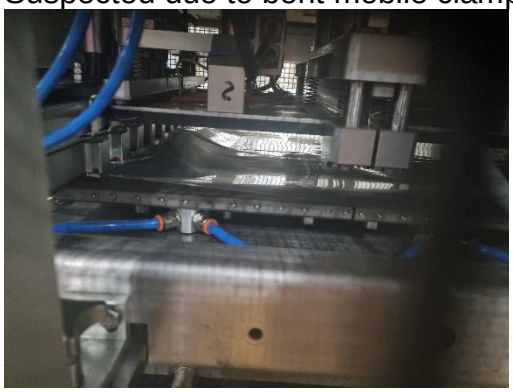

- Shuttle issue was temporary fixed, film could cycling properly. Parameter #318 :Lid shuttle release position was set 1238mm instead of 1245mm. But another issue happened on tool, film was popping during dome forming on all cavity

GENERAL SERVICE REPORT

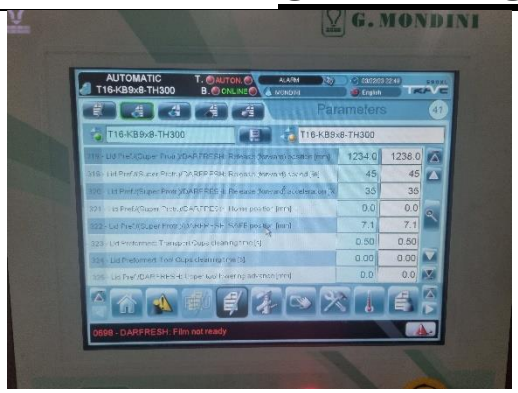

- Tried to redo heating cycle of shuttle but film still popping.
- Increasing dome vacuum valve #2 delay from 3.5 to 4.5s, only half of the cavity was popping now. Teflon coating on domes weren't in best condition, they need to be replaced.

- Confirming the issue is due to film too cold, production decided not to run the production since it was already 1030pm
- Marc will be onsite in the next morning to rectify film popping issue.

** end of report **

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Comment

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

Benni Wijaya

TECHNICIAN HOURS					
Date	**22/03/23**				
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	18:00	18:45			
Onsite:	18:45	23:15			
Travel From Site:	23:15	24:00			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Trent	X _____	22/03/2023
Technician:	Benni		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au