UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles	**Date:**	22/05/2021
Site Address:	72 Templar Road Erskine Park NSW	**Site Contact:**	Rahul Sugumaran
		Phone:	
Customer PO #:		**Internal Job #:**	3220

Subject: Service Platformer

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Platformer	A/17/A-11614	

Equipment condition:

Work Performed:

- Checked parts for service in store.
  Planned to repair Pick&Place pneumatic cylinder and foam.
  There was no stock of pneumatic cylinders in store and we were informed that Coles team just replaced them a week ago
  Foam for Pick&Place, only have 1 pc for the outfeed side.

- Service the machine in the following steps :

1. Inspected Jumbo Reel. OK
2. Inspected Gummy Roller.
   Gummy roller condition is OK, locking cylinder was working. Spider coupling was OK.

3. Inspected punch tool. OK
4. Loading Belt
   Coles team just replaced the new belt + plane recently. Timing belt was OK
   Checked vacuum valve and pump. OK
5. Pick and Place
   - Checked timing belt was OK.
   - Due to part availability, we could only replace 1pc foam on the outfeed side this time. The condition of other foam are bad and need to be replaced asap. The damage foam was causing uneven temp on film and poor forming on tray. **We will send a quote for complete set of foam**.

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

- Suction cups has uneven height and need to be replaced asap.
  We have send email chaser to spare part as quote has been requested on May 11th.
- Linier bearings were slightly worn.
  We will send a quote for new bearings and rail

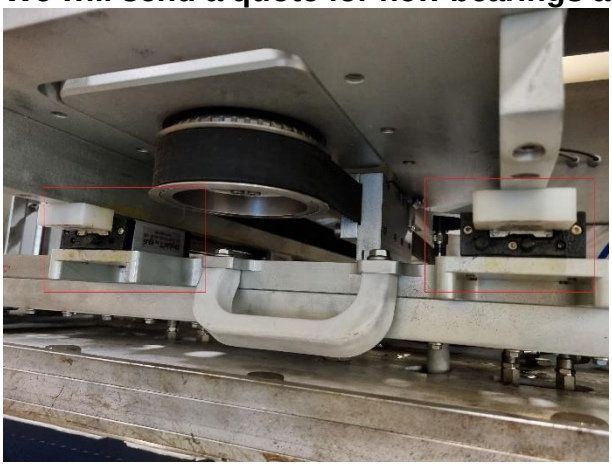

- Regarding pneumatic cylinder failing, we will observe further after receiving pneumatic diagram from Mondini. For the meantime, as requested **please keep the faulty cylinder for our investigation.**

6. Heating plate
   - Replaced 2x faulty 9x8 VSP heating plate (#2 and #4)
     Please note the crate written 9x8 VSP Heating Plate in workshop was actually 4pcsx 9x8 MAP Heating Plate. We finally found another crate with 2pcs x 9x8 VSP heating for replacement. Used the new pins and o-cord from Coles spares.
     Cleaned 2x old heating plate from melted plastic. A number of venting holes are blocked with plastic.

   - 2x Locking plate was missing. Mounting bolt also snapped.**We will send a quote**.

GENERAL SERVICE REPORT

- Checked all the magnet on rotary head and replaced 3pcs using Coles spare.

- There was intermittent Alarm 0308 “Up tool quarter 1 plate1 : High Temperature” and other time “Up tool quarter 1 plate 1 : Low Temperature”. Alarm could be reset and machine restart again.
  We have checked thermocouple wires and plug, heater and slip rings. There is nothing ackward, need to observe further onsite when alarm happened. It could be sensor or temperature input module fault.

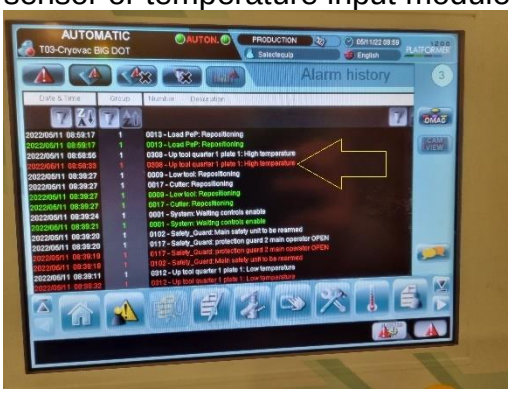

7. Lifting motor
   - Inspected lifting system. Timing belt is still ok

GENERAL SERVICE REPORT

- The lock nuts were loose on four corners. We could only well tightened three corners due to accessibility.

- Inspected vacuum hose if any split or damage

8. Extractor
   - Checked timing belt.OK
   - Linier bearings. Still OK
9. Misc
   - Checked and cleaned vacuum pump filter

GENERAL SERVICE REPORT

- Checked safety guards and emergency buttons. OK
- Checked Electrical cabinet. No water ingress detected.

** end of report**

SPARE PARTS USED

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Part Number:	Description:	Qty:	Chargeable?	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

Tim Harrison

TECHNICIAN HOURS					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	13.30	15:00			
Onsite:	15:00	21:30			
Travel From Site:	21:30	23:00			

Benni Wijaya

TECHNICIAN HOURS					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	14:15	15:00			
Onsite:	15:00	21:30			
Travel From Site:	21:30	22:15			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Rahul	X _____	22/05/2021

GENERAL SERVICE REPORT

Technician:	Tim/Benni