UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles	**Date:**	23/07/2021
Site Address:	72 Templar Road Erskine Park NSW	**Site Contact:**	Tom Darwen
		Phone:	
Customer PO #:		**Internal Job #:**	3618

Subject: Upper and Lower tool time out - Platformer

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Platformer	A/17/A-11614	

Equipment condition:

Work Performed:

Issue : Call out for Lower tool timeout issue

Actions :

- Was informed that machine stopped with lower tool timeout and no error on the screen.
- When arrived onsite, maintenance team was in process of top vacuum plate changeover but they couldn't complete the changeover cycle.
- Noticed S189.3 sensor was giving inconsistent input to PLC module.
  This is analog current sensor, we were suspecting the sensor is defective. We swapped this sensor with S189.2.
- Noticed all vacuum plates were not locked properly, which causing inconsistent detection on sensor S189.1 and S189.3 also error on screen as below

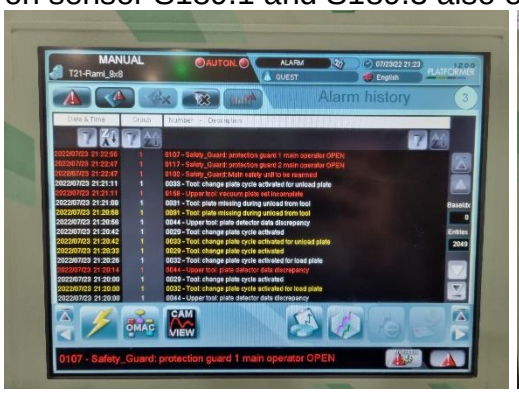

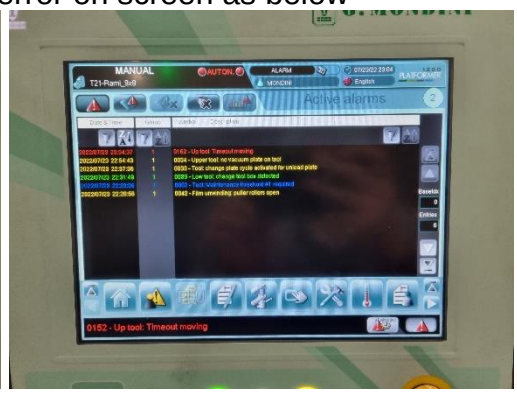

- Checking the rootcause why plates were not locking and found the stopper for locking cylinder stroke has its counter nut loose and a way to long. Adjusted the stopper and lock it properly.

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

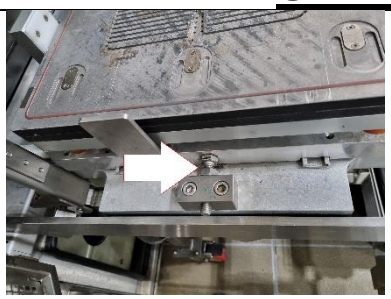

- Re-adjusted sensor S189.1 and S189.3, making sure they were not flashing when detecting the presence of vacuum plates.
- Tested changeover cycle for few times, it was working fine without failing.
- Concluding the rootcause of issue are sensor S189.1 and S189.3 signal and position, also cylinder stroke for locking vacuum plates
- The cleaner already onsite and changeover of other tool has not been performed for 9x8 format. We are confident the rootcause has been fixed and it will work in automatic cycle. We were not able to test run the machine with film on that night.
- In the next morning, checked with team the machine is running good without issue.
- As a follow up, we will provide quote for the sensor since this is consider as critical parts.

** end of report**

SPARE PARTS USED

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Part Number:	Description:	Qty:	Chargeable?	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

Benni Wijaya

TECHNICIAN HOURS					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	17:30	18:15			
Onsite:	18:15	24:00			
Travel From Site:	00:00	00:45			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Tom	X _____	23/07/2021
Technician:	Benni		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au