UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles	**Date:**	28/08/2022
Site Address:	72 Templar Road Erskine Park NSW	**Site Contact:**	Trent Cleminson
		Phone:	
Customer PO #:		**Internal Job #:**	3655

Subject: Service Platformer

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Platformer	11614	

Equipment condition:

Work Performed:

28/08
Machine cycles : 3713664
Cutter cycles : 17230140

Reset machine counters and performed service routine checklist

Film Path Jumbo

- Checked all rollers. OK
- Checked operation of dancers. OK
- Checked sensor. OK
- Checked hydraulic ram if any leaks. OK

Load Belt

- Checked condition of load belt. OK
- Checked all rollers and bearings. OK
- Checked knife punch and lubricated bearings.OK
- Checked drive belt. OK
- Found belt was not in center. Counter nut was not tightened. Adjusted belt tension

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

- Checked rubber rollers. OK
- Checked nylon guide. OK
- Checked film clamp tension. OK
- Checked vacuum system and cleaned filter.

Load Pick&Place Shuttle

- Checked condition of foam pad. They were damage and there is no stock onsite. **To be quoted**.

- Pneumatic cylinders fails and mounting plates worn out. **Replaced using customer stock.**

- Checked PT-100 reading. OK
- Checked condition of drive belts and drive coupling.OK
- Checked servomotor connection. OK
- Guide rails and linier bearing were worn out. **To be quoted.**

GENERAL SERVICE REPORT

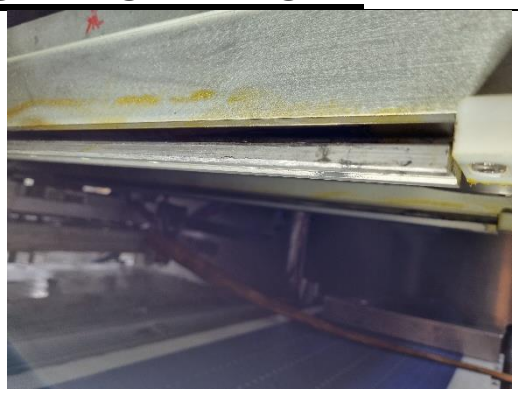

Rotor Drum

- Checked rotor vacuum system. OK
- Checked rotor belt. OK
- Checked PT-100. OK
- 2x locks on rotor plate#4 were missing because the thread was damage.

Bottom tool

- Replaced T17 seal on 11x9 VSP tool **using customer stock**
- Checked water fittings. OK

Unload P&P

- Checked drive belts and couplings. OK
- 1x suction cups was broken and 1x column+damper was damage on 11x9 VSP. Replaced using customer stock

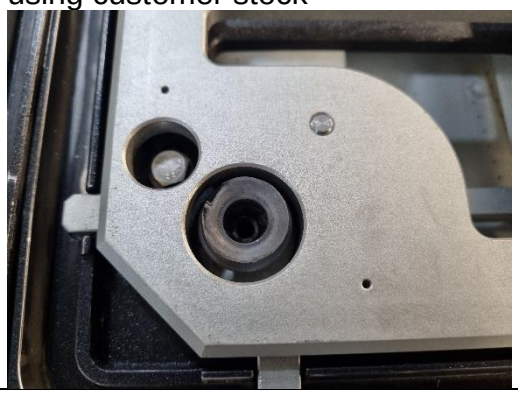
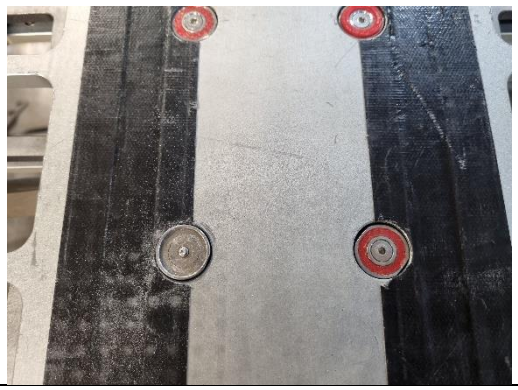

GENERAL SERVICE REPORT

- Noticed base plate for 11x9 VSP was bit bending, all plates have different height as well, and vacuum channel has been repaired and taped. **Recommended complete shuttle to be replaced.**

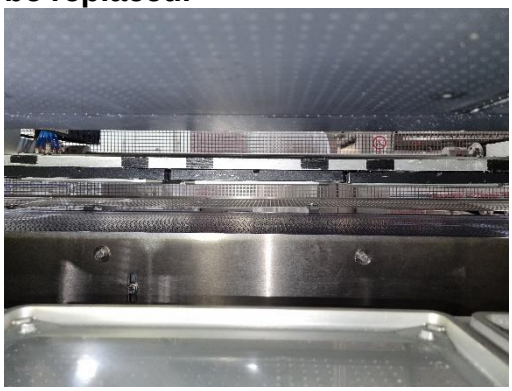

Under Machine

- Inspected and checked the operation of pneumatic air valves. OK

- All sensors are tight and operational. OK
- Checked main lifting unit belt. OK
- Checked mobile plate and o-rings. OK
- Checked grease level. OK

- Cleaned vacuum filter
- 1x groove nut on lifting column was missing. It must be loose and drop somewhere. **To be quoted.**

GENERAL SERVICE REPORT

Exit Belt

- Checked condition of exit belt. OK

Electrical

- Checked for any loose or discoloured connection. OK
- Checked all switches and E-stops. OK
- Checked HMI, sometimes there was issue on recipe loading as per below photo.
  For the meantime the only way to fix the issue is to power cycle the machine. Issue has been forwarded to Mondini for further advise.

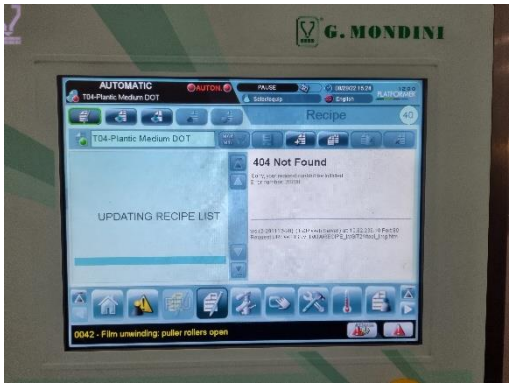

29/08
Production support running VSP 11x9
Issue :

- Last tray sometimes fail to be unloaded, notice uneven vacuum on four corners.
  Issue is on unload P&P. Plates are not in the same level and base was bending. To get it run, we have to reduce pause time during lip molding (Par 017)
- Movement of loading P&P was inconsistent causing unstable placement position of film into vacuum plate. It could be loading belt issue but we definitely need to fix the rail and linier bearing first
- There are few times error missing vacuum plate which causing upper tool axis fault. The analog sensor on the right side (main switch panel) might be playing up.

Follow up action:

- To quote new unload P&P for VSP 11x9
- To quote foam, new rails and linear bearings for loading P&P
- To quote analog sensor for vacuum plate detection

GENERAL SERVICE REPORT

- To quote groove nut for lifting column

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

GENERAL SERVICE REPORT

Benni Wijaya

TECHNICIAN HOURS					
Date	**28/08**			**29/08**	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	13:45	14:30		04:30	05:15
Onsite:	14:30	22:00		05:15	09:00
Travel From Site:	22:00	22:45		09:00	09:45

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Trent	X	29/08/2022
Technician:	Benni		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au