UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

Service done by: David van der Merwe **Date:** 08/12/2022

Huon Aquaculture

Mondini Trave 340

Skin line A/14A-00912

Inspect infeed and spacer belt system:

1. Infeed and spacer belt bearings in good condition.
2. Replaced infeed belt. Had cracks

3. Spacing and infeed belt drum motor in good working order.
4. Sensor and reflector in good working order.
5. Greased both drum motors.

Inspect film feed system:

1. Cleaned all film path rollers.
2. Dancing bar in good working order.
3. Replaced missing Cir-clips on film path rollers. X4

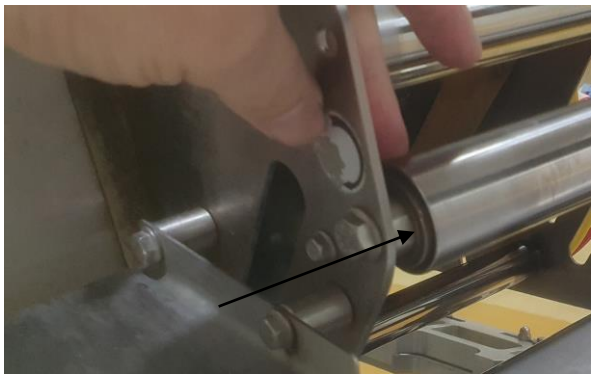

4. Replaced missing Cir-clip on film snap detection flaps on and bent them straight again.

5. Inspected waste film drive all in good working order.
6. Did notice some ware on the Teflon coating on the film pre heater.
7. Tighten loose film end of reel sensor.

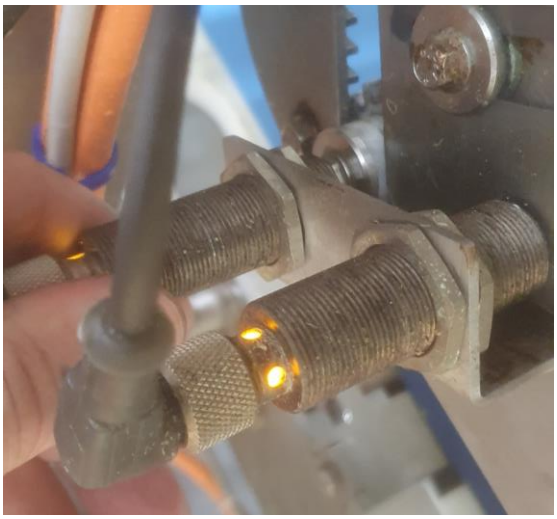

Inspect exit belt system:

1. Exit cords in good condition.
2. Greased drum motor.
3.

Inspect Mechanical Lifting system:

1. Replaced vacuum and gas O-rings.
2. Vacuum hoses in good condition.
3. Inspected lifting system motor.
4. Gas hoses in good condition.
5. Grease machine.
6. Test auto grease system and checked level. All good.
7. Preformed vacuum test.
8. Inspect air service unit.
9. Rest of the system is in good working order

Inspect pusher arms:

1. Checked connecting rods all good.
2. Inspected open close pneumatic cylinder and reed switch in good working order.
3. Rest of the system in good condition.

Inspect safety system:

1. Checked E-stop's
2. Checked door safeties.
3. Test function of all safeties.

Chain Line:

1. Inspect chain line links. All good.
2. Checked chain tension and inspected gears. Stripped chain tensioner as it was seized. Loosened it and lubricate but new one needs to be order.

3. Saw some wear on the back idler sprocket pins.

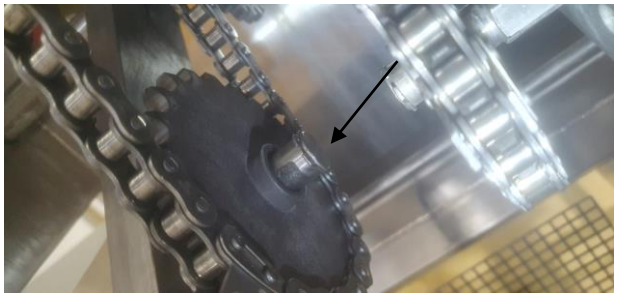

4. Inspected J/box and E-stops. Blowed out with air as there is a lot of moisture in them. Lot of corrosion.

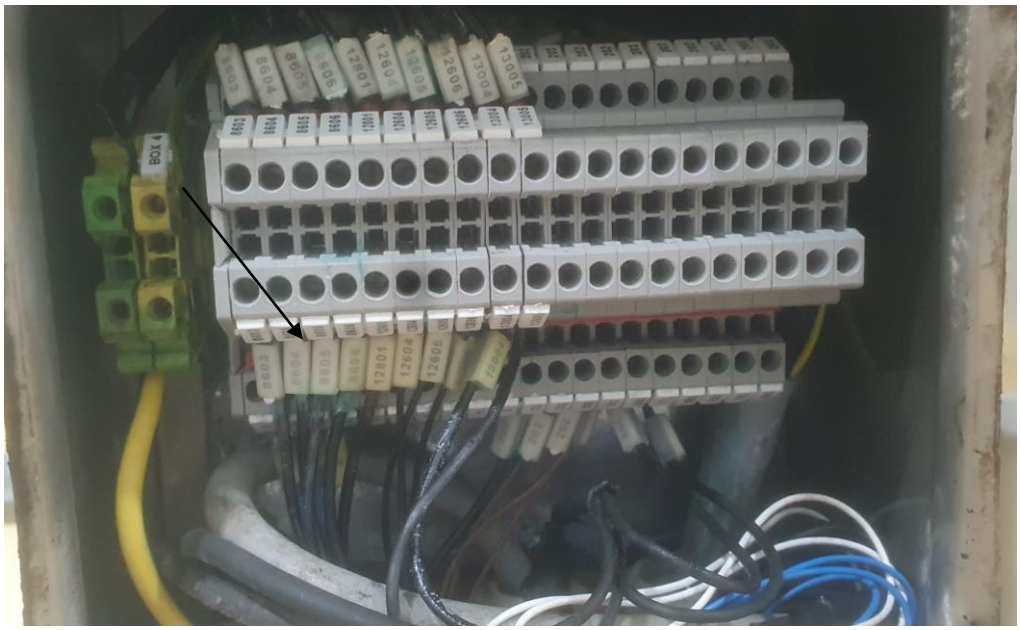

5. Inspected denseting unit. Replaced worn suction cups. Rest of the system in good working order.

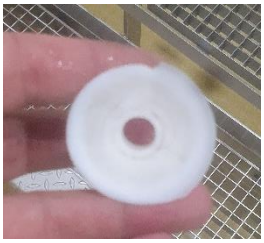

Skin tool service

1. Stripped and cleaned bottom tool.

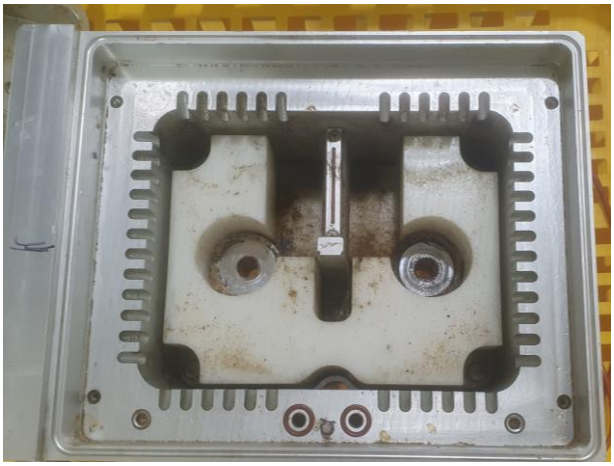

- Replaced foot plate shaft O-rings x4
- Replaced red O-cord on bottom tool.
- Stripped top tool lower bel and cleaned.

- Replaced both knifes had some damaged teeth

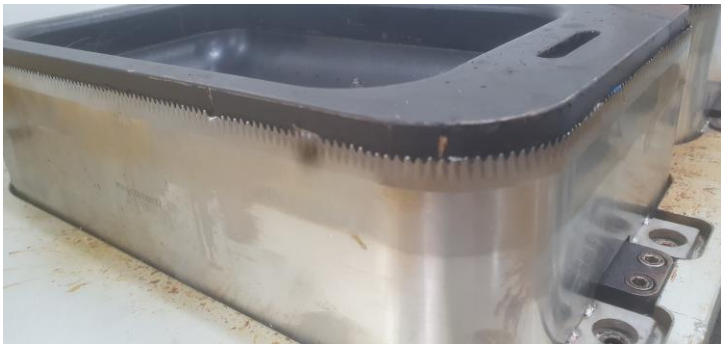

- Teflon coating on out feed side seal bar is badly worn. Need to be replaced asap. There was a lot of burn on seal.

- Inspect case back plate vacuum holes. There is some ware on the case backs but recommend that they are only replaced when new seal bars are fitted.
- Replace bent air fitting.

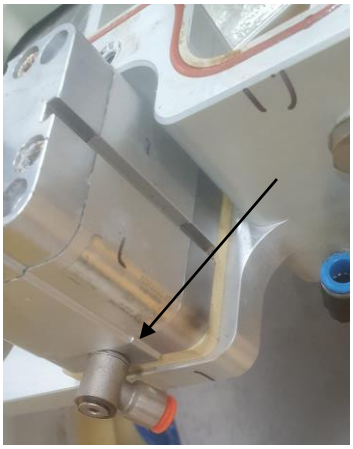

- Tighten loose seal bar vacuum pipe banger connection.
- Replace all red O-cord.

Raw line A/14/A- 00911

Inspect infeed and spacer belt system:

1. Spacer and infeed belt bearings in good condition.
2. Infeed and spacer belts in good condition.
3. Spacing and infeed belt drum motors in good working order. Greased them.
4. Sensor and reflector in good working order.

Inspect film feed system:

1. Cleaned all film path rollers.
2. Dancing bar in good working order.
3. Replaced bearings on gummer roller shaft and tried cleaning gummy rollers but they need to be replaced.

4. Film snap detection flaps has been removed and spreader bar assembly is not original.
5. Inspected waste film drive all in good working order.
6. Replaced worn Cir-clips on gummy roller clamps.

Inspect exit belt system:

1. Exit cords in good condition.
2. Greased drum motor.

Inspect Mechanical Lifting system:

1. Replaced vacuum and gas O-rings on mobile plate

2. Vacuum hoses in good condition.
3. Inspected tool lifting servo drive
4. Gas hoses in good condition.
5. Grease machine.
6. Test auto grease pump.
7. Preformed vacuum test.
8. Test gas solenoids.
9. Inspect air service unit.
10. Replace top air diaphragm.

11. Fix bottom tool locking clamp in feed side. Was loose.
12. One of the nylon strips are missing top tool guide.

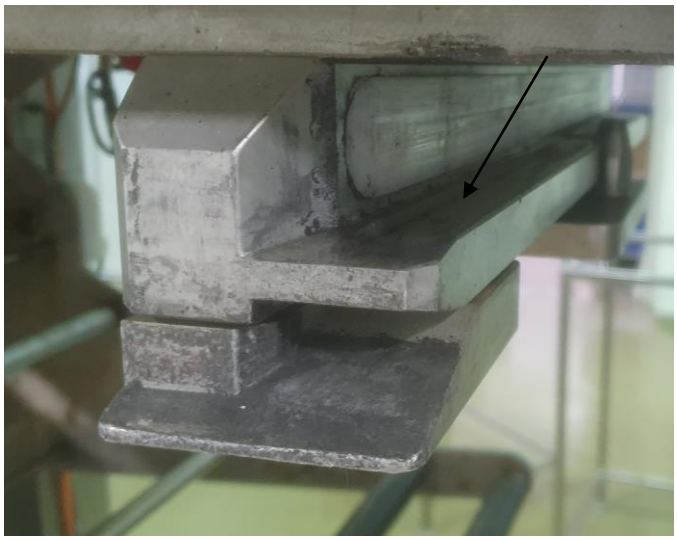

13. Rest of the system is in good working order

Inspect pusher arms:

1. Checked connecting rods all good.
2. Checked pneumatic cylinder and reed switch.
3. Rest of the system in good condition.

Inspect safety system:

1. Checked E-stop's
2. Checked door safeties.
3. Test function of all safeties.

Chain Line:

1. Inspected chain line.
2. Check drive chain and stripped chain tensioner. It was seized. Freed up but needs replacing.

3. Inspect J/box, E-stops and control button boxes. Lot of water in them.

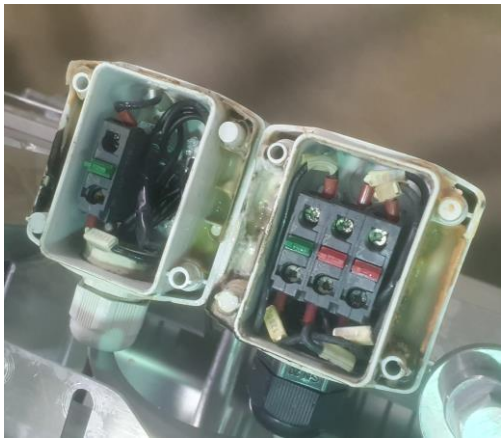

4. Inspected densting unit. Could not fix unit as there is a lot of parts that are faulty due to time the unit was standing. Please see service report for more detail.

<u>Tool service 9x7 SB-138-550 and 9x5 A90972</u>

1. Inspected foot plate springs and replaced foot colomn orings on both tools,

2. Replaced broken foot plate springs on 9x5 tool

3. Cleaned bot botomm tools. 9x5 was very dirty.

4. Lubricated top and bottom tools.
5. Inspected and cleaned seal bars. Seal bars on 9x7 needs to be replaced Teflon coating worn.

6. Replaced Red O-cord on both tools.
7. Replace T-seals on both tools
8. Cleaned lower bels on top tools.
9. Knifes on 9x7 in good condition. 9x5 needs to be relapced.

10. Inspect 6-pin plug and connections both tools.
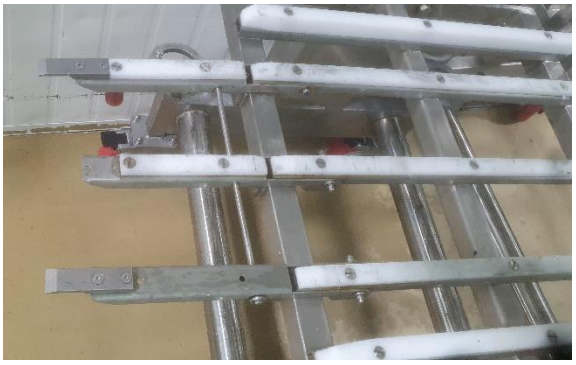
Note that one of the tool trollies has a lot of missing parts on transfer slides