UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Lite and Easy	**Date:**	22 November 2024
Site Address:	54-72 Templar Road Erskine Park NSW	**Site Contact:**	Anthony Pisani
		Phone:	0438287226
Customer PO #:		**Internal Job #:**	4971

Subject: Tool rebuilds

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave340 VG	A/16/A-11452	Line 1
Trave340 VG	A/16/A-11450	Line 2
Trave340 VG	A/16/A-11451	Line 3

Equipment condition:

Line 1 Dinner tool has a vacuum leak. Vacuum test was done. The reason why the tool has been refurbished
Spare 2 up tool, no vacuum test was done before hand. It was also refurbished.

Work Performed:

Dinner tool Line 1, 2 up.
This tool had a vacuum leak, smoke was coming from the Male heater plug. Tool was opened and found that a bolt was stripped, and a damage O ring was present on the pipe for resistance.

Top tool
Top tool was opened and cleaned

- *Replaced 2 vacuum bellows and O rings*
- *Replaced 1 electrical bellows and O rings*
- *Replaced 4 springs*
- *Replaced blue electrical cable sheath, and O ring*
- *Replaced heater male pin*
- *Replaced Heater male pin holder*
- *Replaced 4 dampers*
- *Cleaned washers and installed 5 mil O rings, there was none under washer.*
- *Replaced all springs on top of element,*
- *Inspected disks*
- *Inspected upper columns*
- *Replaced red O cord*
- *Replaced PT 100*
- *Redid terminal connections*
- *Cleaned seal bars*
- *Inspected blades*
- *Retaped hole for pipe for resistance, bolt was stripped*
- *Inspected pipe for resistance and replaced O ring. O ring had damage*
- *Replaced O rings on lateral bushes*

GENERAL SERVICE REPORT

Bottom tool

- *Opened, cleaned and rebuild tool*
- *Replaced T seal*
- *Replaced 123 O rings*
- *Inspected bushes and O rings*
- *Inspected columns*
- *Inspected Lower column should be replaced.*
- *Replaced foot springs*
- *Replaced Damper O cord*
- *Replaced dampers*
- *Replaced vacuum gauge*

Dinner tool 2 up, spare.

The bottom bush for the bottom tool is bent and should be replaced, non in stock. Will send a quote

Top tool

Top tool was opened and cleaned

- *Replaced 2 vacuum bellows and O rings*
- *Replaced 1 electrical bellows and O rings*
- *Replaced 4 springs*
- *Replaced O ring on blue electrical cable sheath.*
- *Replaced heater male pin*
- *Replaced Heater male pin holder*
- *Replaced 4 dampers*
- *Cleaned washers and installed 5 mil O rings, there was none under washer.*
- *Replaced all springs on top of element, found 4 broken*
- *Inspected disks*
- *Inspected upper columns*
- *Replaced red O cord*
- *Replaced PT 100*
- *Redid terminal connections*
- *Cleaned seal bars*
- *Inspected blades*
- *Retaped hole for pipe for resistance, bolt was stripped*
- *Inspected pipe for resistance and replaced O ring. O ring had damage*
- *Replaced O rings on lateral bushes.*

Bottom tool

- *Opened, cleaned and rebuild tool*
- *Replaced T seal*
- *Replaced 123 O rings*
- *Inspected bushes and O rings*
- *Inspected columns, should be replaced as one is bent. Non in stock*
- *Inspected Lower column should be replaced.*

GENERAL SERVICE REPORT

- *Replaced foot springs*
- *Replaced Damper O cord*
- *Replaced dampers*
- *Replaced vacuum gauge*

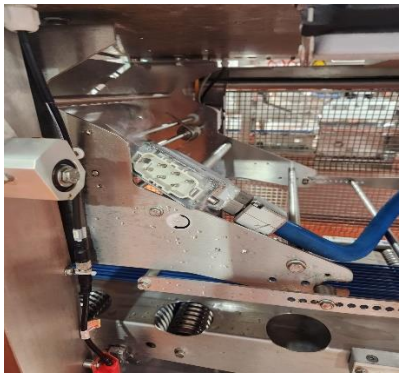

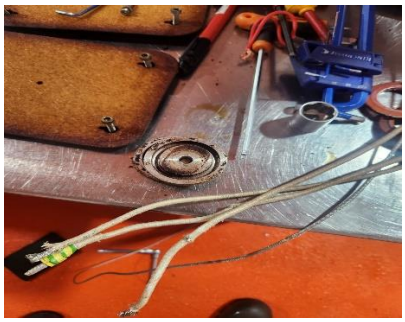

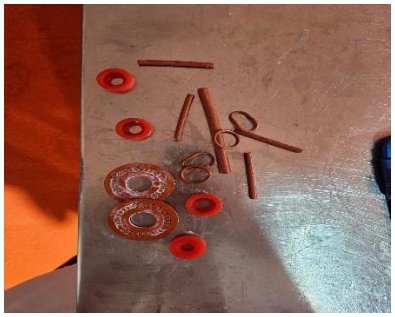

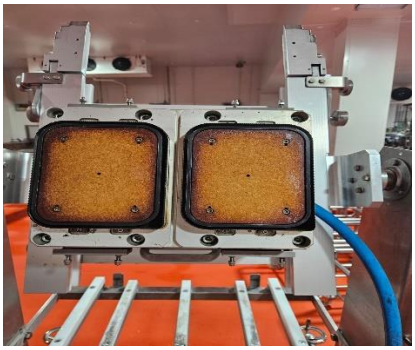

GENERAL SERVICE REPORT

Conclusion.

Both tools were refurbished and tested with a vacuum test. Both pulled a good vacuum and held the vacuum. Bleed of was slow which is good.

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☐	No☒
Comments: Good		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments: Lower bushes should be replaced on the spare 2 up tool as they are bent. Both lifting colums should be replaced. Will send through a quote.

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

TECHNICIAN HOURS	Henry Nieuwenhuis	
Time	**Start**	**Finish**
Travel To Site:	06:30	07:00
Onsite:	07:00	16:00
Travel From Site:	16:00	16:30
Remote assistance:		
Report writing:	30 mins	
Overnight stay	☐	
Overnight stay with flights	☐	

TECHNICIAN HOURS	Johan Venter	
Time	**Start**	**Finish**
Travel To Site:	06:30	07:00
Onsite:	07:00	16:00
Travel From Site:	16:00	16:30
Remote assistance:		
Report writing:		
Overnight stay	☐	
Overnight stay with flights	☐	

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:		X _____	22/11/2024
Technician:	Henry Nieuwenhuis/Johan Venter		