UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	RROA Coles	**Date:**	30/1/24 31/1/24
Site Address:		**Site Contact:**	Allen Vella
		Phone:	
Customer PO #:		**Internal Job #:**	4341

Subject: 11x9 VSP Shuttle

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590	A17A-11614	Line 4

Equipment condition:

Work Performed:

30/1/24
Arrived onsite for service on platformer tools but was asked to look at 11x9 skin shuttle
Removed shuttle from rack and moved to workshop
Speaking with customer shuttle had a problem with cutting on the first blade, film creasing on back corner of the first plate.
Set up pneumatics system and tested all shuttle functions all cylinder are working nothing sluggish
Tested cut functions all fine
Removed bottom shuttle for inspection

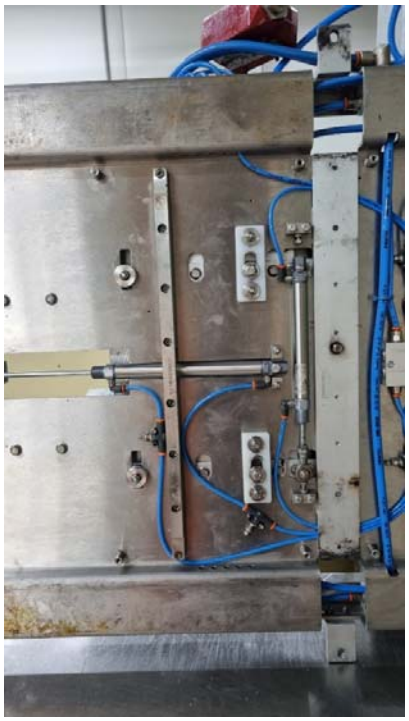

Inspected and tested all cylinders and micro switches
Had to stop inspection due issues in production with 9x8 skin tool not sealing very well
Inspection found three broken vacuum spikes on tool, maintenance to replace when tool is available also wrong plantic film used on platformer changed over to right film

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

Carried back on with 11x9 shuttle

Inspected bottom plates and found the plasma coating is lifting and not letting film heat-up correctly due to film not sitting flat during film cycle

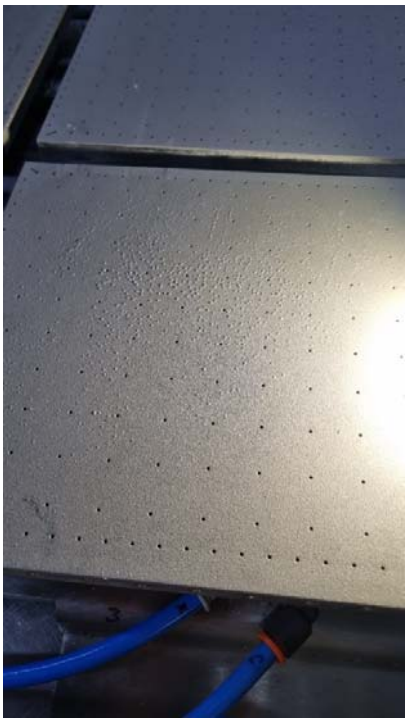

we need to order spare plates to keep production running and the original ones need to be sent away for recoating
Cleaned plates and reassembled shuttle

GENERAL SERVICE REPORT

Tested PT100 all in spec

Inspection of heater plugs found the start of a hot joints recommend replacing plug I would say the heater is being unplugged before the shuttle in unlocked

GENERAL SERVICE REPORT

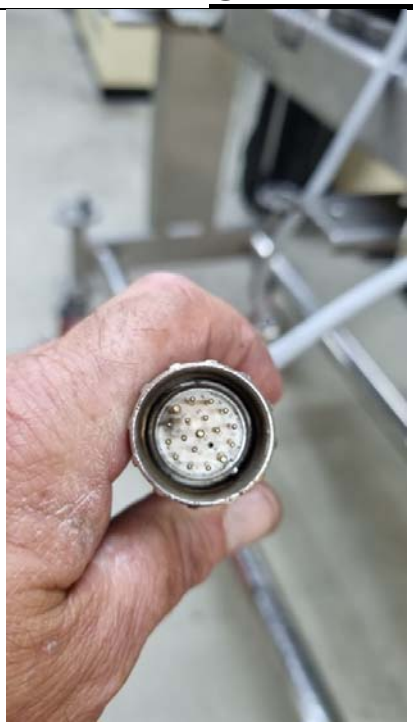

31/1/24
Arrived onsite to look over 11x9 production as they had issue running through the night
The root cause for the issue was not enough temp in the shuttle.
Fine tuned recipe and saved as 11x9 (31/1/24)

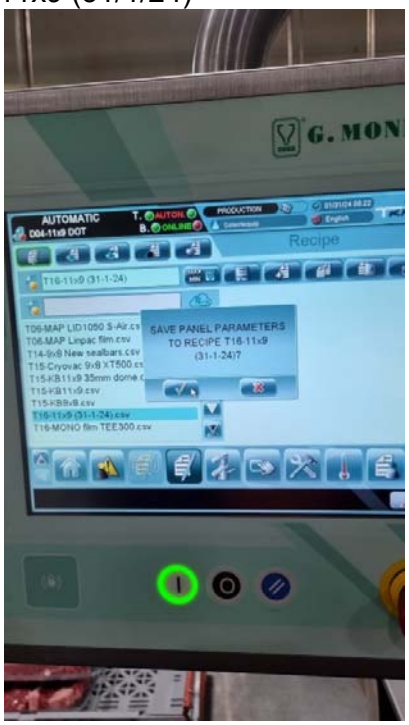

11x9 ran very good throughout the day
Stayed around for 9x8 changeover to make sure they are running fine

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

No real issue with 9x8 did fine-tuned a few setting on film preheat to get a better transfer to tool

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

	30/1/24			31/1/24	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	7:30	9:15		4:30	6:00
Onsite:	9:15	14:30		6:00	14:30
Travel From Site:	14:30	16:00		14:30	16:00

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:		X _____	
Technician:			

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au