UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles	**Date:**	05-07/09/2023
Site Address:	Coles	**Site Contact:**	Alan Villa
		Phone:	0438325453
Customer PO #:		**Internal Job #:**	4074

Rebuild 9x8 top tool and start-up

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590	9x8 DOT tool	Line 4

Equipment condition:

Good condition.

Work Performed:

05/09/2023

- Arrived on site and re-did my induction. Met with Alan and discussed plane for the day.
- Took tool form production area and setup work area for the day.
- Started stripping top tool. Removed seal bars
- Stripped off top plate and put back on tool trolley
- Stripped rest of the tool down
- Found one of the red spring tensioning screws stripped and could not unscrew completely. Removed mounting block and cut damaged part of the threads off and removed.
- Found on of the upper tool column seized. This would have effected tool during expansion stage when heating up. Stripped all 4 upper columns and cleaned and re lubricated.
- Washed tool parts.
- Replaced Both PT100's. They had a lot of corrosion on them.
- Replaced all O-rings.
- Replaced both Blue electrical hoses.
- Replaced both 6pin male plugs.
- Replaced x2 vacuum gauges.
- Replaced x 8 red springs.
- Reassembled tool.
- Replaced all red hoses.
- Replaced on of the tool up position strikers was damaged.
- Replaced all water hoses.
- Sanded and polished seal bar picking face.
- Greased to tool.

07/09/2023

- Arrived on site and found incorrect 9x8 tool installed in machine. Swapped tool over and waited for tool heat up.

GENERAL SERVICE REPORT

- Locked clamping rings after I aligned plugs with sockets on machine.
- Test upper tool water circulation and checked for leaks all good.
- Assisted production with film prep.
- When tool reached temp set-point did a couple of cycles to test pick up and forming.
- Polished some of the seal bars more to improve pickup.
- Started running production. Pickup and dome formation looked good.
- Had to do some minor adjustments to recipe **T15-KB9x8** to prevent film slipping during dome formation.
- Had some reworks due to halo in product. Did some find tunning to improve sealing but could not eliminate completely. Suspect the tray quality is effecting the overall consistency of the tool as some of the side of the trays are badly deformed.
- Also had some rework due to product size and product packing.
- Also noticed that the white T-seals on bottom tool has some wear on them, this can also be caused by the deformed tray edges. Worn T-seals will lead to vacuum leaks.
- The deformed trays are also causing some issue during the stepping phase on the spacer belt as they are touching the phasor shoe and this is effecting the overall stepping position causing random crushing. Doubled check stepping and pusher arm closing position, all looked good.
- Monitored production and did some fine tuning to improve sealing, but more time is need on the line with the tool to get better results.
- Saved all changes to recipe **T15-KB9x8.**
- Will discuss findings with Marc.
- Please see below pictures of tool rebuild

Stripped tool completely down

Blue electrical hoses badly worn

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

Replaced damaged tool up position striker.

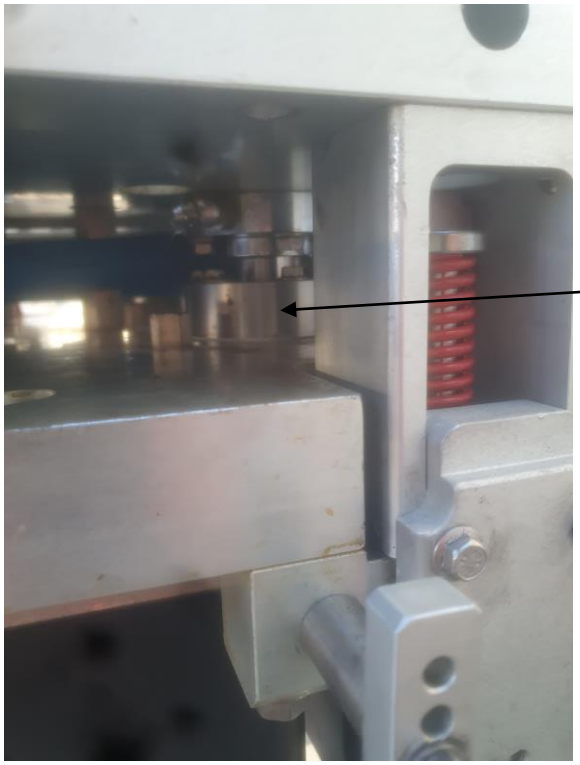

Stripped and clean all 4 upper tool columns. One of the were seized.

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Machine Tested?	Yes☒	No☐
Comments: Ran production		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS					
Date	**05/09/2023**			**07/09/2023**	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	7:30	8:00		03:30	4:00
Onsite:	8:00	17:30		4:00	7:30
Travel From Site:	17:30	18:00			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Alan	_x_____	07/091/2023
Technician:	David		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au