UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Huon Aquaculture	**Date:**	06,07,08/12/2022
Site Address:	7218 Bass Highway East SASSAFRAS Tasmania	**Site Contact:**	Anthony
		Phone:	0428776039
Customer PO #:		**Internal Job #:**	2056
Subject: Service and Film Trial			

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 340	A/14/A-00911	Raw
Trave 340	A/14/A-00912	Skin Line

Equipment condition:

Work Performed:

06/12/2022

- Arrived on site and checked in met with Anthony.
- Serviced Raw line as per Mondini service sheet.
- Replaced gummy roller bearings as they were worn.
- Tried cleaning all build up on gummy rollers but contamination is impregnated in to rollers will have to replace with new ones.
- Replaced mobile plate vacuum and gas O-rings.
- Fix bottom tool lock clamp it was loose and not clamping tool correctly.
- Replaced bottom tool stops. They were bent and damaged.
- Noticed that machine does not have the original spreader bar fitted and film snap detection flaps has been removed.
- Service 9X7 tool. Replaced red O-cord and foot plate shaft O-rings. Cleaned tool and greased.
- Test Auto grease pump.

07/12/2022

- Arrived on site and waited for production to stop production on skin line. Started service around 8:30am.
- Service skin line as per Mondini inspection sheet
- Replaced infeed belt. But noticed that the tracking strip on the new belts are very thin and not keeping belt tracked correctly. Spaced nose roller to keep tracking in-line.
- Replaced missing Cir-clips on film feed rollers x4
- Replaced mobile plate O-rings
- Tighten loose film end of real sensor.
- Replaced suction cups on denesting unit. X2
- Opened up E-stop, button and J-box's and inspected. Found some water in them. Blowed out with air. There is signs of corrosion on some of the terminals.
- Replaced missing Cir-clip on film snap detection flaps and bent then straight again.
- Freed up jammed chain tensioner for drive chain.

GENERAL SERVICE REPORT

- Noticed some ware on idler sprocket pins.
- Service skin tool. Replaced x2 knifes, replaced red O-cord, replaced bent air fitting, tighten loose vacuum fitting and cleaned top tool. Stripped bottom tool and cleaned it. Replaced foot plate O-rings and red O-cord.
- Greased top and bottom tool.
- Ran some empty trays to test line. Also rans some test on the new trail film.

08/12/2022

- Arrived on site and monitored production start-up. Start-up went well with no issues.
- Noticed during the run that some trays are not always entering square on the spacer belt. Found that the flange of the trays are resting on top of the pusher lugs on the chain and this is causing the issues with tray transfer.

- Arranged with production to run trail on new **VST 280 Sealed Air film 150um** film at 8am. Changed over and stated resting testing in the time production was on break.
- Had to change pre-heater temperature, slow down dome formation to prevent popping, and slow down cycle speed to get some constancy. The defected seal bar also caused some issue with trays sticking to it.
- Will send full report on trial findings, but we managed to run but we lost a lot of speed compared to original film and we were not running so constant as we were getting some reworks.
- After trial we changed back to original film (**Amcor- A9111-W HB film 150um**)
- Made new recipe for the VST280 film called **T80- VST280 Sealed Air**. Also marked position on red adjustable handle for the old and new film.
- Completed service on the raw line. Inspected chain line and fixed stuck chain tensioner. Found a lot of water in E-stop and control button box's
- Test denesting unit, found problem why unit will go in to axis fault after homing. The extra over stroke up reed switch has a falls signal on it and when testing on voltage there is 15VDC on the signal wire constantly when the reed switch is not made. This can be caused faulty reed switch or damaged cable to J/Box. With this reed switch disconnected I managed to home the system and start chain line and denester, but the electrical cylinder is very stiff and jerky when moving causing system move irregular and effecting movement and stopping. The electrical cylinder needs to be stripped and cleaned and if it can be repaired it will have to be replaced.
- The vacuum pump also tripped out after +- 2min of running. This must be because the system has not run for more than 2 years.

GENERAL SERVICE REPORT

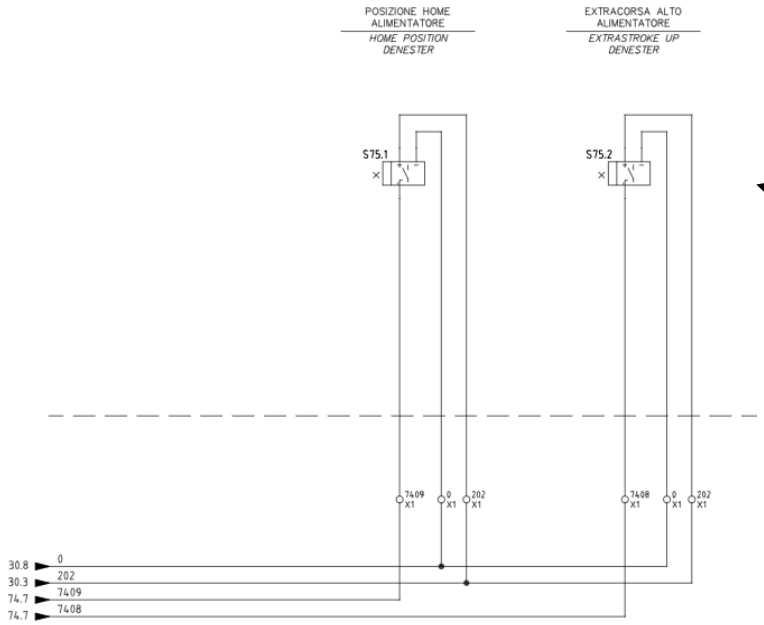

Extra over stroke reed switch and signal cable to J/box must be replaced

- Service 9x5 tool. Tool was very dirty. Cleaned tool and sanitised. Replaced foot plate shaft O-rings and foot plate springs x2. One was broken. Replaced Red O-cord. Knifes in top tool is damaged but could not change as we had none in stock.

NB on both chain lines the air service unit at the denesting units air pressure regulators are damaged. Did not change as they will just get damaged again recommend that a cover is made before replacing's. The skin line subsystem is hold on by cable ties.

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Dry cycled Raw machine, Ran production on Skin line		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:Skin tool needs a rebuild as it has a small vacuum leak and one of the seal bars is in very bad condition. All teflon coating is worn off. Recommed that only Nils grease is used when refilling the auto grease pumps on both lines.

TECHNICIAN HOURS					
Date	**06/12/2022**			**07/12/2022**	
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	04:00	11:45		6:30	7:00
Onsite:	11:45	17:30		7:00	17:00
Travel From Site:	17:30	18:00		17:00	17:45
Date	**08/12/2022**				
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	5:30	6:00			
Onsite:	6:00	15:30			
Travel From Site:	15:30	16:00			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Anthony	x _____	08/12/2022
Technician:	David		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au