UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Huon Aquaculture	**Date:**	18/02/2026
Site Address:	7218 Bass Highway East SASSAFRAS Tasmania	**Site Contact:**	Anthony
		Phone:	0428776039
Customer PO #:		**Internal Job #:**	6011

Subject: PLC Fault and Pusher arm fault

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 340	A/14/A-00912	Skin Line

Equipment condition:

Work Performed:

- Travelled to Site to attend machine breakdown.
- Arrived on site and found the machine with PLC card fault 0451 (power supply card) and pusher arms in forward position not wanting to home.
- Could clear PLC fault but it will pop up randomly. But when alarm was active I could still activate multiple functions on the machine.
- Stated investigating why the pusher arms will not home. I could see the coil on pneumatic card K8 for the pusher arms are not on and it should be on to open the arms.
- Then manually activate the card and the arms opened up. Did a manual cycle to see what happens and the arms moved forward but did not return to home position because the arms did not open. Maintenance informed me that it a new K8 card has been installed for the pusher arms movement.
- I then check if I have 24vdc on terminal 21205. There was 24vdc so it meant the PLC output was switching correctly.
- Stripped valve bank and inspected each card for bent or burned pins and contacts. All good.
- Then tested to see if I have power on the relevant contact on the valve bank power BUS system. There was 24vdc.
- Installed the first card in the series and tested to see if the 24vdc is present on the BUS contact on the card. There was no voltage. Replaced first card (I6) with new one and then tested again and had 24vdc. I then assembled the valve bank and the coil for pusher arms open came on and operated as it should.
- The manually test the pusher arm cycle and it was working correctly. Put machine in by-pass mode and ran the machine for +- 30min with trays testing pusher arm function and transfer. Fine-tuned air flow on flow control valves as the arms was closing very fast.
- Production then installed film and we ran some product to test the line.
- Adjusted the pre heater plate angle as it was adjusted to prevent film sticking to it. Also adjusted the dome formation valve as it was completely closed for some reason.
- Machine cycled well and did not have any issues with pusher arms.

GENERAL SERVICE REPORT

- We also did not have the PLC error again, but when I pressed on the power supply card or tapped on it the alarm would pop up. The got the new connection card and power supply card form the spare machine and installed it. After I have done this I could press and tap on the power supply card and the fault would not happen again.
- Emptied out all water traps and put machine in clean mode for cleaning.

Will be on site next day at 5:30am to monitor production.

Pressing and tapping on the Power supply card would bring up the PLC error. Replaced connection card and power supply card with one from the spare machine. Contacts and pins looked good the bus.

Replaced first card I6 on the valve was not getting the 24vdc on the relevant bus contact to feed power to the pusher arm card K8. Card also had a lot of corrosion on it.

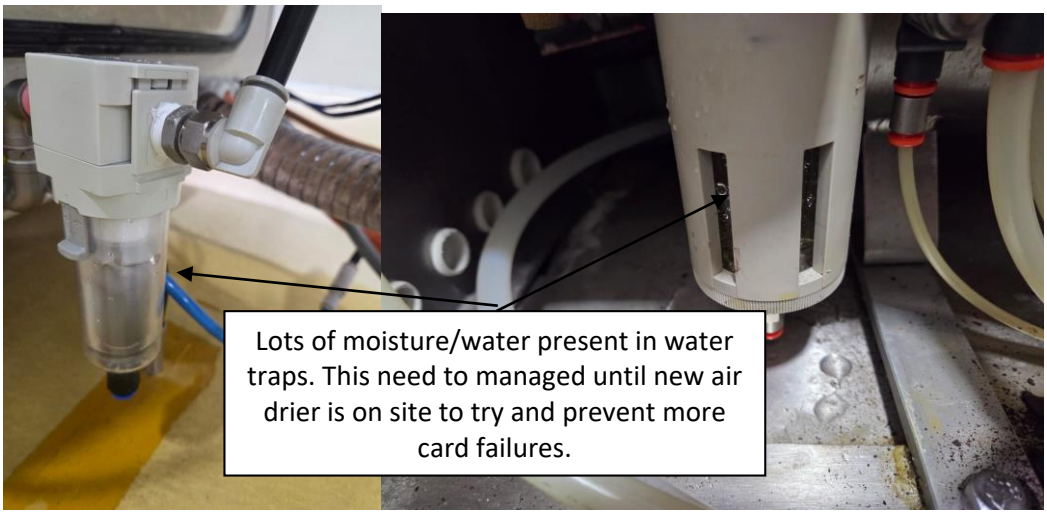

Lots of moisture/water present in water traps. This need to managed until new air drier is on site to try and prevent more card failures.

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

STATUS

TECHNICIAN HOURS	David van der Merwe	
Time	**Start**	**Finish**
Travel To Site:	3:30	12:30
Onsite:	12:30	16:00
Travel From Site:	16:00	16:30
Remote assistance:		
Report writing:	13:00	13:30
Overnight stay	☐	
Overnight stay with flights	☒	

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Anthony	X	18/02/2026
Technician:	David		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au