UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Coles	**Date:**	15/11/2021
Site Address:	72 Templar Road Erskine Park NSW	**Site Contact:**	Rahul Sugumaran
		Phone:	
Customer PO #:		**Internal Job #:**	3425

Subject: Forming and Extractor issue

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Platformer	11614	

Equipment condition:

Work Performed:

Did rapid test and completed all required work permits
Issues : unmolded trays and extractor picking fail on 11x9 MAP tray

When arrived onsite, extraction plate has been dismantled by maintenance team as there was suspect lip moulding plate was bending again.

Actions :

- Checked extraction plate. All spring actions on lip moulding plates and ejectors are good. Noticed 1x lip molding plate is bending, maintenance team was helping to straighten the plate. Other moulding plates are considered still under tolerance.
- Replaced 1x suction cup because it got tiny hole on the side of cup.
- To avoid the risk of having lip moulding plate bending in future, we re-activated extractors pressure switch valves 1-6 (somehow found the switch setting was “by-passed”). These switches are detecting repetitive unload fails on any of channel 1-6 before stopping the machine with error. In this way extractor won’t have risk to unload “multi-stack” of fail trays from lower tool. Photo on the left below showing out1 is already “High” even with no vacuum working. And after correcting setting on parameter SP1: -0.5, photo on the right below showing out1 “Low” with no vacuum working.

GENERAL SERVICE REPORT

- Test run machine and noticed issue on forming. The 1st and last tray were fail to form on the short edges. Tried different ways of forming settings without any success.
- Thanks to Tom Darwen's help, he picked up faulty linier bearings on Load PeP. Bearings have big play about 10mm. This play will cause film to not line up/has an angle when loaded into low tool.

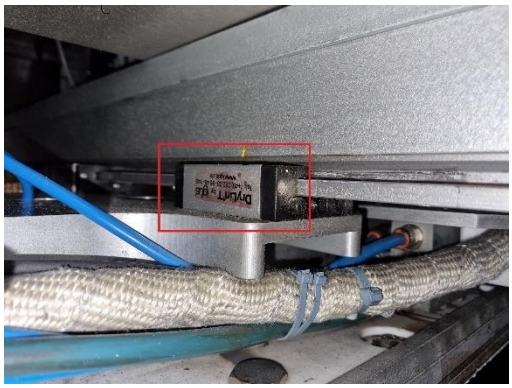

- Checked and found 2x spare bearing in store. Since there are 4x needed and only 2x in spare, we decided to replace 2x in diagonal. Load PeP play was improving a lot after the repair.
- Test run machine but this time only 1st tray is fail to form but in different side of short edge.
- Observed further and noticed fail was always happening on Top Tool#1.
- Set machine to run different Top Tool configuration using 2&4 plates instead of 1&3.
- Test run machine, forming was good on both plates in every cycle.
- To ensure proper unload PeP after lip moulding cycle, we decreased % speed of lower tool opening after lip moulding to 10%.
- Monitoring production run for about 15mins with maintenance team, forming and tray unload was working well
- Saved these new setting under new recipe named "Plantic MAP 2+4 Tom"

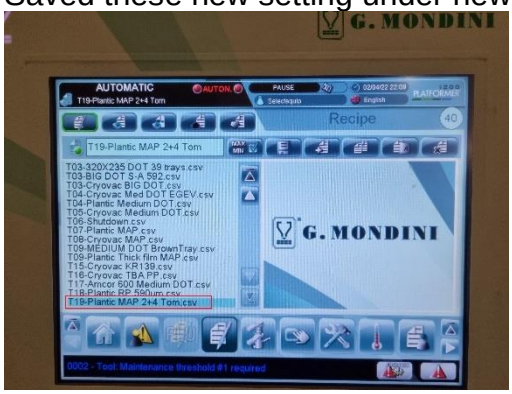

Summary :

- We still need to replace all 4x load PeP linier bearing. Tom has requested the order through spares and we will also send a quote for another complete set to be kept in your stock.
- Confirming there is issue on Top Tool Plate #1 11x9 MAP tray. Problem could be the plate, rotary head base or the position setting? To eliminate the possibilities, our suggestion is to do another test by swapping with other plate and put it on Pos#1.

GENERAL SERVICE REPORT

- Since pressure switch for unload PeP is re-activated now, there might be hicks-up while running other format. Please be aware of this, let us know should you need our assistance to observe issues on other format.

*** end of report ***

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Test run 11x9 MAP tray		
Revisit Required?	Yes☐	No☒
Comments:		

RECOMMENDATIONS
Comments: To qoute 4x linier bearing for load PeP

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Benni Wijaya

TECHNICIAN HOURS					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	14:45	15:30			
Onsite:	15:30	23:15			
Travel From Site:	23:15	24:00			

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Rahul	X _____	05/02/2022
Technician:	Benni		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au