

CT\Meter Check Fault

Author:胡维
Reviewer: Eason

FAQ\Hybrid INV

Issue introduction:



The inverter screen displays:CTMeterConFault IE37.


Confirmation of basic information:

[Photo] SN numbers of the inverter

Guidance for installer

Step1:Upgrade the firmware version to the latest.

Step2: Check CT direction, when only CT is connected, the CT arrow points to the grid, and when meter-CT is connected, the CT direction points to the inverter.

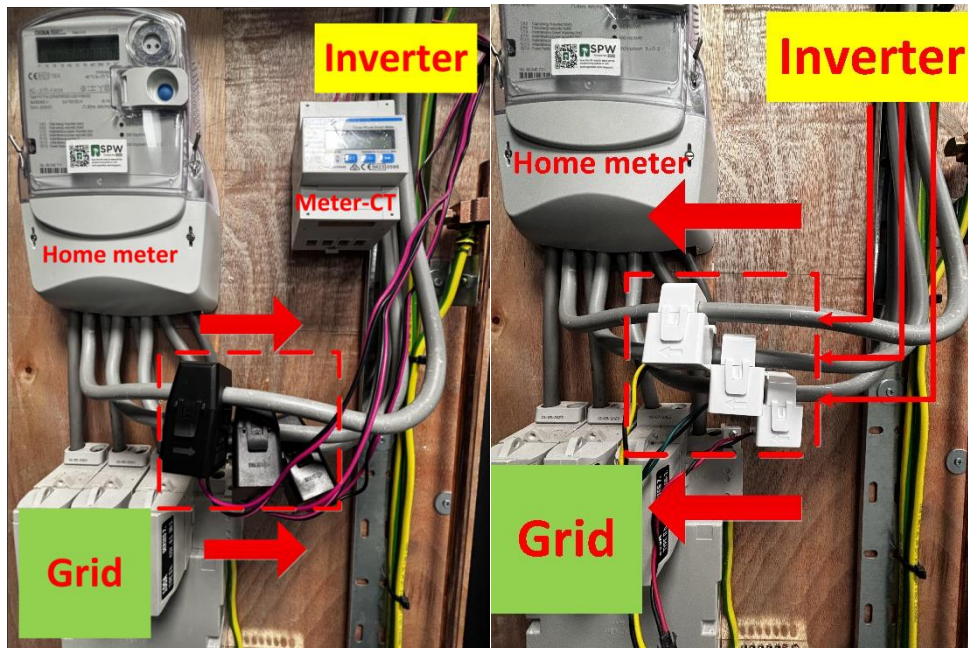

Step3: Disconnect the PV and battery of the inverter, open any three-phase equipment at home, if the three-phase load can be stably taken from the grid and the meter sampling data conforms to the load rated power value, then restart the inverter and enable the Installation Check function. (This

function can only be operated when connected to grid)

Setting Path: *Advanced->Meter/CT Setting->Meter/CT Check->Installation Check*

Meter/CT Check


Installation Check

☐ Enable

Cyclic Check

☐ Enable

Wait a minute for the results, make the necessary corrections to the table based on the prompt code

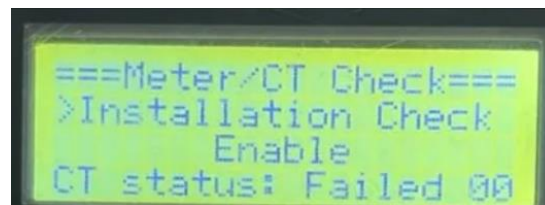

Error Codes	Meaning
Fail 00	Phase A has no CT clipped on it.
Fail 01	Phase A has 2 <u>CTs</u> clipped on it, or there is CT clipped on the N wire.
Fail 02	CT1 is clipped to Phase A and Phase B.
Fail 03	CT2 is clipped to Phase A and Phase B.
Fail 04	CT3 is clipped to Phase A and Phase B.
Fail 05	Phase B has no CT clipped on it.
Fail 06	Phase B has 2 <u>CTs</u> clipped on it, or there is CT clipped on the N wire.
Fail 07	CT1 is clipped to Phase A and Phase C.
Fail 08	CT2 is clipped to Phase A, CT1 is clipped on Phase B and Phase C.
Fail 09	CT3 is clipped to Phase A, CT1 is clipped on Phase B and Phase C
Fail 10	CT2 is clipped to Phase A and Phase C.
Fail 11	CT1 is clipped to Phase A, CT2 is clipped on Phase B and Phase C
Fail 12	CT3 is clipped to Phase A, CT2 is clipped on Phase B and Phase C
Fail 13	CT3 is clipped to Phase A and Phase C.
Fail 14	CT1 is clipped to Phase A, CT3 is clipped on Phase B and Phase C
Fail 15	CT2 is clipped to Phase A, CT3 is clipped on Phase B and Phase C
Fail 16	Phase C has no CT clipped on it.
Fail 17	Phase C has 2 <u>CTs</u> clipped on it, or there is CT clipped on the N wire.
Fail 18	No reactive power was detected on phase A after adjusting the CT sequence.
Fail 19	No reactive power was detected on phase B after adjusting the CT sequence.
Fail 20	No reactive power was detected on phase C after adjusting the CT sequence.
Fail 21	Meter phase A direction is reversed.
Fail 22	Meter phase B direction is reversed.
Fail 23	Meter phase C direction is reversed.
Fail 24~31	Reservation
Fail 32	Not connected to the grid
Fail 33	The inverter reports an error and cannot run (see Error for details)
Fail 34	The inverter can not start normally (detection timeout)
Fail 35	ARM and DSP have not established effective communication.
Fail 36	CT is not connected to L phase

The error message is just a reminder and may not necessarily correspond to the actual installation issue. Usually, if there are no issues with the installation wiring of the meter or CT, updating the firmware version to the latest one can solve the problem.


Information check list :

If you have completed the above <Guidance for installer>, and the problem is still not solved, please collect the following troubleshooting information and send them to the R&D.

1. [Photo] SN numbers of the inverter.



2. [Photo] CT direction.

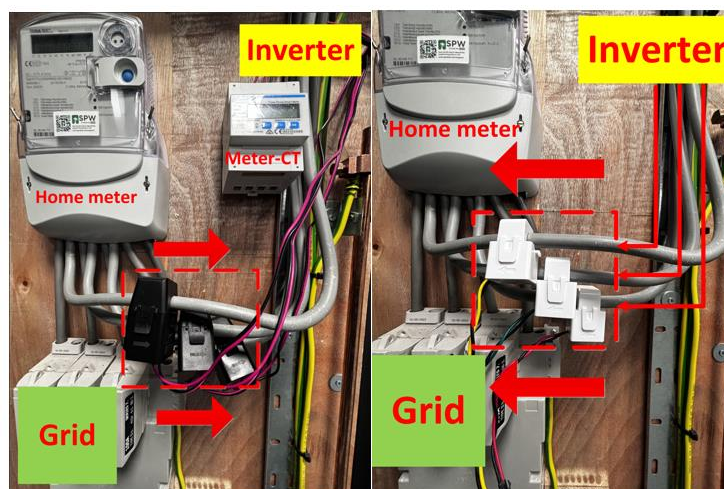

3. [Photo] The inspection results after enabling the "self-checking" function.

