


AM-3110

User Guide




AM-3110 Dimensions


• Dimensions (mm)

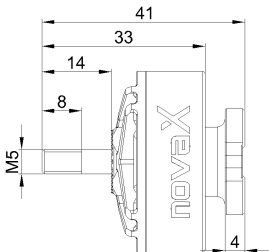

Side

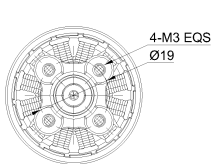

Bottom · mount

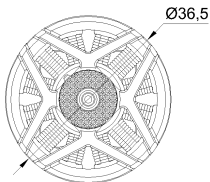

Top · propeller side

AM-3110 Specifications

• Basic Specifications

Stator Dimensions	$\phi 37.4 \times 27 \text{ mm}$
Slots / Poles	12N14P (7 pole pairs)
Motor Weight	78 g
Shaft / Thread	$\phi 5.0 \text{ mm} / \text{M5} \times 0.8$
Mounting Hole	$19 \times 19 \text{ mm (M3)}$
KV Value	KV1150
Rated Voltage	$14.8 \sim 22.2 \text{ V}$
Max Current	59.1 A
Max Power	1437 W
Recommended Prop	$8 \sim 10 \text{ inch (} 8 \times 4.0 / 10 \times 5.1 \text{)}$
Operating Temp	$-20 \sim +85 \text{ }^{\circ}\text{C}$

AM-3110 Performance Data

6S LiPo, sea-level static thrust stand. Measured values; rated specs may differ.

• Propeller 8 × 4.0

Throttle	Thrust (g)	Current (A)	Power (W)	Eff. (g/W)	Temp (°C)
20%	276.0	1.53	38.5	7.2	21.0
40%	704.1	5.19	130.3	5.4	21.2
60%	1431.9	13.80	344.0	4.2	21.6
80%	2364.5	29.12	716.8	3.3	22.3
100%	3363.9	51.51	1244.2	2.7	22.7

• Propeller 10 × 5.1

Throttle	Thrust (g)	Current (A)	Power (W)	Eff. (g/W)	Temp (°C)
20%	306.0	1.64	41.3	7.4	24.2
40%	1090.0	7.95	199.3	5.5	25.2
60%	2128.0	22.40	555.5	3.8	26.7
80%	3198.0	43.92	1070.8	3.0	31.5
100%	3584.0	59.07	1437.3	2.4	33.8

AM-3110 Installation



1. **Mounting** — Fix the motor to the arm through the bottom mounting holes. Follow the screw size and spacing on the drawing and use screws that do not reach the windings.
2. **ESC wiring** — Connect the three motor wires to the ESC outputs. To reverse the rotation, swap any two wires or reverse it in the ESC settings.
3. **Spin check** — Without a propeller, run at low throttle and check the direction and for abnormal noise.
4. **Propeller** — Fit a propeller matching the rotation and tighten the nut firmly.
Recommended: 8 ~ 10 inch (8×4.0 / 10×5.1).

AM-3110 Safety Notes

- Do not exceed the rated voltage. Rated: 14.8 ~ 22.2 V.
- Use an ESC rated with margin above the motor maximum current. Max current: 59.1 A.
- Always remove the propeller while wiring, configuring or bench testing.
- The motor can be hot right after operation; let it cool before touching.
- Keep metal debris away from the magnets; stop using the motor if the shaft is bent or the bearings are noisy.



<Detailed Manual>

novaX