

BAY PROCEDURE

Tacoma RV Center · Document Library

CONCERN
MODEL
PRIMARY

Icing up on rear wall - only about half from the top down


Furrion FCR10DCGTA-BL

DATE 2026-09-19

WO# WO-ICE

Furrion fridge service manual, Ice and Moisture section (Fig. 36).

VISUAL FLOWCHART

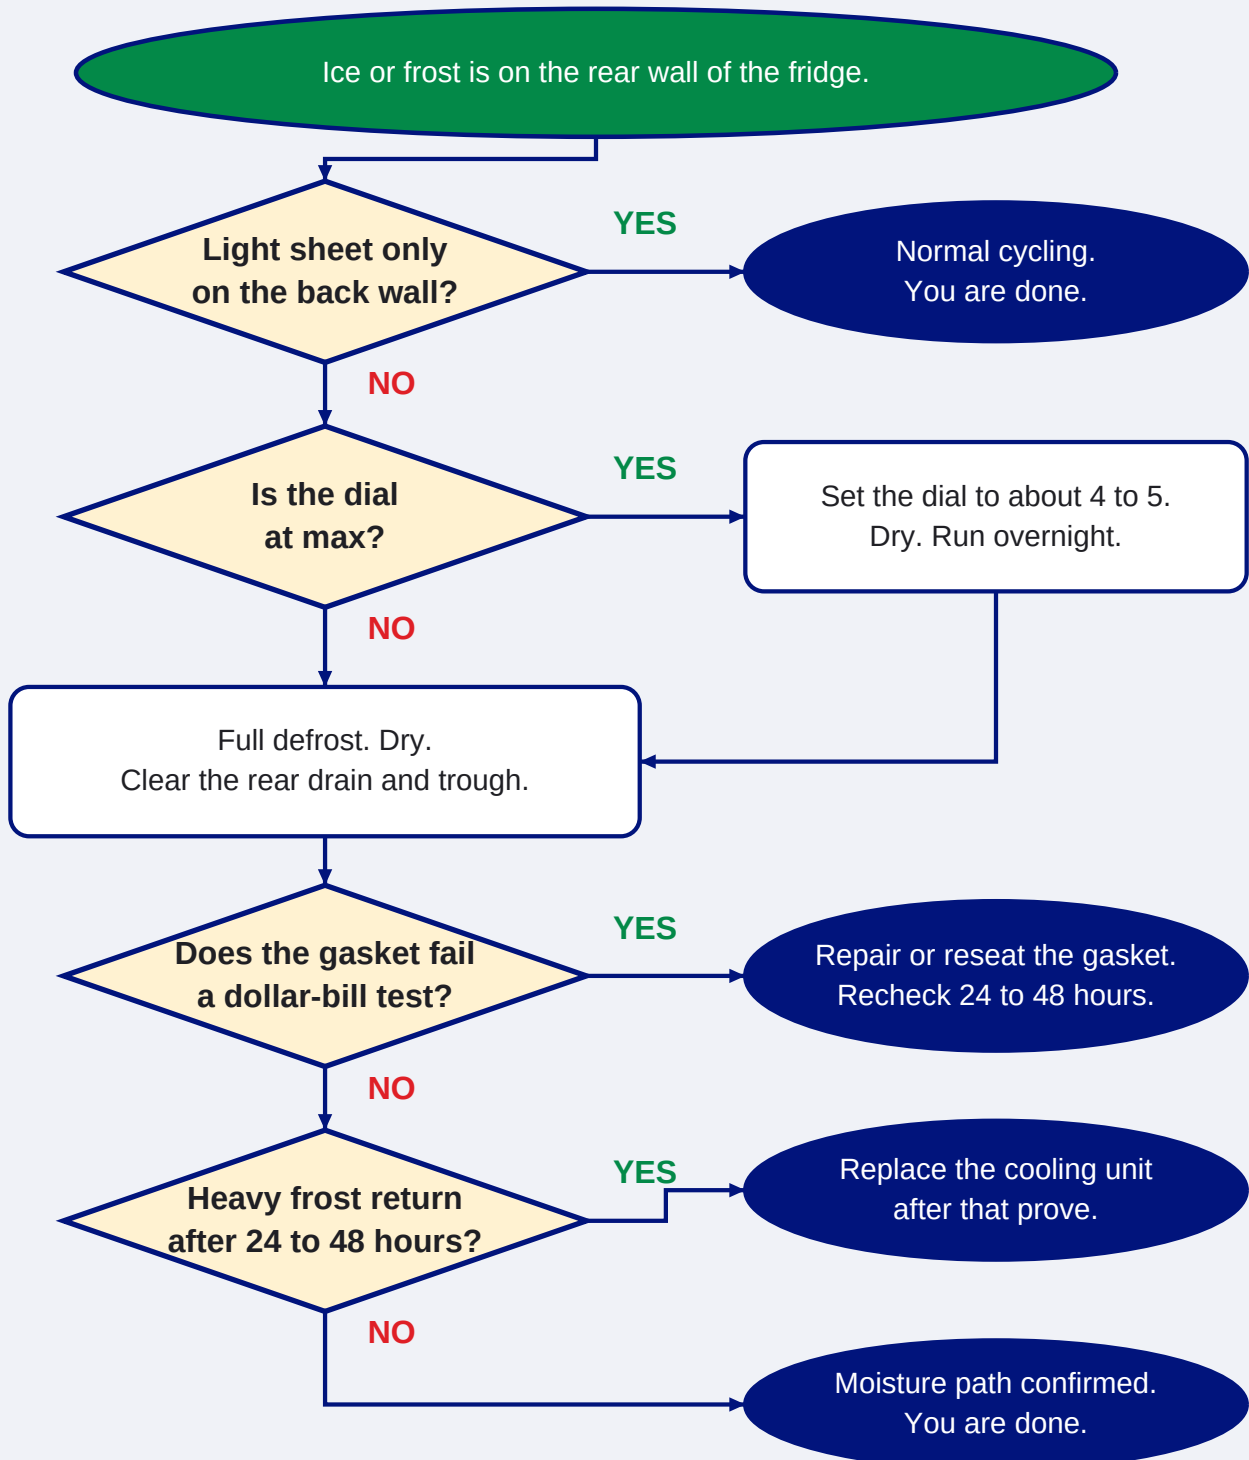

WHAT THIS PATTERN USUALLY MEANS

A frost or ice band on the upper rear wall, with the lower rear often clearer, is a common Furrion fridge complaint. It is usually moisture on a cold evaporator surface from the door seal, humidity, setpoint, airflow, or the drain. A light sheet of ice or moisture only on the back wall is normal cycling: the cabinet condenses, freezes, and thaws. This pattern by itself is not proof of a sealed-system failure.

BAY ORDER (DO THIS FIRST)

- ☐ 1. Open the fridge and note the ice or moisture pattern. Photograph it. If it is only a light sheet on the back wall and nowhere else, that is normal cycling: no further action is required for that alone, and you are done. If frost is heavy, starts halfway down, or shows on other surfaces, keep going.
- ☐ 2. Record the dial setting and the fridge and freezer cavity temperatures. If the dial is at max, set it to about 4 to 5, towel-dry the melt, let the fridge run overnight, then look at the pattern again. If the ice begins to melt at mid setpoint, stay on the moisture path. If the dial is already mid, go to the defrost next.
- ☐ 3. Do a full manual defrost. Power the unit off, open both doors, and use towels. Do not scrape, do not use a heat gun, and do not set hot-water pans in the cabinet. When the ice is gone, go to the dry-and-drain step.
- ☐ 4. Dry the cabinet completely. Clear the rear drain and trough with a soft plastic probe only so melt water can leave. If water backs up, keep clearing until it leaves, then go to the gasket. If the drain is already open, go to the gasket next.
- ☐ 5. Check the door gasket with a dollar-bill test around the full perimeter, and check the hinges, latch, and door alignment. If the bill slides out with no drag, reseal or replace the gasket, set the dial to about 4 to 5, leave an air gap at the rear wall, and recheck in 24 to 48 hours. If the gasket holds, set the dial mid, leave the air gap, and recheck in 24 to 48 hours.
- ☐ 6. After 24 to 48 hours, if the frost is gone or only a light sheet remains on the back wall, the correction is the moisture path: mid setpoint, a holding gasket, and a clear drain. You are done. If heavy frost returns with a mid dial, a good gasket, and a clear drain, the unit is not cooling to target: replace the cooling unit.
- ☐ 7. If cooling is good but the same heavy frost still returns after the moisture path is cleared, dry the cabinet again and watch door-open time and humidity for about a month. If the heavy frost returns hard after that watch, replace the cooling unit. That is the confirmed correction.

DO NOT


- Do not knife the ice off the rear wall.
- Do not assume a sealed-system failure from top-half frost alone.
- Do not leave the cabinet wet after defrost

SOURCES (SHOP DOCUMENT LIBRARY)

- Furrion FCR08/FCR10 SM CCD-0008122 page 36
Ice and Moisture. Ice or Moisture in the Fridge. Figure 36 shows the rear-wall frost pattern.
- Furrion FCR08/FCR10 SM CCD-0008122 page 6
Defrosting. Power the unit off, open the doors, and use towels. Do not scrape, do not use a heat gun, and do not set hot-water pans.
- Furrion FCR08/FCR10 SM CCD-0008122 page 51
Door gasket. Dollar-bill test around the full perimeter. Check hinges, latch, and door alignment.

CITED LIBRARY FIGURES

Fig. 36 rear-wall frost pattern, views A and B -- Furrion FCR08/FCR10 SM CCD-0008122 p.36

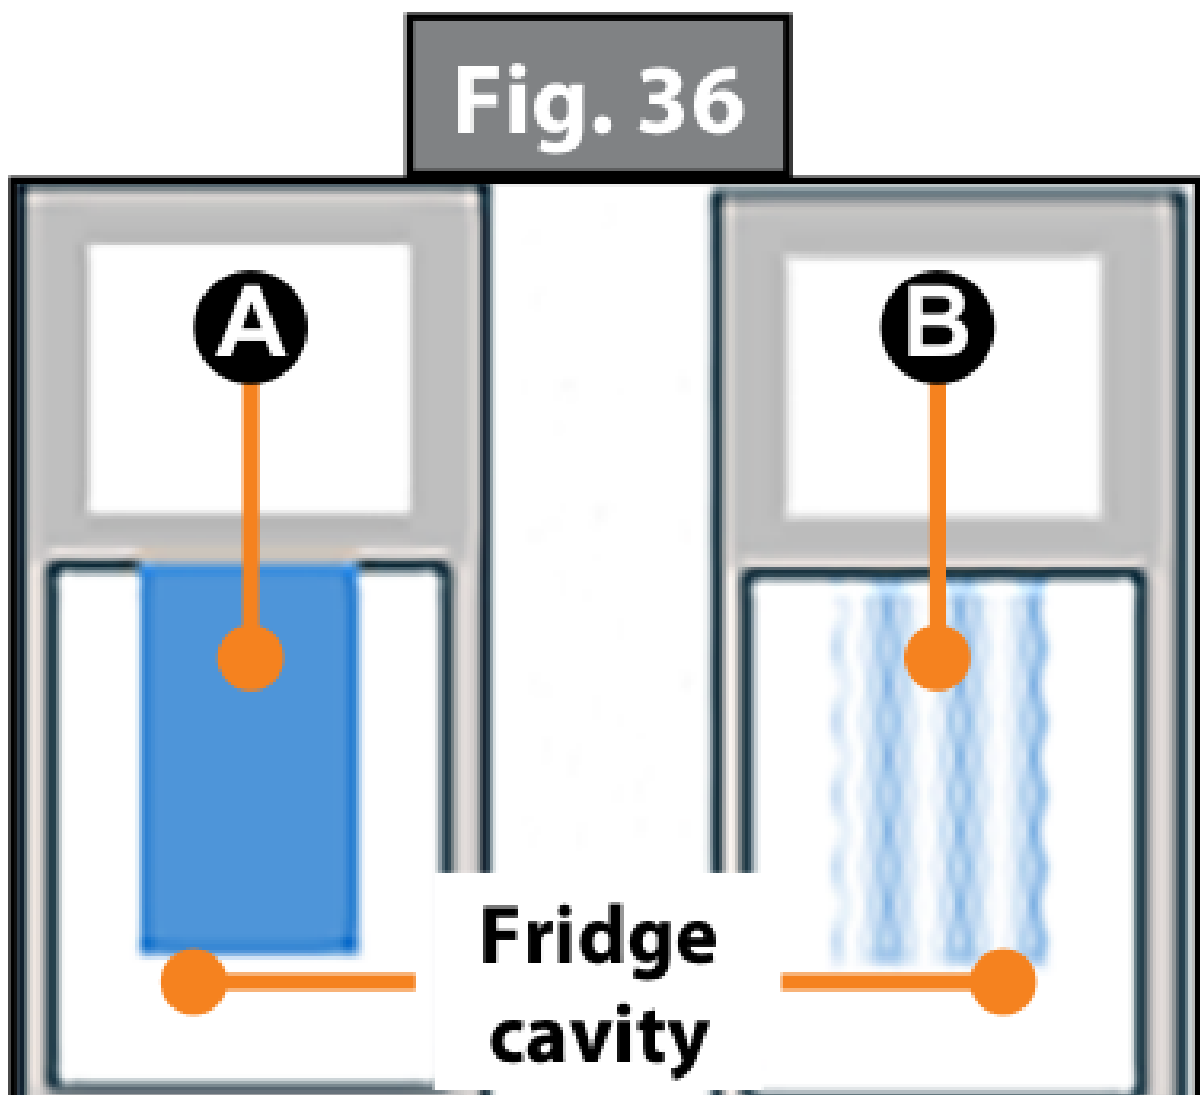

CITED LIBRARY FIGURES

CCD-0008122 page 36 Ice and Moisture -- Furrion FCR08/FCR10 SM CCD-0008122 p.36

Internal Ice and Moisture in Cavities - Ice or Moisture in the Fridge Diagnostics

