

BAY PROCEDURE


Tacoma RV Center · Document Library

CONCERN	FACR08 freeze up interior leak condensate		
MODEL	Furrion Chill rooftop unit	DATE	2026-09-19
PRIMARY	Furrion rooftop assembly and condensate path. Chill layout book for the pan and drain.		
		WO#	WO-FACR

WHAT THIS PATTERN USUALLY MEANS

A Furrion rooftop freeze, interior leak, or condensate drip is an assembly and condensate problem. Prove the evaporator pan, the drain, the base-pan slope, and suction-line icing before you condemn the sealed system.

VISUAL FLOWCHART

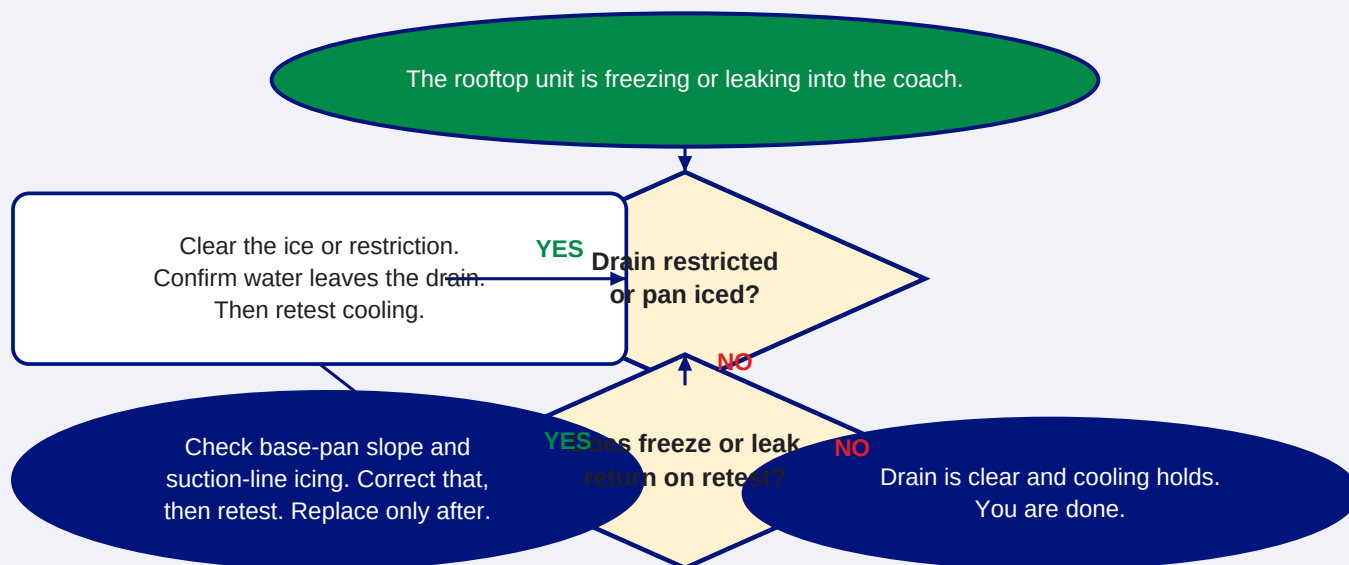

BAY ORDER (DO THIS FIRST)


- ☐ 1. Inspect the rooftop assembly, the evaporator pan, and the condensate drain. If the drain is restricted or the pan is iced, clear the ice or the restriction and confirm water leaves the drain, then retest cooling. If the pan is dry and the drain is open, go to the next check.
- ☐ 2. Confirm the drain path from the evaporator pan out of the rooftop. If melt water backs up, clear the trough and the hose, then retest cooling. If water leaves freely, run cooling and watch the pan.
- ☐ 3. Retest cooling and watch the pan and the interior. If the freeze or leak is gone, you are done. If ice or drip returns with a clear drain, check the base-pan slope and suction-line icing next.
- ☐ 4. If the base pan is tilted or the suction line is iced, correct that and retest. If the pan is level, the suction line is clear, and the freeze or leak still returns, replace the rooftop unit after that assembly prove.

DO NOT

- Do not condemn the sealed system before you clear the drain and the pan.

SOURCES (SHOP DOCUMENT LIBRARY)

- Furrion Rooftop HVAC Troubleshooting & Service Manual CCD-0007990
 - Furrion Chill FACR CCD-0008666
- Figures: Rooftop assembly, base pan, and drain - Furrion Rooftop HVAC Troubleshooting & Service Manual CCD-...

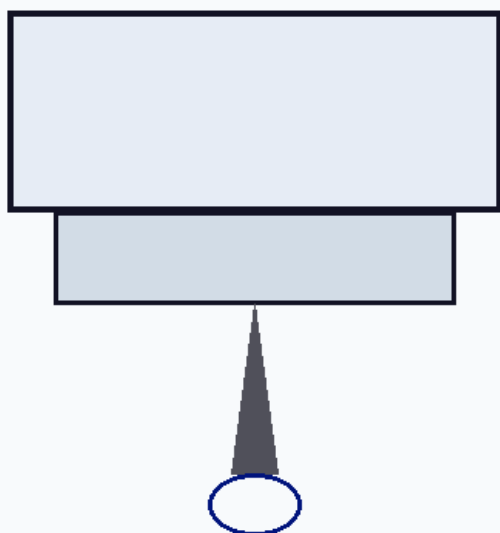

Drain path

Rooftop assembly / base pan

Inspect the evaporator pan and the condensate drain.

If the drain is restricted or the pan is iced, clear it, then retest cooling.