

BAY PROCEDURE

Tacoma RV Center · Document Library

CONCERN

FACR08 freeze up interior leak condensate

MODEL

Furrion Chill rooftop unit

DATE 2026-09-19


WO#

WO-FACR

PRIMARY

Furrion rooftop assembly and condensate path. Chill layout book for the pan and drain.

VISUAL FLOWCHART

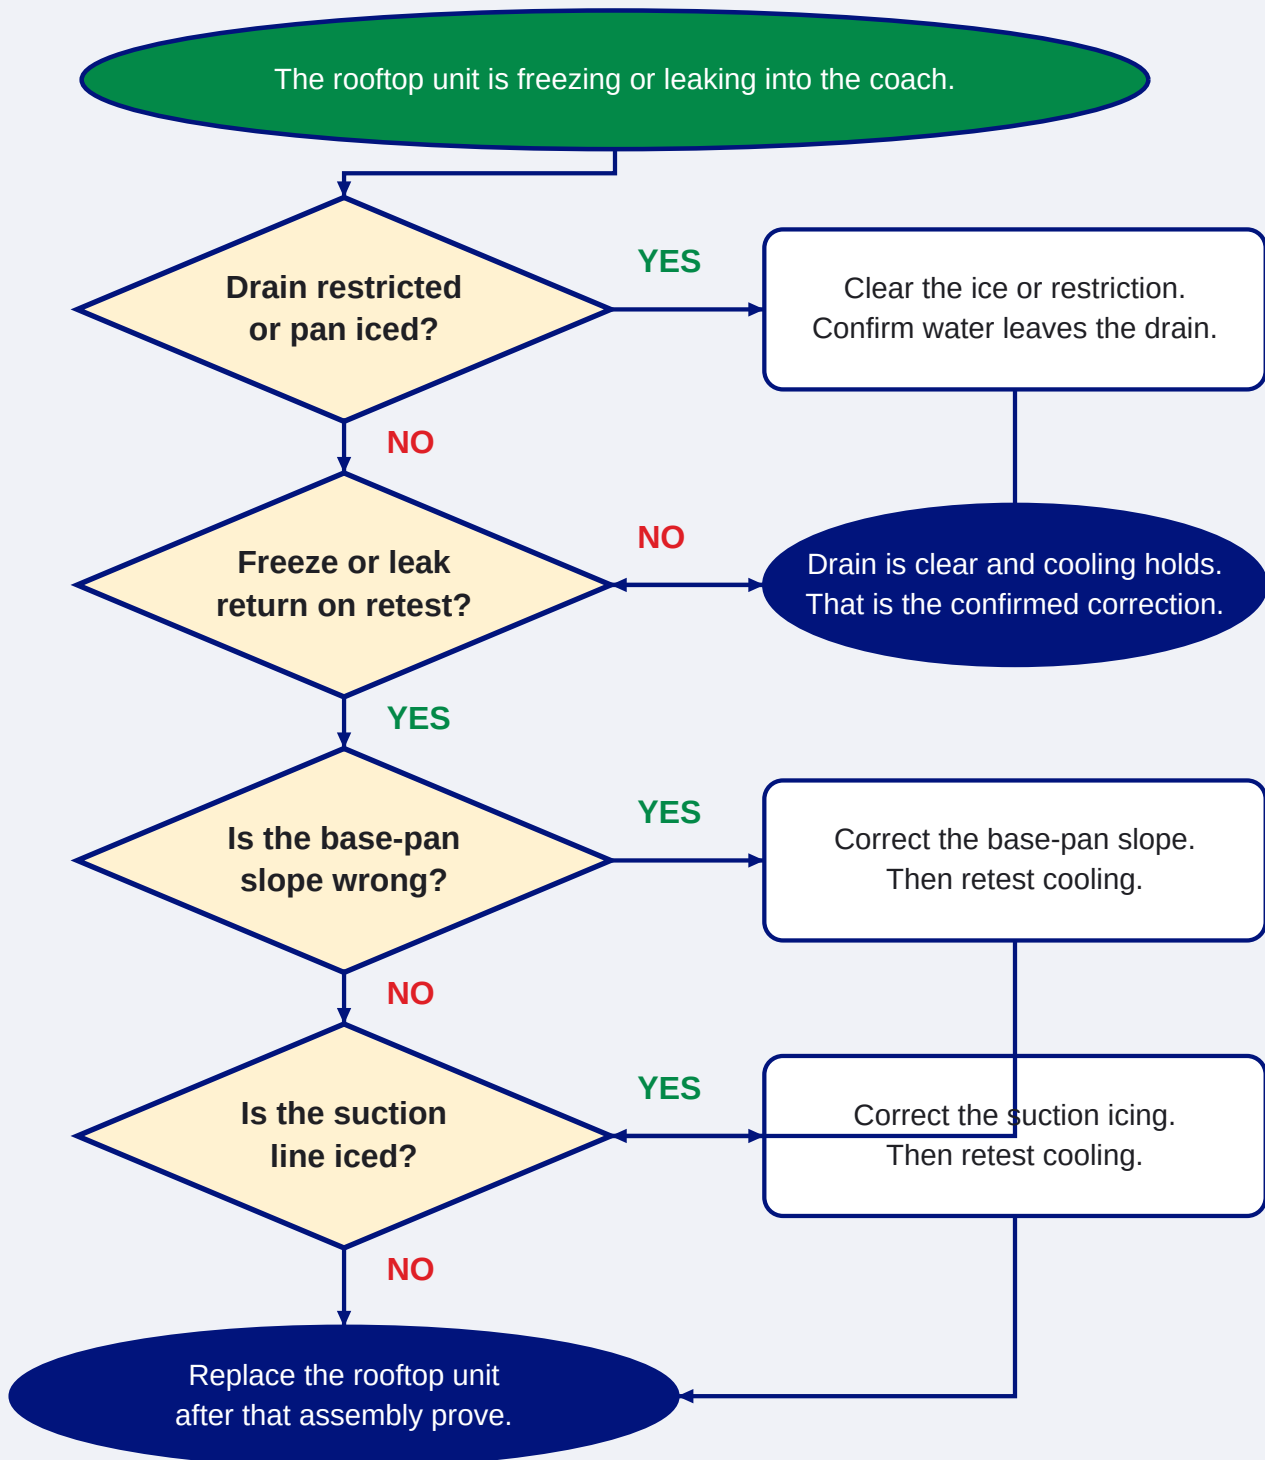

BAY PROCEDURE

Bay order · Tacoma RV Center

WHAT THIS PATTERN USUALLY MEANS

A Furrion rooftop freeze, interior leak, or condensate drip is an assembly and condensate problem. Melt water that cannot leave the evaporator pan ices the pan, backs up, and drips into the coach. Prove the evaporator pan, the condensate drain, the base-pan slope, and suction-line icing before you condemn the sealed system. A clear drain and a dry interior after a full cool cycle is a passed assembly prove.

BAY ORDER (DO THIS FIRST)

- ☐ 1. Inspect the rooftop assembly, the evaporator pan, and the condensate drain. If the drain is restricted or the pan is iced, clear the ice or the restriction and confirm water leaves the drain, then retest cooling. If the pan is dry and the drain is open, go to the drain-path confirm next.
- ☐ 2. Confirm the drain path from the evaporator pan out of the rooftop. If melt water backs up, clear the trough and the hose, then retest cooling. Water leaving freely is a pass: run cooling and watch the pan. Water that stands or overflows is a fail: stay on the drain until it leaves.
- ☐ 3. Watch the pan and the freeze-sensor area through a full cool cycle. If ice reforms in the pan or the drain ices shut, clear it again and prove the drain remains clear on the next cycle. If the drain remains clear and the pan stays dry, check the base-pan slope next.
- ☐ 4. Check the base-pan slope. If the pan is tilted so water cannot reach the drain, correct the slope and retest cooling. If the pan is level and water still reaches the drain, check suction-line icing next.
- ☐ 5. Check the suction line for icing. If the suction line is iced, correct that icing and retest cooling. If the suction line is clear, run a full cool cycle and watch the interior.
- ☐ 6. Retest cooling and watch the pan and the interior. If the freeze or leak is gone, the correction is the drain, pan, slope, or suction work you just proved. You are done.
- ☐ 7. If ice or drip returns with a clear drain, a level base pan, and a clear suction line, replace the rooftop unit after that assembly prove. That is the confirmed correction.

DO NOT

- Do not condemn the sealed system before you clear the drain and the pan

SOURCES (SHOP DOCUMENT LIBRARY)

- Furrion Rooftop HVAC Troubleshooting & Service Manual CCD-0007990
Rooftop assembly, condensate drain, base pan, and freeze path.
- Furrion Chill FACR CCD-0008666
Furrion Chill drain, base-pan, and freeze-sensor layout.

CITED LIBRARY FIGURES

CCD-0007990 page 7. Water enters the vehicle. Clean the drainage openings. -- Furrion Rooftop HVA...

Troubleshooting

Problem	Cause	Remedy
Rooftop air conditioner Abnormal shutdown	Freeze sensor has tripped.	Outer temperature is too low or all air nozzles are closed.
Rooftop air conditioner Abnormal shutdown	Freeze sensor has tripped.	Outer temperature is too low or all air nozzles are closed
Not cool enough	Refrigerant leakage	Contact an authorized service agent or Furrion (see the detail contact info at the back page of this manual).
	The rooftop air conditioner is not set to cooling.	Set the rooftop air conditioner to cooling.
	The set temperature is too high.	Select a lower temperature.
	The evaporator fan is damaged.	Contact an authorized service agent or Furrion® (see the detail contact info at the back page of this manual).
	The condenser fan is damaged.	Contact an authorized service agent or Furrion® (see the detail contact info at the back page of this manual).
	The air intake grilles are blocked or obstructed.	Remove any leaves and other dirt from the ventilation grilles of the rooftop air conditioner.
	The blower is defective.	Contact an authorized service agent or Furrion® (see the detail contact info at the back page of this manual).
Water enters the vehicle	The condensation water drainage openings are clogged up.	Clean the drainage openings for condensation water.
	The seals are damaged.	Contact an authorized service agent or Furrion® (see the detail contact info at the back page of this manual).
Rooftop air conditioner does not switch on	No supply voltage connected.	Check the power supply.
	The voltage is too low.	Contact an authorized service agent or Furrion® (see the detail contact info at the back page of this manual).
	Fuse blown or circuit protector tripped.	Check the electrical fuse of the power supply.

Specifications

Model Number	FACR13SA-PS FACR13SA-BL	FACR13HESA-BL FACR13HESA-BL-AM	FACR14SA-PS FACR14SA-BL-AM	FACR15SA-PS FACR15SA-BL-AM	FACR15HESA-BL FACR15HESA-BL-AM
Cooling Capacity (Btu/h)	13,500	13,500	14,500	15,500	15,500
Dehumidification (pint/h)	2.5	1.8	2.7	3.2	3.0
Applicable vehicle length (feet)	23	23	26	31	31
Refrigerant	R410A	R410A	R410A	R410A	R410A
Charge (Oz)	15.9	13.9	19.8	23.1	20.8
Roof top Unit Dimensions (L x W x H) (inch)	34-7/8" x 27-5/8" x 13-5/8"	34-7/8" x 27-5/8" x 13-5/8"	34-7/8" x 27-5/8" x 13-5/8"	34-7/8" x 27-5/8" x 13-5/8"	34-7/8" x 27-5/8" x 13-5/8"
ELECTRICAL					
Volts/Frequency	115V~/60Hz/1Ph	115V~/60Hz/1Ph	115V~/60Hz/1Ph	115V~/60Hz/1Ph	115V~/60Hz/1Ph
Power Watts (Cooling)	1450	1283	1620	1720	1760
Amps (Cooling)	13.1	11.3	14.6	15.4	15.6
Power Cord Gauge Min. (mm2)	AWG12	AWG12	AWG12	AWG12	AWG12

CITED LIBRARY FIGURES

CCD-0008666 page 10. Rooftop unit base and roof opening. -- Furrion Chill FACR CCD-0008666 p.10


Installation

Installing the Rooftop Unit

⚠ CAUTION

- The rooftop unit weighs approximately 100 pounds (45 kg). To prevent back injury, use a mechanical hoist when lifting or moving the unit. Failure to obey this warning could result in injury.
- Do not slide unit. It may damage the gasket at the bottom of the rooftop unit and cause leakage.
- Do not grasp the ventilation slots to lift the rooftop unit up.

1. Grasp the bottom of two sides of the unit, lift and position the rooftop unit into the prepared opening using the gasket at the bottom of the rooftop unit as a guide. (Fig. 1)

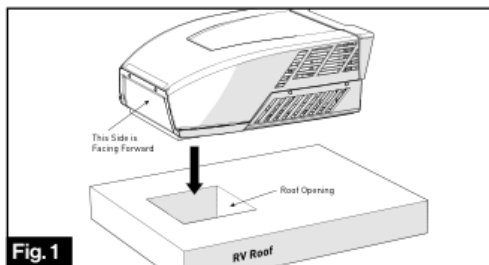

This completes the outside installation of the rooftop unit. Minor adjustments can be done from inside of the RV if required.

Installing the Wall Thermostat

There are 2 types of wall thermostat (sold separately) for you to select.


- FACW10ESSA2-BL: Single zone basic wall thermostat
- FACW12ESZA2-BL: Multi zone wall thermostat

Based on the wall thermostat version you selected. Please refer to the separate instruction manual on how to install the wall thermostat to the RV.

Mounting and Sealing

The rooftop unit is fixed on the RV roof using 4 long bolts through the mounting frame from the interior of the RV ceiling.

1. Check the gasket alignment of the rooftop unit inside the RV over the roof opening and adjust as necessary by lifting and moving slightly. (Fig. 2)

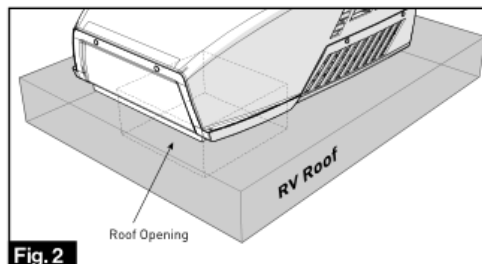

CITED LIBRARY FIGURES

CCD-0007990 page 4. Assembly, decoration plate, and filters. -- Furrion Rooftop HVAC Troubleshoot...

⚠ CAUTION

- The rooftop air conditioner must be installed securely so that it cannot fall down.
- Only operate the rooftop air conditioner if you are certain that the housing and the cables are not damaged.
- Do not use the rooftop air conditioner near flammable fluids or in closed rooms.
- Make sure no combustible objects are stored or installed near the air outlet. A distance of at least 20" must be kept.
- Do not reach into air outlets or insert any foreign objects into the device.

Only use the device as intended.

Do not make any alterations or conversions to the device.

If faults occur in the refrigerant circuit, the system must be checked by a certified service technician and repaired properly. The refrigerant must never be released into the air.

Cleaning and Maintenance

A blocked filter will impair the cooling and heating performance of the unit significantly.

The filter must be cleaned periodically to ensure that it does not become clogged with dust and other particles.

The state of the filter can be ascertained from its appearance. If it appears dirty or clogged then it should be cleaned.


⚠ WARNING

Airborne particles can pose a health risk, particularly to young children and the elderly. Ensure that filters are cleaned in a safe and well ventilated area.

To Clean the Filter

The filter should be cleaned every four weeks or more when in use. Prolonged use, higher concentrations of airborne particles and various other factors may result in the filters needing to be cleaned more often.

1. Remove the decoration plate (Fig. 1A) from the air conditioning system by pushing the side tabs to release.

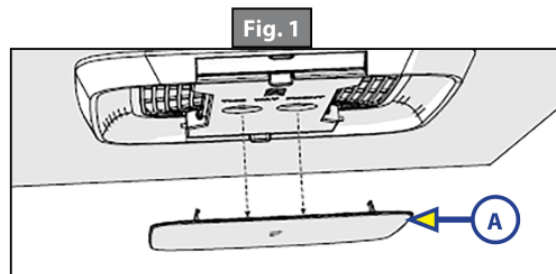

2. Remove the filters (Fig. 2A) by pushing the tabs to release.

