

BAY PROCEDURE

Tacoma RV Center · Document Library

CONCERN

Icing up on rear wall - only about half from the top down

MODEL

Furrion FCR10DCGTA-BL

DATE

2026-09-19

WO#

WO-ICE


PRIMARY

Furrion fridge service manual, Ice and Moisture section (Fig. 36).

WHAT THIS PATTERN USUALLY MEANS

Ice or frost on the rear wall, including a pattern that starts about halfway down from the top, is an Ice and Moisture problem. Follow the Ice and Moisture section of the Furrion fridge service manual. A light sheet on the back wall alone can be normal cycling. This is a moisture, door gasket, and cooling path. It is not a dead-unit fuse check.

VISUAL FLOWCHART

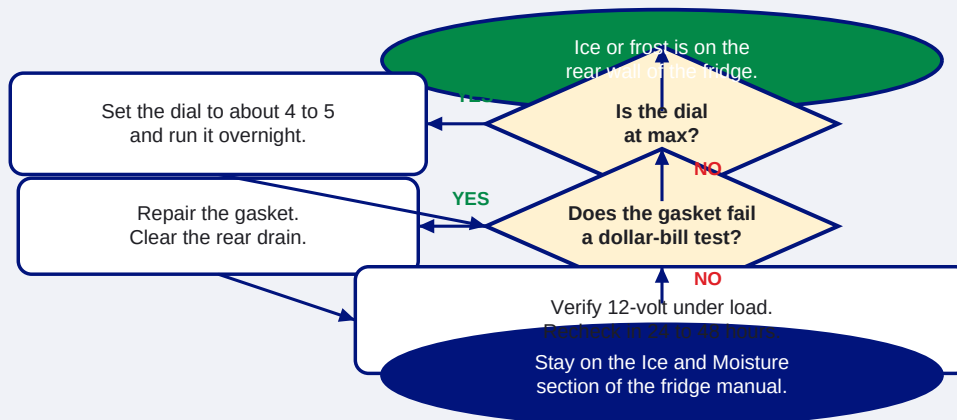

BAY ORDER (DO THIS FIRST)

- ☐ 1. Look at the frost pattern on the rear wall. A light sheet on the back wall alone can be normal cycling.
- ☐ 2. If the temperature dial is at max, set it to mid, about 4 to 5, and let the fridge run overnight.
- ☐ 3. Check the door gasket with a dollar-bill test, then reseal or repair the gasket before you condemn the cooling unit.
- ☐ 4. Clear the rear drain and trough so melt water can leave. Verify 12-volt supply under load at the fridge.
- ☐ 5. Recheck the frost pattern in 24 to 48 hours. Watch or replace the unit only from the Ice and Moisture section of the Furrion fridge service manual.

DO NOT

- Do not knife the ice off the rear wall.
- Do not assume a sealed-system failure from top-half frost alone.
- Do not open the no-power or 15A fuse path for this frost pattern.
- Do not start at the 12-volt inverter unless the unit is dead, has no light, or will not run.

SOURCES (SHOP DOCUMENT LIBRARY)

- Furrion FCR08/FCR10 SM CCD-0008122 page 36
Figures: Fig. 36 - Furrion FCR08/FCR10 SM CCD-0008122 p.36

Fig. 36 -- Furrion FCR08/FCR10 SM CCD-0008122 p.36

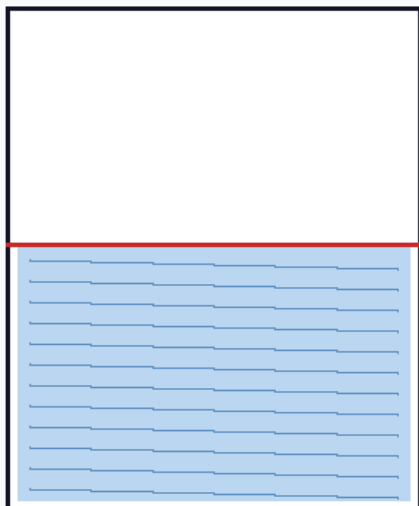


Fig. 36 rear-wall frost pattern

Lightsheet on the back wall

alone can be normal cycling.

Top half clear / frost from mid-down

is the Ice and Moisture pattern.

Furrion fridge service manual

Ice and Moisture section