

BAY PROCEDURE


Tacoma RV Center · Document Library

CONCERN FACR08 freeze up interior leak condensate
MODEL Furrion Chill rooftop unit
PRIMARY Furrion rooftop assembly and condensate path. Chill layout book for the pan and drain.

DATE 2026-09-19

WO# WO-FACR

VISUAL FLOWCHART

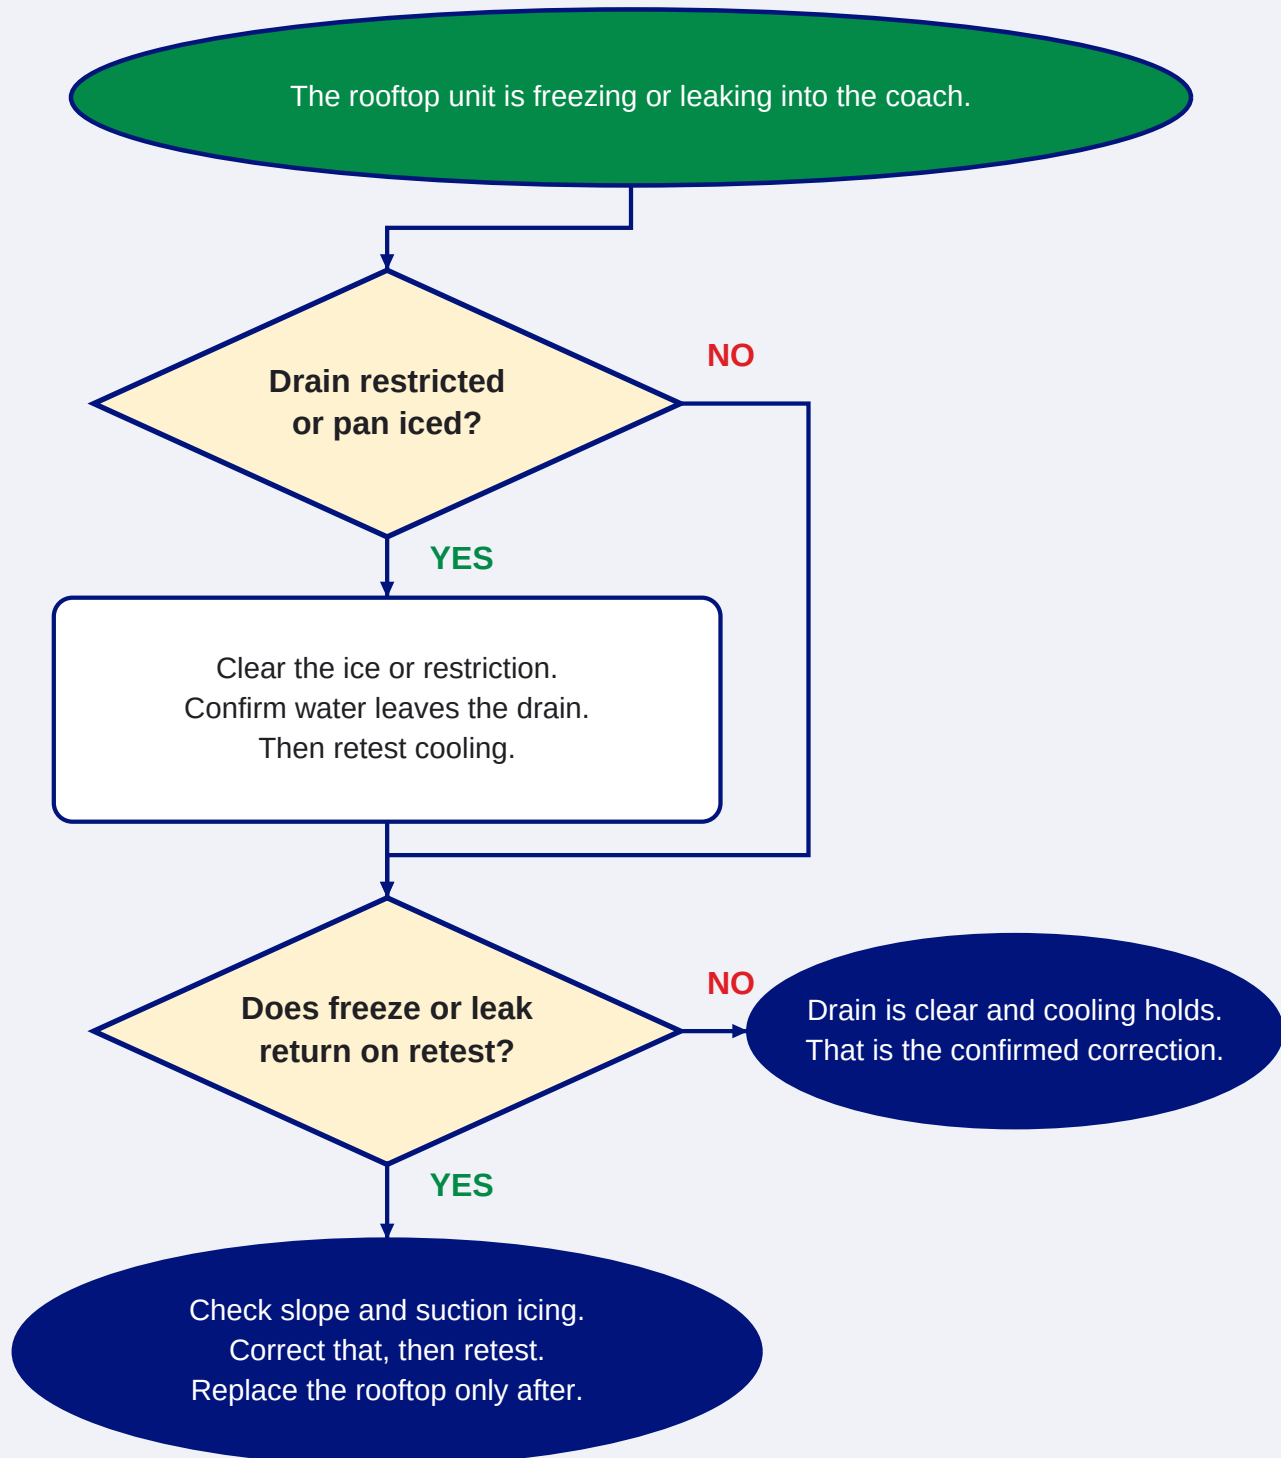

BAY PROCEDURE

Bay order · Tacoma RV Center

WHAT THIS PATTERN USUALLY MEANS

A Furrion rooftop freeze, interior leak, or condensate drip is an assembly and condensate problem. Melt water that cannot leave the evaporator pan ices the pan, backs up, and drips into the coach. Prove the evaporator pan, the condensate drain, the base-pan slope, and suction-line icing before you condemn the sealed system. A clear drain and a dry interior after a full cool cycle is a passed assembly prove.

BAY ORDER (DO THIS FIRST)

- ☐ 1. Inspect the rooftop assembly, the evaporator pan, and the condensate drain. If the drain is restricted or the pan is iced, clear the ice or the restriction and confirm water leaves the drain, then retest cooling. If the pan is dry and the drain is open, go to the drain-path confirm next.
- ☐ 2. Confirm the drain path from the evaporator pan out of the rooftop. If melt water backs up, clear the trough and the hose, then retest cooling. Water leaving freely is a pass: run cooling and watch the pan. Water that stands or overflows is a fail: stay on the drain until it leaves.
- ☐ 3. Watch the pan and the freeze-sensor area through a full cool cycle. If ice reforms in the pan or the drain ices shut, clear it again and prove the drain remains clear on the next cycle. If the drain remains clear and the pan stays dry, check the base-pan slope next.
- ☐ 4. Check the base-pan slope. If the pan is tilted so water cannot reach the drain, correct the slope and retest cooling. If the pan is level and water still reaches the drain, check suction-line icing next.
- ☐ 5. Check the suction line for icing. If the suction line is iced, correct that icing and retest cooling. If the suction line is clear, run a full cool cycle and watch the interior.
- ☐ 6. Retest cooling and watch the pan and the interior. If the freeze or leak is gone, the correction is the drain, pan, slope, or suction work you just proved. You are done.
- ☐ 7. If ice or drip returns with a clear drain, a level base pan, and a clear suction line, replace the rooftop unit after that assembly prove. That is the confirmed correction.

DO NOT


- Do not condemn the sealed system before you clear the drain and the pan

SOURCES (SHOP DOCUMENT LIBRARY)

- Furrion Rooftop HVAC Troubleshooting & Service Manual CCD-0007990
Rooftop assembly, condensate drain, base pan, and freeze path.
- Furrion Chill FACR CCD-0008666
Furrion Chill drain, base-pan, and freeze-sensor layout.

CITED LIBRARY FIGURES

Rooftop assembly, base pan, and drain -- Furrion Rooftop HVAC Troubleshooting & Service Manual CC...

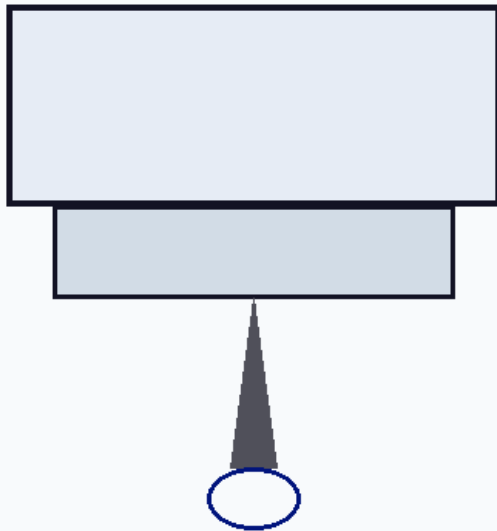

Drain path

Rooftop assembly / base pan

Inspect the evaporator pan and the condensate drain.

If the drain is restricted or the pan is iced, clear it, then retest cooling.