

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74857 - Suspended Campaign H291 - XCL / AJ20P - Ingenium 2.0 Petrol Coolant Pump (P2B61-73 / P26CB-72)

Models : E-Pace / X540

E-Pace / X540 (China L2C)

F-Pace / X761

F-Type / X152

XE / X760

XE / X760 (China L2C)

XF / X260

XF / X260 (China L2C)

Engineer Chris Davies

Name :

Last 16 JUN 2020 13:19:48

Modified :

Category : Engine

Symptom : 402000 Cooling System Concerns

Content : **Issue:**

- E-Pace / X540 - 19MY Onwards
- F-Pace / X761 - 19MY Onwards
- F-Type / X152 - 19MY Onwards
- XE / X760 - 19MY Onwards
- XF / X260 - 19MY Onwards

H291 campaign was rescinded as of 9th June 2020, due to software for X540 is not currently available to resolve the customer symptom below, which will result in unsuccessful downloads.

Customers may experience excessive cooling fan noise in the passenger compartment and eventual degradation of the engine cooling system performance. The following Diagnostic Trouble Codes (DTCs) may be stored in the Powertrain Control Module (PCM):

- P2B61-73
- P26CB-72

The campaign is estimated to be re-issued on or before 10th July 2020.

Cause:

The coolant diversion shroud inside the variable coolant pump is not moving to the correct position when requested by the PCM. The PCM then activates the engine cooling fans at high speed to avoid potential overheating.

Action:

X540:

If an X540 visits a retailer before the campaign is re-issued and has the symptoms stated above please replace the cooling pump.

For all other models stated above;

CAUTION: This procedure requires a minimum of Pathfinder 285 loaded or later.

1. Connect the JLR approved battery support unit.
2. Connect the JLR approved diagnostic equipment to the vehicle and begin a new session.
3. Follow the JLR approved diagnostic equipment prompts.
4. Select 'ECU Diagnostics'.
5. Select 'Powertrain control module [PCM]'.
6. Select 'Update ECU'.
7. Follow all on-screen instructions to complete the task.
8. If required, reset the vehicle to 'Transportation mode'.
9. When all the tasks are complete, exit the session.
10. Disconnect the JLR approved diagnostic equipment and the JLR approved battery support unit.

Please note: H291 claims may only be submitted once the campaign is made live again. Any claims submitted during the suspended period will be auto rejected. During this period please refer to RTS and JLR warranty policy to claim for the rectifications detailed above.

This SSM will be removed once the campaign is re-issued, estimated to be on or before 10th July 2020.

Reference	SSM66637
Models	XF / X250 XJ / X351 F-TYPE / X152 XK / X150
Title	Charging a vehicle fitted with Battery monitoring system
Category	Electrical
Last modified	26-Jun-2013 00:00:00
Symptom	203000 Basic Electrical
Content	Issue: A customer may report a concern with a flat battery or poor starting; when testing the battery it is determined that a charge is required. Cause: When charging a battery (both primary and secondary) with a BMS (battery monitoring system) fitted, the earth from the charger must be connected to a suitable chassis or engine earth (check Topix for appropriate location). This allows the BMS to see the current going into the battery. However when using a diagnostic charger from Midtronics such as GR1, GRX or GR8(110 volts) this connection process can cause an incorrect battery analysis due to the extra resistance in the wiring when connected to a chassis or engine earth. Action: When using a Midtronics GR1, GRX or GR8 you are required to remove both battery leads from the vehicle to carry out correct analysis and charge to the battery. <u>DO NOT</u> connect the diagnostic charger to any other circuit or chassis point other than the battery negative terminal as advised in the Battery Care Requirements. Battery replacement if stated on Diagnostic charger: If it is determined that a battery requires replacement, always refer to the appropriate section of the workshop manual for instructions on removing and installing the battery from the vehicle. Vehicles fitted with a Battery Monitoring System (BMS), the BMS module must be reset following the installation of a new battery. The BMS module reset procedure must be performed using an approved diagnostic system. Care points: Reset customer settings as appropriate after battery disconnection from the vehicle.

Reference	SSM74408
Models	E-PACE / X540 F-PACE / X761 F-TYPE / X152 I-PACE / X590 XE / X760 XF / X260 XJ / X351
Title	Telematics Control Unit (TCU) Fails activation at PDI
Category	Electrical
Last modified	03-May-2019 00:00:00
Symptom	207000 Entertainment Systems
Content	<u>Note: This issue affects 18/19/20MY vehicles only.</u>

Issue:

Telematics Control Module (TCU) fails activation during the Pre Delivery Inspection (PDI) or the eCall button does not illuminate after PDI.

Cause:

Currently under investigation by JLR engineering.

Action:

CAUTION: This procedure requires a minimum of Pathfinder version 229 loaded or a later.

1. Move the vehicle outside to an area of known good reception.

NOTE: The Jaguar Land Rover (JLR) approved diagnostic equipment will read the Vehicle Identification Number (VIN) for the vehicle and automatically take the vehicle out of 'Transportation mode' if required.

2. Connect the JLR approved diagnostic equipment to the vehicle and begin a new session.

3. Follow the JLR approved diagnostic equipment prompts.

4. Select 'ECU Diagnostics'.

5. Select 'Telematic control unit module' [TCU]

6. Select 'ECU Functions'

7. Select 'TCU Module Reset'.

8. Follow all on-screen instructions to complete this task.

9. Select 'Telematics server communication check'.

10. Follow all on-screen instructions to complete this task.

11. If the 'Telematics server communication check' is successful, then retry the PDI Application.

12. If the 'Telematics server communication check' is unsuccessful, select 'Update ECU' to update the TCU to the latest software version and then retry the PDI Application.

Note: This SSM is an interim action until the Telematics Guided Flow routine for Telematics Diagnosis is

updated on Pathfinder

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74570 - NLI Head unit causing battery drain issue

Models : F-Pace / X761
F-Type / X152
XE / X760
XF / X260

Engineer :Shilvock Matthew

Date Last 08 OCT 2019 12:32:07

Updated :

Content :Issue

Customer experiences, 'Low battery message' on the instrument panel, and is unable to start the vehicle. No associated DTC's flagged. Cause Incontrol touch wakes up the CAN bus intermittently. Investigation in progress.

Action


If customer faces above issues and all standard diagnostic processes have failed to resolve the issue, then

1. Recharge battery if required.
2. Isolate Audio Head Unit (AHU) from CAN by disconnecting the connector (See attached document for reference)
3. Carryout quiescent current draw test on vehicle specific fuse for AHU power:
For Discovery Sport, Range Rover Evoque, XE, XF and F-pace vehicles use Fuse 5A in the quiescent current module.
For F-type, use Fuse FA5 in the quiescent current module.
For Discovery, use Fuse 51R in the rear junction box.
After Locking vehicle and waiting for 10 minutes for it to go to sleep (warning light off).
4. Please raise Technical Assistance if measured current draw is higher than 5 milliamps.

Version : 1

Latest Vehicle Concern Fixes

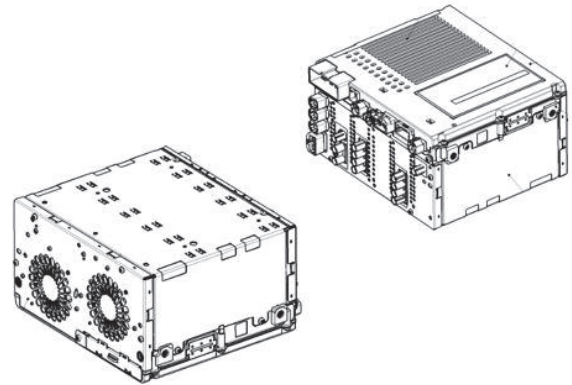


No Audio Output or Loss of Audio	19 – 20MY E-PACE, F-PACE, I-PACE, F-TYPE, XE, XF, XJ, Range Rover, RR Sport, RR Velar, RR Evoque, Discovery, Discovery Sport with InControl Touch Pro Audio System
<u>Customer Voice:</u> • Customer states there is no audio output from the speakers on all sources <u>Technical Description:</u> • IMC hardware failure <u>Status:</u> • Primarily reported on 19MY vehicles • LR – SSM 74491 has been released on July 26th 2019 • JAG – SSM 74490 has been released on July 26th 2019 • Part stock has been confirmed clean. • Permanent Corrective Action PCA to be completed by Dec 20th 2019.	



PRODUCT INVESTIGATION ELECTRICAL

UPDATE

CAPABLE
OF GREAT
THINGS
PALM SPRINGS 2020

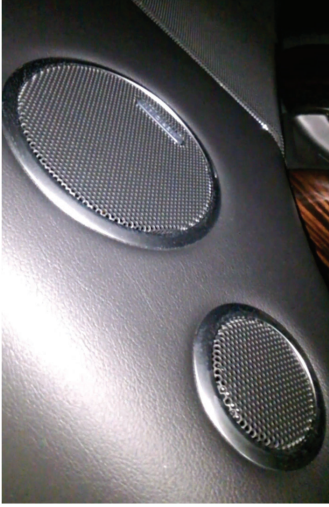Pop Noise From Audio Output	16 – 20MY E-Pace, F-Pace, I-Pace, F-Type, XE, XF, XJ, Range Rover, RR Sport, RR Velar, RR Evoque, Discovery & Discovery Sport equipped with InControl Touch Pro
<u>Customer Voice:</u> • Popping sound or crackling noise from the audio system while in use. <u>Technical Description:</u> • IMC module clipping sound due to large processing functions. <u>Status:</u> • IMC Software 19C contains additional improvements and was released on December 11, 2019 for PATHFINDER, January 9,2020 for SDD and currently available wirelessly via TOPIx. • If you should encounter a further complaint after 19C software has been installed, please submit a TA case for guidance. A customer vehicle which was unresolved following the latest software release (North Carolina, Jaguar Raleigh) has now arrived back at Mahwah for further analysis and testing of an updated fix	

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74763 - 18MY Onwards - TCU3 Remote App not working

Models : E-Pace / X540

E-Pace / X540 (China
L2C)

F-Pace / X761

F-Type / X152

I-Pace / X590

XE / X760

XE / X760 (China L2C)

XF / X260

XF / X260 (China L2C)

XJ / X351

Engineer Mann Tom

Name :

Last 20 MAR 2020 15:22:40

Modified :

Category : Electrical

Symptom : 207000 Entertainment Systems

Content : Issue:

InControl Remote App does not update vehicle location or show correct vehicle status. Remote features (e.g.: Remote Engine Start, Beep and Flash, Remote Lock/Unlock etc.) do not work.

Cause:

The Telematics Control Unit (TCU) unable to communicate with Telematics Service Provider due to curl library error.

Action:

1. Ensure Pathfinder tool is updated to the latest version.
2. Connect the JLR approved battery support unit the vehicle.
3. Connect the JLR approved diagnostic equipment to the vehicle and begin a new session.
4. Follow the JLR approved diagnostic equipment

prompts.

5. Select 'ECU Diagnostics'.
6. Select 'Telematics Control Unit Module (TCU)'
7. Select 'ECU Functions'
8. Select 'TCU Module Reset'.
9. Follow all on-screen instructions to complete the task.
10. When all of the tasks are complete, exit the session.
11. Disconnect the JLR approved diagnostic equipment and the JLR approved battery support unit.

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74787 - The `Replace ECU` Application for the OCS module fails using PATHFINDER

Models : E-Pace / X540

E-Pace / X540 (China L2C)

F-Pace / X761

F-Type / X152

XE / X760

XE / X760 (China L2C)

XF / X260

XF / X260 (China L2C)

XJ / X351

Engineer : Ruiz Vicente

Date Last 01 APR 2020 09:14:54

Updated :

Content : **ISSUE:**

When attempting to complete the "**Replace ECU**" application for the Occupant Classification System Module (OCS) the application fails. The error message '**The following error was encountered:**' is displayed to the user.

CAUSE:

PATHFINDER fails to set the OCS module into an extended session before attempting the write the VIN number.

ACTION:

This workaround will load a software file to the Jaguar Land Rover Approved Diagnostic Equipment using the Manual Patch Update process.

This Manual Patch will stay on the JLR Approved Diagnostic Equipment.

NOTE: When an update been applied to the JLR Approved Diagnostic Equipment, this Manual Patch will need to be re-applied until the permanent corrective action is delivered.

To apply the Manual Patch please, complete the instructions carefully.

1. Restart the JLR Approved Diagnostic Equipment
2. Make sure Symptom Driven Diagnostics (SDD) and PATHFINDER are closed. Then select the 'Manual Patch' Icon on the Application Launcher screen. You will see a pop-up for the Manual Patch downloader.
3. Enter '**MP_PF_R0116**' in the 'Patch Name' field.
4. Select '**Start**' and the Manual Patch will download.
5. Select '**Yes**' when the patch download is finished.
6. Select '**ECU Diagnostics**'
7. Select '**Restraints Occupant Classification System Module [OCS]**'
8. Select '**Replace ECU**'

If this Manual Patch fails to correct the concern, a Technical Assistance (TA) should be submitted using the manual patch number as a reference within the customer concern field, also quoting the communication reference number that the patch was taken from.

Note: If this Manual Patch is not being installed on all JLR Approved Diagnostic Equipment you may wish to consider labelling the machine.

PERMANENT CORRECTIVE ACTION:


Once the permanent corrective action has been released, this communication and Manual Patch will be expired. An updated bulletin will be released detailing which JLR Approved Diagnostic Equipment version includes the permanent corrective action.

Version : 1

TECHNICAL TOPICS

POWERTRAIN

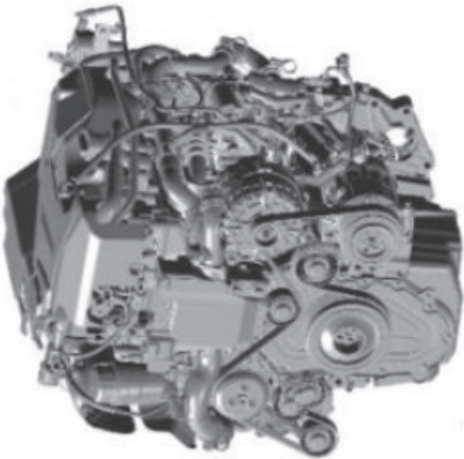

Engine Speed Stability	
<u>Customer Complaint:</u> - There was a flashing D when slowing to a stop. <u>Technical Description:</u> - Various contributing factors have been identified to improve idle quality. <u>Status:</u> - Complete primary and secondary diagnosis for any DTCs that are stored. - If no DTCs are stored, or if no other obvious root cause is identified, complete a PCM software update with Pathfinder 324 (released March 31, 2021) or later. - Updated work instructions in the TOPIX WSM section 303-14B: Electronic Engine controls – Ingenium I2 2.0L Petrol > Diagnosis and Testing will be published shortly.	19MY – Onward Discovery Sport, RR Evoque, RR Velar, Defender, RR/RR Sport PHEV, XE, XF, F PACE, F TYPE, E PACE equipped with AJ20P4 



PRINTED COPIES ARE UNCONTROLLED

JLRTB02023NAS1

TECHNICAL BULLETIN

06 MAR 2020



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION**SECTION:**

303-01

SUBJECT/CONCERN:

Malfunction Indicator Lamp (MIL) Illuminated on the Instrument Panel Cluster (IPC)

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
Discovery (LR)	2018-2019	014201-096489	Solihull	INGENIUM I4 2.0L Petrol
Discovery (LR)	2019-2020	400445-426260	Nitra (Slovakia)	INGENIUM I4 2.0L Petrol
Discovery Sport (LC)	2018-2019	690537-824661	Halewood	INGENIUM I4 2.0L Petrol
New Range Rover Evoque (LZ)	2020	000011-022242	Halewood	INGENIUM I4 2.0L Petrol

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
Range Rover Evoque (LV)	2018-2019	232184-354437	Halewood	INGENIUM I4 2.0L Petrol
Range Rover Sport (LW)	2018-2020	149358-872707	Solihull	INGENIUM I4 2.0L Petrol
Range Rover Velar (LY)	2018-2019	700246-799998	Solihull	INGENIUM I4 2.0L Petrol
Range Rover Velar (LY)	2019	200001-231027	Solihull	INGENIUM I4 2.0L Petrol
E-PACE (X540)	2018-2020	Z00581-Z74881	Graz (Austria)	INGENIUM I4 2.0L Petrol
F-TYPE (X152)	2018-2020	K45252-K65706	Castle Bromwich	INGENIUM I4 2.0L Petrol
F-PACE (X761)	2018-2019	488023-616663	Solihull	INGENIUM I4 2.0L Petrol
XE (X760)	2018-2020	P26896-P57662	Castle Bromwich	INGENIUM I4 2.0L Petrol
XF (X260)	2018-2020	Y46487-Y85151	Castle Bromwich	INGENIUM I4 2.0L Petrol

MARKETS:**NORTH AMERICA****CONDITION SUMMARY:****SITUATION:**

The Malfunction Indicator Lamp (MIL) is illuminated on the Instrument Panel Cluster (IPC) with a small loss in performance and reduction in accelerator response.

The following Diagnostic Trouble Code(s) (DTC)s may possibly be stored in the Powertrain Control Module (PCM):

- P0011-71 - 'A' Camshaft Position - Timing Over - Advanced or System Performance Bank 1 - Actuator stuck

- P000A-00 - 'A' Camshaft Position Slow Response Bank 1
- P0014-71 - 'B' Camshaft Position - Timing Over - Advanced or System Performance Bank 1 - Actuator stuck
- P000B-00 - 'B' Camshaft Position Slow Response Bank 1
- P054A-00 - Cold Start 'B' Camshaft Position Timing Over - Advanced Bank 1
- P013E-00 - O2 Sensor Delayed Response - Rich to Lean Bank 1 Sensor 2
- P0016-00 - Crankshaft Position - Camshaft Position Correlation Bank 1 Sensor A

CAUSE:

Insufficient wear resistance of the Variable Camshaft Timing (VCT) solenoid bush.

ACTION:

Follow the instructions below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
T2H48301	Jaguar - VCT solenoid - Kit	1
LR140207	Land Rover - VCT solenoid - Kit	1

TOOLS:



Jaguar Land Rover (JLR)
approved diagnostic equipment

E208514



JLR approved battery support
unit

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
JLRTB02023 - Guided Diagnostics - Application	85.99.18	0.2	42	LR126832/T4N32636

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Range Rover Sport, Range Rover Velar, Discovery, F-PACE, XF and XE - <u>VCT</u> solenoid - Engine set - Renew	18.31.51	1	42	LR126832/T4N32636
New Range Rover Evoque, Range Rover Evoque, Discovery Sport and E-PACE - <u>VCT</u> solenoid - Engine set - Renew	18.31.51	0.3	42	LR126832/T4N32636
F-TYPE - <u>VCT</u> solenoid - Engine set - Renew	18.31.51	0.2	42	T4N32636

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:**NOTE:**

Do not clear the PCM DTCs before completing this guided diagnostic routine. The following steps will test the function of the intake and exhaust camshaft VCT solenoids.

1.

CAUTION:

This procedure requires a minimum of Pathfinder 261 installed or later.

NOTES:

- The Jaguar Land Rover (JLR) approved diagnostic equipment will read the Vehicle Identification Number (VIN) for the vehicle and automatically take the vehicle out of 'Transportation Mode' if required.
- All ignition ON/OFF instructions must be followed. Failure to complete these instructions may cause damage to the vehicle control modules.

Connect the JLR approved battery support unit.

2. Connect the JLR approved diagnostic equipment to the vehicle and begin a new session.

-
3. Follow the JLR approved diagnostic equipment prompts.

- ■ Select 'Guided Diagnostics'.
- ■ Select 'Warnings - Lamps - Engine Malfunction Indicator Lamp (MIL)'.
- ■ Follow all on-screen instructions to complete the task.
 - ■ If the guided diagnostic routine **did not** identify a fault with either of the VCT solenoids, **complete steps 6 to 8 and continue to diagnose the customer concern using the applicable diagnosis and testing section within the TOPlx Workshop Manual.**
 - ■ If the guided diagnostic routine **did** identify a fault with either of the VCT solenoids, **continue to step 4.**

-
- 4.

NOTE:

In this instance, the VCT solenoids must be renewed as a pair. If a single VCT solenoid is diagnosed as failed in the future, only renew the failed component.

Renew both VCT solenoids (see TOPlx Workshop Manual section 303-14: Electronic Engine Controls - INGENIUM I4 2.0L Petrol - Remove and Installation - Variable Camshaft Timing Solenoid).

-
5. Select 'ECU Diagnostics'.

- ■ Select 'All DTCs'.
- ■ Select 'Clear all DTCs'.
- ■ Follow all on-screen instructions to complete this task.

-
6. If required, reset the vehicle to 'Transportation Mode'.

-
7. When all of the tasks are complete, exit the session.

8. Disconnect the JLR approved diagnostic equipment and the JLR approved battery support unit.

JLRTB02023NAS2

TECHNICAL BULLETIN

18 MAR 2020



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

This bulletin supersedes TSB JLRTB02023NAS1/2020 dated 06 MAR 2020, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in blue

SECTION:

303-01

SUBJECT/CONCERN:

Malfunction Indicator Lamp (MIL) Illuminated on the Instrument Panel Cluster (IPC)

AFFECTED VEHICLE RANGE:**MODEL:****MODEL
YEAR:****VIN:****ASSEMBLY
PLANT:****APPLICABILITY:**

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
Discovery Sport (LC)	2018-2019	690537-824661	Halewood	INGENIUM I4 2.0L Petrol
New Range Rover Evoque (LZ)	2020	000011-022242	Halewood	INGENIUM I4 2.0L Petrol
Range Rover Evoque (LV)	2018-2019	232184-354437	Halewood	INGENIUM I4 2.0L Petrol
Range Rover Sport (LW)	2018-2020	149358-872707	Solihull	INGENIUM I4 2.0L Petrol
Range Rover Velar (LY)	2018-2019	700246-799998	Solihull	INGENIUM I4 2.0L Petrol
Range Rover Velar (LY)	2019	200001-231027	Solihull	INGENIUM I4 2.0L Petrol
E-PACE (X540)	2018-2020	Z00581-Z74881	Graz (Austria)	INGENIUM I4 2.0L Petrol
F-TYPE (X152)	2018-2020	K45252-K65706	Castle Bromwich	INGENIUM I4 2.0L Petrol
F-PACE (X761)	2018-2019	488023-616663	Solihull	INGENIUM I4 2.0L Petrol
XE (X760)	2018-2020	P26896-P57662	Castle Bromwich	INGENIUM I4 2.0L Petrol
XF (X260)	2018-2020	Y46487-Y85151	Castle Bromwich	INGENIUM I4 2.0L Petrol

MARKETS:**NORTH AMERICA****CONDITION SUMMARY:****SITUATION:**

The Malfunction Indicator Lamp (MIL) is illuminated on the Instrument Panel Cluster (IPC) with a small loss in performance and reduction in accelerator response.

The following Diagnostic Trouble Code(s) (DTC)s may possibly be stored in the Powertrain Control Module (PCM):

- P0011-71 - 'A' Camshaft Position - Timing Over - Advanced or System Performance Bank 1 - Actuator stuck
- P000A-00 - 'A' Camshaft Position Slow Response Bank 1
- P0014-71 - 'B' Camshaft Position - Timing Over - Advanced or System Performance Bank 1 - Actuator stuck
- P000B-00 - 'B' Camshaft Position Slow Response Bank 1
- P054A-00 - Cold Start 'B' Camshaft Position Timing Over - Advanced Bank 1
- P013E-00 - O2 Sensor Delayed Response - Rich to Lean Bank 1 Sensor 2
- P0016-00 - Crankshaft Position - Camshaft Position Correlation Bank 1 Sensor A

CAUSE:

Insufficient wear resistance of the Variable Camshaft Timing (VCT) solenoid bush.

ACTION:

Follow the instructions below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
T4N32636	Jaguar - VCT solenoid - Kit	2
LR126832	Land Rover - VCT solenoid - Kit	2

TOOLS:



Jaguar Land Rover (JLR)
approved diagnostic equipment

E208514



JLR approved battery support
unit

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
JLRTB02023 - Guided Diagnostics - Application	85.99.18	0.2	42	LR126832/T4N32636

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Range Rover Sport, Range Rover Velar, Discovery, F-PACE, XF and XE - <u>VCT</u> solenoid - Engine set - Renew	18.31.51	1	42	LR126832/T4N32636
Range Rover Evoque (LZ), Range Rover Evoque (LV), Discovery Sport and E-PACE - <u>VCT</u> solenoid - Engine set - Renew	18.31.51	0.3	42	LR126832/T4N32636
F-TYPE - <u>VCT</u> solenoid - Engine set - Renew	18.31.51	0.2	42	T4N32636

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:**NOTE:**

Do not clear the PCM DTCs before completing this guided diagnostic routine. The following steps will test the function of the intake and exhaust camshaft VCT solenoids.

1.

CAUTIONS:

- This procedure requires a minimum of Pathfinder 274 installed or later.
- All ignition ON/OFF instructions must be followed. Failure to complete these instructions may cause damage to the vehicle control modules.

NOTE:

The Jaguar Land Rover (JLR) approved diagnostic equipment will read the Vehicle Identification Number (VIN) for the vehicle and automatically take the vehicle out of 'Transportation Mode' if required.

Connect the JLR approved battery support unit.

2. Connect the JLR approved diagnostic equipment to the vehicle and begin a new session.

-
3. Follow the JLR approved diagnostic equipment prompts.

- ■ Select 'Guided Diagnostics'.
- ■ Select 'Warnings - Lamps - Engine Malfunction Indicator Lamp (MIL)'.
- ■ Follow all on-screen instructions to complete the task.
 - ■ If the guided diagnostic routine **did not** identify a fault with either of the VCT solenoids, **complete steps 6 to 8 and continue to diagnose the customer concern (see TOPlx Workshop Manual section 303-14: Electronic Engine Controls - INGENIUM I4 2.0L Petrol - Diagnosis and Testing)**.
 - ■ If the guided diagnostic routine **did** identify a fault with either of the VCT solenoids, **continue to step 4**.

4.

NOTE:

In this instance, the VCT solenoids must be renewed as a pair. If a single VCT solenoid is diagnosed as failed in the future, only renew the failed component.

Renew both VCT solenoids (see TOPlx Workshop Manual section 303-14: Electronic Engine Controls - INGENIUM I4 2.0L Petrol - Remove and Installation - Variable Camshaft Timing Solenoid).

-
5. Select 'ECU Diagnostics'.

- ■ Select 'All DTCs'.
- ■ Select 'Clear all DTCs'.
- ■ Follow all on-screen instructions to complete this task.

-
6. If required, reset the vehicle to 'Transportation Mode'.
-

7. When all of the tasks are complete, exit the session.

-
8. Disconnect the JLR approved diagnostic equipment and the JLR approved battery support unit.

CAMPAIGN LAUNCH STATUS

SERVICE ACTIONS – VVT SOLENOID - AJ20P 4 CYL ENGINE



CSP SERVICE ACTION N481		CSP SERVICE ACTION H299	
AFFECTED MODELS	2018-2020 MY DISCOVERY SPORT; EVOQUE; DISCOVERY, RR VELAR; RANGE ROVER; RANGE ROVER SPORT. 4cyl AJ20P engines	AFFECTED MODELS	2018-2020MY F-TYPE; F-PACE; XE; XF; E-PACE 4cyl AJ20P engines
VEHICLE VOLUME AFFECTED	53,094 USA 5,226 CAN	VEHICLE VOLUME AFFECTED	37,827 USA 4,037 CAN
REPAIR	To prevent premature wear, a resulting MIL and a possible no start, all affected vehicles require the replacement of variable valve timing (VVT) solenoids on both intake an exhaust.	REPAIR	To prevent premature wear, a resulting MIL and a possible no start, all affected vehicles require the replacement of variable valve timing (VVT) solenoids on both intake an exhaust.
REPAIR TIME	Between 0.3 and 0.8 hrs based on model + drive in/out	REPAIR TIME	Between 0.2 and 0.6 hrs based on model + Drive in/out
CAMPAIGN LAUNCH	Phase 1 Oct 14 th 2020	CAMPAIGN LAUNCH	Phase 1 Oct 14 th 2020
Notes	Launch is staggered in VIN batches over a 3 month period Phase 1 10,700 VIN includes 90 unsold units..	Notes	Launch is staggered in VIN batches over a 3 month period Phase 1 c 14,500 VIN includes 200 unsold units.

SERVICE ACTION H299 - VARIABLE CAMSHAFT TIMING (VCT) SOLENOIDS



NAS20.11.001 | WORKSHOP
ISSUE 2

CAN/USA

AFTERSALES BULLETIN
DECEMBER 22, 2020

NOTE: this bulletin updates all previous versions. Changes are highlighted in blue.

DESCRIPTION OF ISSUE

A potential issue has been identified on Jaguar certain vehicles with the INGENIUM I4 2.0L petrol engine within the listed Affected Vehicle Range which may exhibit one or more of the following:

- Driveability flat spots;
- Malfunction Indicator Lamp (MIL) illuminated with Variable Camshaft Timing (VCT) Diagnostic Trouble Code(s) (DTC) stored in the Powertrain Control Module (PCM);
- Increased induction noise while driving; and/or
- A small reduction in performance.

AFFECTED VEHICLE RANGE

E-PACE

Model Year: 2018-2020
VIN: Z00291-Z74881

F-PACE (INGENIUM I4 2.0L Petrol)

Model Year: 2018-2020
VIN: 201651-399997; 600006-625517

F-TYPE (INGENIUM I4 2.0L Petrol)

Model Year: 2018-2020
VIN: K51500-K66534

XE (INGENIUM I4 2.0L Petrol)

Model Year: 2018-2020
VIN: P18140-P60063

XF (INGENIUM I4 2.0L Petrol)

Model Year: 2018-2020
VIN: Y53890-Y85156

Visit the British Brands Sales Suite (BBSS) website for a list of affected vehicles at your retailer.

SERVICE PROGRAM / REWORK ACTION

Retailers are to replace the VCT solenoids before vehicle handover to the customer. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

There will be no charge to owners for this action under this program.

ACTION TO BE TAKEN

Use the Jaguar Land Rover claims submission system to make sure that the vehicle is affected by this Program prior to undertaking any rework action.

Retailers are required to HOLD affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the rework action. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

Refer to Technical Bulletin H299NAS, *Service Action: Variable Camshaft Timing (VCT) Solenoids*, for detailed repair instructions.

PARTS

Use the Vehicle Identification Number (VIN) and the Electronic Parts Catalog (EPC) to confirm part number(s) necessary to perform repairs.

DESCRIPTION	PART NUMBER	QUANTITY
Variable Camshaft Timing (VCT) solenoid	T4N32636	2

TOOLS

Refer to the Technical Bulletin referenced above for any required special tools.

WARRANTY

NOTE: use the Jaguar Land Rover claims submission system to make sure that a vehicle is affected by this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, make sure that all outstanding Service Actions are identified to make sure the correct parts are available and adequate workshop time is allocated for repairs to be completed in one visit.

Warranty claims must be submitted quoting the Program Code together with the relevant Option Code. The SRO and parts information listed have been included for information only. The Option Code(s) that allows for the drive in/drive out allowance may only be claimed if the vehicle is brought into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Use TOPlx to obtain the latest repair time.

This program is valid for a limited time only. Warranty claims with a repair date prior to the October 31, 2022 closure date must be submitted for payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART NUMBER	QUANTITY
H299	A	Variable Camshaft Timing Solenoid - Engine Set - Renew	18.31.51	E-PACE: 0.3 F-PACE, XE, XF: 0.6 F-TYPE: 0.2	T4N32636	2
H299	B	Variable Camshaft Timing Solenoid - Engine Set - Renew	18.31.51	E-PACE: 0.3 F-PACE, XE, XF: 0.6 F-TYPE: 0.2	T4N32636	2
		Drive in/drive out	10.10.10	All: 0.2	-	-

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 75405 - Vehicles equipped with AJ20P4 Check Engine MIL

Models : E-Pace / X540

F-Pace / X761

F-Type / X152

XE / X760

XF / X260

Engineer Priestner Matt

Name :

Last 10 MAY 2021 15:31:58

Modified :

Category : Driveability

Symptom : 698298 Malfunction Indicator Lamp

Content : Issue: Check Engine MIL illuminated with DTC
P0096-85 (and possibly P0099-00) stored in the PCM.

Cause: This complaint is currently under investigation and we are in need of undisturbed parts for further analysis.

Action: Should you encounter a vehicle with the DTCs listed above stored in the PCM, please do not disassemble the vehicle for diagnosis. Raise a TA which will be escalated directly to Engineering who will provide further diagnostic and repair guidance.

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74605 - 2019 - 2020 MY Vehicles equipped with gasoline engine and Check Engine MIL with DTC P2402-00 stored

Models : E-Pace / X540

F-Pace / X761

F-Type / X152

XE / X760

XF / X260

Engineer Priestner Matt

Name :

Last 01 NOV 2019 13:48:08

Modified :

Category : Driveability

Symptom : 698298 Malfunction Indicator Lamp

Content : Issue:

Engine MIL on.

Cause:

DMTL system DTC P2402-00 confirmed.

Repair Action:

Inspect the DMTL circuit for damage including pin fit and pin tension at connectors. If no root cause is identified, replace the full carbon canister assembly which includes the DMTL. Raise an EPQR so parts return can be organized.

JLRTB02030NAS1

TECHNICAL BULLETIN

20 MAR 2020



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION**SECTION:**

303-00

SUBJECT/CONCERN:

Noise From Engine Compartment

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
Range Rover (LG)	2019-2020	521699-589005	Solihull	INGENIUM I4 2.0L Petrol - PHEV
Range Rover Sport (LW)	2019-2020	819281-708497	Solihull	INGENIUM I4 2.0L Petrol/INGENIUM I4 2.0L Petrol - PHEV
Range Rover Velar (LY)	2019	788026-799998	Solihull	INGENIUM I4 2.0L Petrol
Range Rover Velar (LY)	2019-2020	200001-259884	Solihull	INGENIUM I4 2.0L Petrol

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
New Range Rover Evoque (LZ)	2020	000104-075144	Halewood	INGENIUM I4 2.0L Petrol
Range Rover Evoque (LV)	2019	328512-354440	Halewood	INGENIUM I4 2.0L Petrol
Discovery (LR)	2019	083955-096489	Solihull	INGENIUM I4 2.0L Petrol
Discovery (LR)	2019-2020	403629-427691	Nitra (Slovakia)	INGENIUM I4 2.0L Petrol
Discovery Sport (LC)	2019-2020	782492-851455	Halewood	INGENIUM I4 2.0L Petrol
F-PACE (X761)	2019-2020	363151-637719	Solihull	INGENIUM I4 2.0L Petrol
E-PACE (X540)	2019-2020	Z37143-Z87881	Graz (Austria)	INGENIUM I4 2.0L Petrol
XF (X260)	2019-2020	Y75607-Y85980	Castle Bromwich	INGENIUM I4 2.0L Petrol
XE (X760)	2019-2020	P46826-P62417	Castle Bromwich	INGENIUM I4 2.0L Petrol
F-TYPE (X152)	2019-2020	K60736-K68311	Castle Bromwich	INGENIUM I4 2.0L Petrol

MARKETS:**NORTH AMERICA****CONDITION SUMMARY:****SITUATION:**

A loud noise can be heard coming from the engine compartment. Investigation has found that the engine cooling fan is constantly running at high speed and the following Diagnostic Trouble Codes (DTCs) may be stored in the Powertrain Control Module (PCM):

- P2B61-73
- P26CB-72

CAUSE:

The coolant diversion shroud inside the variable coolant pump is not moving to the correct position when requested by the PCM. The PCM then activates the engine cooling fans at high speed to avoid potential over heating. A new service part is now available.

ACTION:

Follow the instructions below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
Land Rover		
LR123392	Range Rover Plug-in Hybrid Electric Vehicle (PHEV) - Variable coolant pump	1
LR123392	Range Rover Sport (including PHEV) - Variable coolant pump	1
LR123392	Range Rover Evoque (LV) - Variable coolant pump	1
LR115260	Range Rover Evoque (LZ) (including Mild Hybrid Electric Vehicle (MHEV)) - Variable coolant pump	1
LR123392	Range Rover Velar - Variable coolant pump	1
LR123392	Discovery - Variable coolant pump	1
LR123392	Discovery Sport - 2019 model year and earlier - Variable coolant pump	1
LR115260	Discovery Sport (including MHEV) - 2020 model year and later - Variable coolant pump	1
LR100931	Drive belt - PHEV and MHEV vehicles only	1
Jaguar		
JDE40573	Variable coolant pump	1

TOOLS:



Jaguar Land Rover (JLR)
approved diagnostic equipment

E208514



JLR approved battery support
unit

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
All vehicles - Powertrain Control Module (PCM) - Update - Replace ECU	85.18.03	0.2	04	LR123906/JDE38596

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Range Rover PHEV and Range Rover Sport PHEV - Variable coolant pump - Renew	26.50.01	2.5	04	LR123906/JDE38596
Range Rover Sport and Discovery - Variable coolant pump - Renew	26.50.01	1	04	LR123906/JDE38596
Range Rover Velar and F-PACE - Variable coolant pump - Renew	26.50.01	0.9	04	LR123906/JDE38596
Range Rover Evoque (LV), Discovery Sport, XF, XE and E-PACE - Variable coolant pump - Renew	26.50.01	1.2	04	LR123906/JDE38596
Range Rover Evoque (LZ) and F-TYPE - Variable coolant pump - Renew	26.50.01	1.4	04	LR123906/JDE38596
Range Rover Evoque (LZ) MHEV - Variable coolant pump - Renew	26.50.01.32	1.5	04	LR123906/JDE38596
Discovery Sport MHEV - Variable coolant pump - Renew	26.50.01.32	1.3	04	LR123906/JDE38596

NOTE:

Normal Warranty procedures apply.

DIAGNOSTIC INSTRUCTION:

1.

CAUTION:

This procedure requires Pathfinder version 272 loaded or a later version.

NOTES:

- The JLR approved diagnostic equipment will read the correct Vehicle Identification Number (VIN) for the current vehicle and automatically take the vehicle out of 'Transportation mode' if required.
- All ignition ON/OFF instructions must be followed. Failure to complete these instructions may cause damage to the vehicle control modules.

Connect the JLR approved battery support unit.

-
2. Connect the JLR approved diagnostic equipment to the vehicle and begin a new diagnostic session.
-
3. Follow the JLR approved diagnostic equipment prompts.
-
4. Select 'ECU Diagnostics'.
-
5. Select 'All DTCs'.
 - ■ If P2B61-73 and/or P26CB-72 **are** stored in the PCM, **continue to step 6.**
 - ■ If P2B61-73 and/or P26CB-72 **are not** stored in the PCM, **this bulletin does not apply, continue to diagnose the concern using the TOPlx Workshop Manual (section 303-03B: Engine Cooling - Ingenium I4 2.0L Petrol - Diagnosis and Testing).**
-
6. Select 'ECU Diagnostics'.
 - ■ Select 'Powertrain Control Module [PCM]'.
 - ■ Select 'Update ECU'.
 - ■ Follow all on-screen instructions to complete the task.
-
7. If required, reset the vehicle to 'Transportation Mode'.
-
8. When all of the tasks are complete, exit the session.
-
9. Disconnect the JLR approved diagnostic equipment and the JLR approved battery support unit.
-
10. Renew the variable coolant pump (see TOPlx Workshop Manual section 303-03: Engine Cooling - Ingenium I4 2.0L Petrol - Removal and Installation - Coolant Pump).

SERVICE ACTION H291 - INGENIUM I4 2.0L PETROL COOLANT PUMP OPERATION



NAS20.06.003 | WORKSHOP

CAN/USA

AFTERSALES BULLETIN

JUNE 4, 2020

DESCRIPTION OF ISSUE

An issue has been identified on a limited number of Jaguar vehicles within the listed Affected Vehicle Range which may experience excessive engine cooling fan noise in the passenger compartment and eventual degradation of the engine cooling system performance.

AFFECTED VEHICLE RANGE

E-PACE (X540)

Model Year: 2019-onwards

VIN: 000001-onwards; Z36602-onwards

F-PACE (X761; Ingenium I4 2.0L Petrol)

Model Year: 2019-21

VIN: 362630-onwards

F-TYPE (X152; Ingenium I4 2.0L Petrol)

Model Year: 2019-21

VIN: K60505-onwards

XE (X760; Ingenium I4 2.0L Petrol)

Model Year: 2019-21

VIN: P46307-onwards

XF (X260; Ingenium I4 2.0L Petrol)

Model Year: 2019-21

VIN: Y75289-onwards

Visit the British Brands Sales Suite (BBSS) website for a list of affected vehicles at your retailer.

SERVICE PROGRAM / REWORK ACTION

An authorized Jaguar retailer will update the Powertrain Control Module (PCM) software to the latest level at the Pre-Delivery Inspection (PDI) or at the next service opportunity.

There will be no charge to owners for this action under this program.

OWNER NOTIFICATION

Owner notification is expected to occur on or before the week of June 29, 2020.

ACTION TO BE TAKEN

Use the Jaguar Land Rover claims submission system to make sure that the vehicle is affected by this Program prior to undertaking any rework action.

Retailers are required to HOLD affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the rework action. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

Refer to Technical Bulletin H291NAS, *Service Action: Ingenium I4 2.0L Petrol Coolant Pump Operation*, for detailed repair instructions.

PARTS

No parts required.

TOOLS

Refer to the Technical Bulletin referenced above for any required special tools.

WARRANTY

NOTE: use the Jaguar Land Rover claims submission system to make sure that a vehicle is affected by this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, make sure that all outstanding Service Actions are identified to make sure the correct parts are available and adequate workshop time is allocated for repairs to be completed in one visit.

Warranty claims must be submitted quoting the Program Code together with the relevant Option Code. The SRO and parts information listed have been included for information only. The Option Code(s) that allows for the drive in/drive out allowance may only be claimed if the vehicle is brought into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.

This program is valid for a limited time only. Warranty claims with a repair date prior to the May 31, 2022 closure date must be submitted for payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)
H291	A	Powertrain Control Module (PCM) - Update - Replace ECU	85.18.03	0.2
H291	B	Powertrain Control Module (PCM) - Update - Replace ECU	85.18.03	0.2
		Drive in/drive out	10.10.10	0.2

Normal Warranty policies and procedures apply.

June 2020

Service Action H291: Ingenium I4 2.0L Petrol Coolant Pump Operation

Jaguar Vehicles Affected: 2019-21MY E-PACE, F-PACE, F-TYPE, XE, XF

Dear Jaguar Owner,

Jaguar Land Rover Canada ULC is conducting a no-charge Customer Satisfaction Program (Program Code H291) for owners of certain Jaguar vehicles noted above fitted with the Ingenium I4 2.0L engine.

What is the issue?

A potential quality issue has been identified where, a fault with the vehicle's engine coolant pump could lead to excessive engine cooling fan noise in the passenger compartment and, eventually, a reduction in the performance of the cooling system.

What will Jaguar and your Jaguar Retailer do?

An authorized Jaguar retailer will update the Powertrain Control Module (PCM) software to the latest level at the next service opportunity.

There will be no charge for this repair.

What should you do?

Contact your preferred authorized Jaguar retailer, provide them with your Vehicle Identification Number (VIN), and request a service date to complete the work required under Program Code **'H291'**.

During this visit, please take the opportunity to discuss any aspect of your vehicle's operation or performance with the Retailer team who will be pleased to assist you with any questions you may have regarding your vehicle in order for you to get the most out of its advanced features.

How long will it take?

The work will be carried out as quickly and efficiently as possible in order to minimize inconvenience to customers and is expected to take approximately 30 minutes, although your retailer may need your vehicle for a longer time. Your retailer can provide you with a better estimate of the overall time for the service visit.

Attention Leasing Agencies: please forward this notification to the lessee within 10 days.

Moved or no longer own this Jaguar vehicle?

If you are no longer the owner of this vehicle, Jaguar would greatly appreciate the name and address of the new owner, using the Information Change Form enclosed.

What should you do if you have further questions?

If you have any questions regarding this program or need assistance in locating the nearest authorized Jaguar retailer, please contact the Jaguar Canada Customer Relationship Center at 1-800-668-6257.

You may also contact us by email using the following address: jagcweb@jaguarlandrover.com. If you have the need to contact Jaguar by mail, please use the following address:

Jaguar Land Rover Canada ULC
75 Courtneypark Drive West, Unit 3
Mississauga, ON L5W 0E3

Thank you again for selecting Jaguar; your ownership experience is very important to us. We recognize this service visit may be an inconvenience to you. Jaguar, in cooperation with your authorized Jaguar retailer, will strive to minimize any inconvenience to you caused by this program.

Yours Sincerely,

A handwritten signature in black ink, appearing to read 'R Whisson', is positioned above the printed name and title.

Robert Whisson
Director, Customer Service
Jaguar Land Rover Canada ULC

June 2020

Service Action H291: Ingenium I4 2.0L Petrol Coolant Pump Operation

Jaguar Vehicles Affected: 2019-21MY E-PACE, F-PACE, F-TYPE, XE, XF

Dear Jaguar Owner,

Jaguar Land Rover North America, LLC is conducting a no-charge Customer Satisfaction Program (Program Code H291) for owners of certain Jaguar vehicles noted above fitted with the Ingenium I4 2.0L engine.

What is the issue?

A potential quality issue has been identified where, a fault with the vehicle's engine coolant pump could lead to excessive engine cooling fan noise in the passenger compartment and, eventually, a reduction in the performance of the cooling system.

What will Jaguar and your Jaguar Retailer do?

An authorized Jaguar retailer will, update the Powertrain Control Module (PCM) software to the latest level at the next service opportunity

There will be no charge for this repair.

What should you do?

Contact your preferred authorized Jaguar retailer, provide them with your Vehicle Identification Number (VIN), and request a service date to complete the work required under Program Code **'H291'**.

During this visit, please take the opportunity to discuss any aspect of your vehicle's operation or performance with the Retailer team who will be pleased to assist you with any questions you may have regarding your vehicle in order for you to get the most out of its advanced features.

How long will it take?

The work will be carried out as quickly and efficiently as possible in order to minimize inconvenience to customers and is expected to take approximately 30 minutes, although your retailer may need your vehicle for a longer time. Your retailer can provide you with a better estimate of the overall time for the service visit.

Attention Leasing Agencies: please forward this notification to the lessee within 10 days.

Moved or no longer own this Jaguar vehicle?

If you are no longer the owner of this vehicle, Jaguar would greatly appreciate the name and address of the new owner, using the Information Change Form enclosed.

What should you do if you have further questions?

Should you have any questions regarding this Program or need assistance in locating the nearest authorized Jaguar retailer, please contact the Jaguar Customer Relationship Center at 1-800-4JAGUAR (1-800-452-4827).

You may also contact us by email using the following address: jagweb1@jaguarlandrover.com. If you have the need to contact Jaguar by mail, please use the following address:

Jaguar Land Rover North America, LLC
ATTN: Customer Relationship Center

100 Jaguar Land Rover Way
Mahwah, NJ 07495

Thank you again for selecting Jaguar; your ownership experience is very important to us. We recognize this service visit may be an inconvenience to you. Jaguar, in cooperation with your authorized Jaguar retailer, will strive to minimize any inconvenience to you caused by this program.

Sincerely,

A handwritten signature in black ink, appearing to read 'Rory Beattie', with a stylized flourish at the end.

Rory Beattie
Vice President Customer Service
Jaguar Land Rover North America, LLC