



RETAILER BULLETIN

DATE: 14-FEBRUARY-2025			BULLETIN NO: NAS25.02.003				DEPT: Legal					
AUDIENCE:	DEALER PRINCIPAL	X	SALES MGR	X	SALES GUIDES	X	SERVICE MGR	X	TECHS	X	PARTS STAFF	X
	GENERAL MANAGER	X	BUSINESS MGR	X	OFFICE MGR	X	SERVICE ADVISORS	X	PARTS MGR	X	WARRANTY	X
SUBJECT: George vs. JLRNA: Revised Settlement with AC edits												

NGI Infotainment Class Action Settlement

TO: All USA Jaguar Land Rover Authorized Retailers
RE: IMPORTANT INFORMATION

Further to Aftersales Bulletin NAS24.06.001 published in June 2024, Jaguar Land Rover has reached a settlement in a class action, George et al. v. Jaguar Land Rover North America, LLC, involving certain vehicles with InControl®TouchPro Infotainment System or InControl® TouchPro Duo System. Impacted vehicle owners (Class Members) were notified of the settlement.

The Class vehicles are the following vehicles with InControl®TouchPro Infotainment System or InControl® TouchPro Duo System that are registered in the 50 United States and District of Columbia.

- 2016–2020 Range Rover Evoque
- 2017–2020 Range Rover
- 2017–2020 Range Rover Sport
- 2018–2020 Range Rover Velar
- 2017–2020 Discovery
- 2017–2020 Discovery Sport
- 2016–2019 Jaguar XJ
- 2016–2020 Jaguar XF
- 2017–2020 Jaguar F-Pace
- 2017–2020 Jaguar XE
- 2018–2020 Jaguar E-Pace
- 2018–2020 Jaguar F-Type
- 2019–2020 Jaguar I-Pace

The settlement includes:

- One (1) year warranty extension from February 3rd, 2025 to February 3rd, 2026 for the Infotainment Master Controller (IMC). Please refer to Bulletins N769 (Land Rover) and H428 (Jaguar) posted on TOPIx February 3rd, 2025.

- Online Resource to provide class members with step-by-step process for updating Infotainment to the latest software.
- Retailer training on how to diagnose Infotainment issues and update software.
- Field Service Actions (FSA) launched February 6, 2025, to make all Class vehicles SOTA capable. Please refer to TOPIx Field Service Actions N735 (Land Rover) and H419 (Jaguar) for further details.

For vehicles not requiring a software update in these Field Service Actions, Class members should be able to update the Infotainment to the latest software via SOTA by using the Online Resource. Please direct any inquiries about updating the Class vehicles to the latest software to the Online Resource page located at

www.georgevlrnainfotainmentsettlement.com.

Should you or your team receive any inquiries on the settlement, please direct those individuals to visit www.georgevlrnainfotainmentsettlement.com or call 1-833-310-6532 for more information.

Reference	SSM74025
Models	Range Rover / L405 Range Rover Sport / L494
Title	AJ126 V6 engine - Coolant leak from thermostat housing
Category	Engine
Last modified	22-Oct-2018 00:00:00
Symptom	402000 Cooling System Concerns

Content**Issue:**

The customer reports a coolant leak from the engine compartment which is found to originate from the thermostat housing seam.

Cause:

Multiple process improvements have been implemented at the supplier to mitigate the likelihood of this complaint.

Action:

It is possible the thermostat may suffer consequential damage during a severe overheat event. Investigate and repair any other possible causes of an overheat condition that may exist on the vehicle.

Should the VIN reported fall beyond the assured VINs listed below, please raise an EPQR and include pictures of the leak.

Assured VINs:

Range Rover: SALGS2FE8HA320883

Range Rover Sport: SALWR2FE0HA124721

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.

TECHNICAL TOPICS

POWERTRAIN



AJ20-P4 engine- Coolant leak from Thermostat

18- 22MY: E-PACE/F-TYPE
17-22MY: F-PACE/XE/ XF

Customer Voice:

- Thermostat coolant leak - Evident fluid leak from the engine compartment and the "Coolant Level Low" warning message may be on the cluster


Technical Description:

- MIL might be associated with P0128 DTC
- Evidence of a leak from thermostat.
- No evident fresh leak but only dried up coolant deposit is seen on the body of the thermostat

Status:

- Check the coolant pipes on top of / around the thermostats for any leak / damage pipes which has possibility of leaking coolant to the thermostat body.
- New Pinpoint test has been added to TOPIx

Refer to TOPIx section 303-03a pinpoint test F

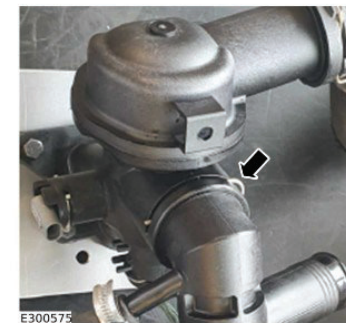

JTB00545NAS1

TECHNICAL BULLETIN

09 APR 2019



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION:

418-00

SUBJECT/CONCERN:

Central Locking/Unlocking Inoperative After Connecting Vehicle Startup Battery

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
XF (X250)	2013-2015	S55282-U85571	Castle Bromwich

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

The Central locking/unlocking feature may not operate after disconnecting and connecting the vehicle startup battery.

CAUSE:

This may be caused by a Central Junction Box (CJB) internal component failure.

ACTION:

Should a Customer express this concern, follow the procedure(s) below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
C2Z32178	Central Junction Box (CJB)	1
C2Z32179	Auxiliary Junction Box (AJB)	1

TOOLS:



Jaguar Land Rover-approved battery power supply



Jaguar Land Rover-approved diagnostic equipment with latest SDD Software Management Pack

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.

- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Central Junction Box (CJB) - Renew	86.70.97	0.4	42	C2Z26983
Auxiliary Junction Box (AJB) - Renew	86.71.05	0.4	42	C2Z26983
Configure new module - Central Junction Box (CJB) and Auxiliary Junction Box (AJB)	05.10.20	0.2	42	C2Z26983

NOTE:

Normal Warranty procedures apply.

WORKSHOP PROCEDURE:

- 1 Renew the Central Junction Box (CJB) (see TOPIx Workshop Manual section 418:00: Module Communications Network - Central Junction Box [CJB]).
- 2 Renew the Auxiliary Junction Box (AJB) (see TOPIx Workshop Manual section 418:00: Module Communications Network - Auxiliary Junction Box [AJB]).

DIAGNOSTIC PROCEDURE:

CAUTIONS:

- A Jaguar Land Rover-approved battery power supply must be connected to the vehicle startup battery.
- All ignition ON/OFF requests MUST be performed; failure to do these steps may cause damage to vehicle control modules.

- 1 Connect the Jaguar Land Rover-approved battery power supply to the vehicle startup battery.

2

 NOTE:

The Jaguar Land Rover-approved diagnostic equipment must be loaded with SDD156.02 Software Management Pack v313 (or later).

Connect the Jaguar Land Rover-approved diagnostic equipment to the vehicle and begin a new session.

3

Follow all on-screen instructions.

 NOTE:

The Jaguar Land Rover-approved diagnostic tool will present an error message stating 'The intended software for update is at an earlier level, make sure the latest Diagnostic Tool release has been loaded before continuing'. Select the red 'X' to skip the software download and continue.

4

If the hyperlink is not available:

- 1 Select **Service Functions** from the Session Type screen.
- 2 Select **Run** from '**Recommendations**' to perform the '**Auxiliary junction box (body control module B)**' option.

5

If the hyperlink is not available:

- 1 Select **Service Functions** from the Session Type screen.
- 2 Select **Run** from '**Recommendations**' to perform the '**Central junction box (body control module)**' option.

6

Follow all on-screen instructions until the application completes successfully.

- 1 When prompted, select the **Clear DTCs** option following completion of the software download.
- 2 Follow the on-screen instructions until the application finishes successfully.

7

Exit the current session.

- 1 Select the **Session** tab.
- 2 Select the **Close Session** option.

- 8 Disconnect the diagnostic equipment and battery power supply from the vehicle.

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 75559 - AJ20-P4 engine – Coolant leak from Thermostat

Models : E-Pace / X540

F-Pace / X761

F-Type / X152

XE / X760

XF / X260

Engineer Shilvock Matthew

Name :

Last 20 OCT 2021 16:46:11

Modified :

Category : Driveline

Symptom : 510000 Fluid Concerns

Content : Issue: JLR is investigating AJ20-P4 thermostats with complaints for coolant leaks (on any vehicle) that are coming into service with evident leak or with low coolant MIL warning [sometimes associated with P0128 DTC]

Causes: JLR investigation in progress

Action: If you see this issue present on a vehicle, and if you suspect the coolant leak is from the thermostat

A. Gross leak from thermostat

1. Screenshot of the latest DTCs / warning light
2. Share video evidence of fresh leak
3. Check if the housing is sitting properly – refer image (A) attached. If there are signs of incorrect assembly, replace the thermostat with a new
4. If no issue found in step (3), document evidence of location and reason for gross leak and replace the part with a new one

B. Evident fresh leak [not gross] from thermostat.

1. Screenshot of the latest DTCs / warning light
2. Share video evidence of fresh leak

3. Clean the fresh leak thoroughly and also ensure the grooves do not hold any residual coolant
4. Test drive the car for about 30 minutes and check for leak again
5. If there is a leak, provide video evidence of the leak and proceed with replacing the part with a new one.
6. If there is no leak, perform the standard cooling system pressure test and show evidence that leak is observed in thermostat
7. If the pressure test does not confirm leak on the thermostat, do not change the thermostat. Check rest of the coolant circuit for leak

C. No evident fresh leak but only dried up coolant deposit is seen on the body of the thermostat [Image B]

1. Screenshot of the latest DTCs / warning light
2. Confirm if there was any external coolant spill [either at dealer end or customer end]
3. Check the coolant pipes on top of / around the thermostats for any leak / damage [pipes which has possibility of leaking coolant to the thermostat body]
4. Clean the thermostat surface and the suspect leak location thoroughly [without removing thermostat from the engine]
5. Make sure the grooves do not contain any residual coolant.
6. Test drive the car for about 30 minutes and inspect the thermostat again for any fresh leak
7. If there is no leak, perform the standard cooling system pressure test and show evidence that leak is observed in thermostat
8. If the pressure test does not confirm leak on the thermostat, do not change the thermostat. Check rest of the coolant circuit for leak

NOTES:

- If the car comes in for repeat failure, perform the same checks as above. But replace the part with a new one and prepare the removed part for return to Engineer.
- Thermostats as a whole is a serviceable part. So, do not manipulate the thermostats in anyway.
- If P0128 DTC Is present, first perform actions as per TOPIX against the DTC prior to performing the actions in SSM.

Thank you for your assistance with this matter.

File : [AJ20-P4 engine – Coolant leak from Thermostat.pdf](#)

Jaguar Land Rover Limited 2000 - 2021 (Rel. 2693)

JTB00566NAS4

TECHNICAL BULLETIN

23 MAY 2018



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

303-03: Engine Cooling

SUBJECT/CONCERN:

Coolant Leak From The Engine Compartment

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
F-TYPE (X152)	2014 Onwards	K00001 Onwards	Castle Bromwich	V6 S/C 3.0L Petrol /V8 S/C 5.0L Petrol

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:	APPLICABILITY:
XF (X250)	2012-2015	S52534-U88785	Castle Bromwich	V6 S/C 3.0L Petrol /V8 S/C 5.0L Petrol
XJ Range (X351)	2012 Onwards	V39060 Onwards	Castle Bromwich	V6 S/C 3.0L Petrol /V8 S/C 5.0L Petrol

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

An 'engine overheat' message may be displayed on the Instrument Cluster and that coolant may be leaking from engine compartment area.

CAUSE:

This may be caused by weakness in the plastic weld process of the coolant pipes.

ACTION:

Should a Customer express this concern, follow the Workshop Procedure below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
AJ813917	Coolant outlet pipe - Upper	1
AJ813865	Coolant outlet pipe - Lower	1
C2Z17249	Gasket - Supercharger-to-cylinder head - V6 3.0L S/C Petrol	2
C2Z17248	Gasket - Intake manifold - V6 3.0L S/C Petrol	1
C2Z28265	Throttle body gasket	1
AJ811576	Gasket - Right bank - Supercharger-to-cylinder head - V8 5.0L S/C Petrol	1
AJ811590	Gasket - Left bank - Supercharger-to-cylinder head - V8 5.0L S/C Petrol	1

PART NUMBER	DESCRIPTION	QUANTITY
AJ811948	Gasket - Intake manifold - V8 5.0L S/C Petrol	1
JLM209722	Engine coolant	1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY: **NOTES:**

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to JLR claims submission system to obtain the latest repair time.
- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Coolant outlet pipe - Upper & lower - Renew - F-TYPE (X152; V6 3.0L S/C Petrol)	26.31.97	3.5	D4	C2Z28536
Coolant outlet pipe - Upper & lower - Renew - F-TYPE (X152; V8 5.0L S/C Petrol)	26.31.97	3.6	D4	C2Z28536
Coolant outlet pipe - Upper & lower - Renew - XF (X250; V6 3.0L S/C Petrol)	26.31.97	4.2	D4	C2Z28536
Coolant outlet pipe - Upper & lower - Renew - XF (X250; V8 5.0L S/C Petrol)	26.31.97	4.3	D4	C2Z28536
Coolant outlet pipe - Upper & lower - Renew - XJ (X351; V6 3.0L S/C Petrol / V8 5.0L S/C Petrol)	26.31.97	4.2	D4	C2Z28536

 NOTE:

Normal Warranty procedures apply.

WORKSHOP PROCEDURE:**ⓘ CAUTIONS:**

- When refilling the cooling system, make sure to use the Jaguar Land Rover approved specification of engine coolant at a 50% mix ratio with water and check the specific gravity of the engine coolant (see TOPlx Workshop Manual section 303-03: Engine Cooling - Specification - V8 S/C 5.0L Petrol).
- Use only Jaguar Land Rover-approved engine coolant.

⚠ NOTE:


V8 5.0L S/C Petrol shown, V6 3.0L S/C Petrol similar.

1 Remove the charge air cooler (see TOPlx Workshop Manual section 303-12: Intake Air Distribution and Filtering - Charge Air Cooler).

2 Remove the air cleaner outlet pipe T-connector (see TOPlx Workshop Manual section 303-12: Intake Air Distribution and Filtering - Air Cleaner Outlet Pipe T-Connector).


3 ⓘ CAUTION:

Be prepared to collect escaping engine coolant.

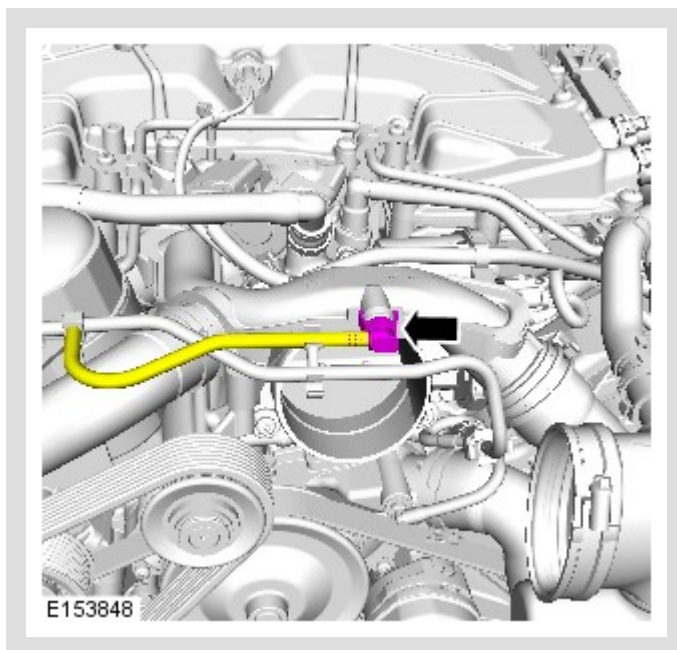

Disconnect and reposition the hose.

4

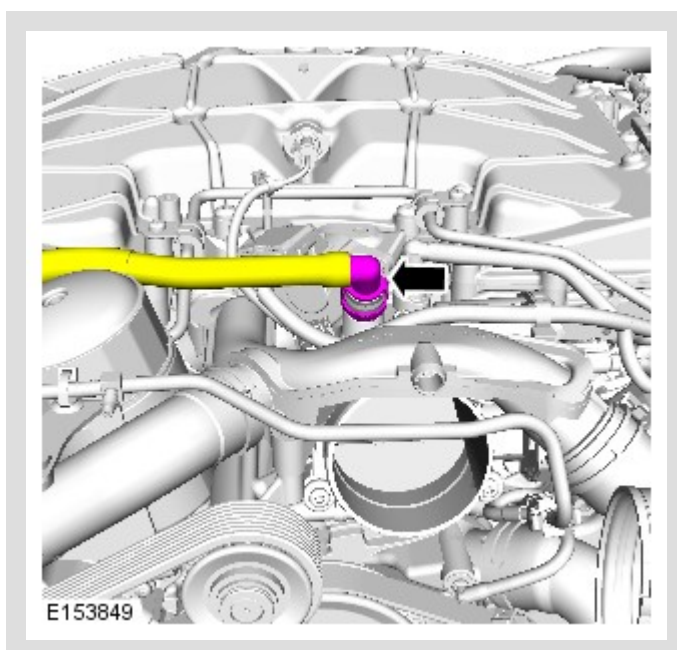


Disconnect and reposition the hose.

5

ⓘ CAUTION:

Be prepared to collect escaping engine coolant.

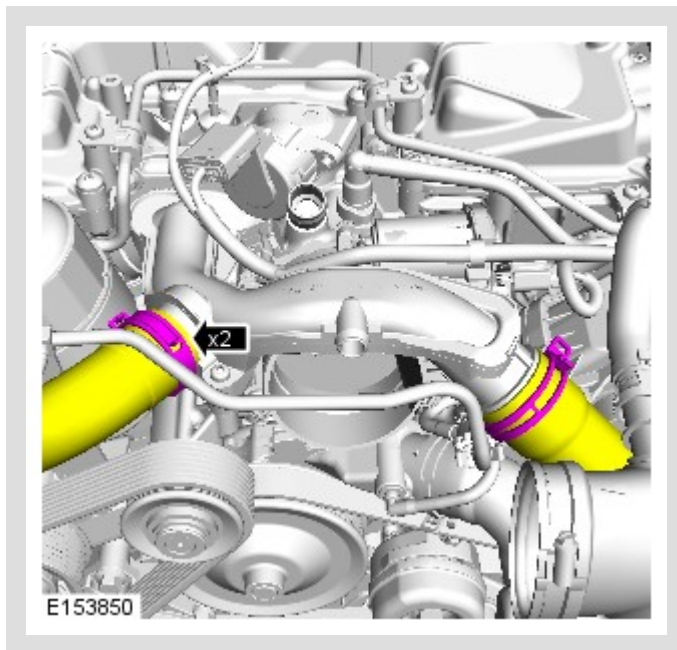

Disconnect and reposition the hoses.


6

ⓘ CAUTION:

Be prepared to collect escaping engine coolant.

⚠ NOTE:

Retain the fasteners.

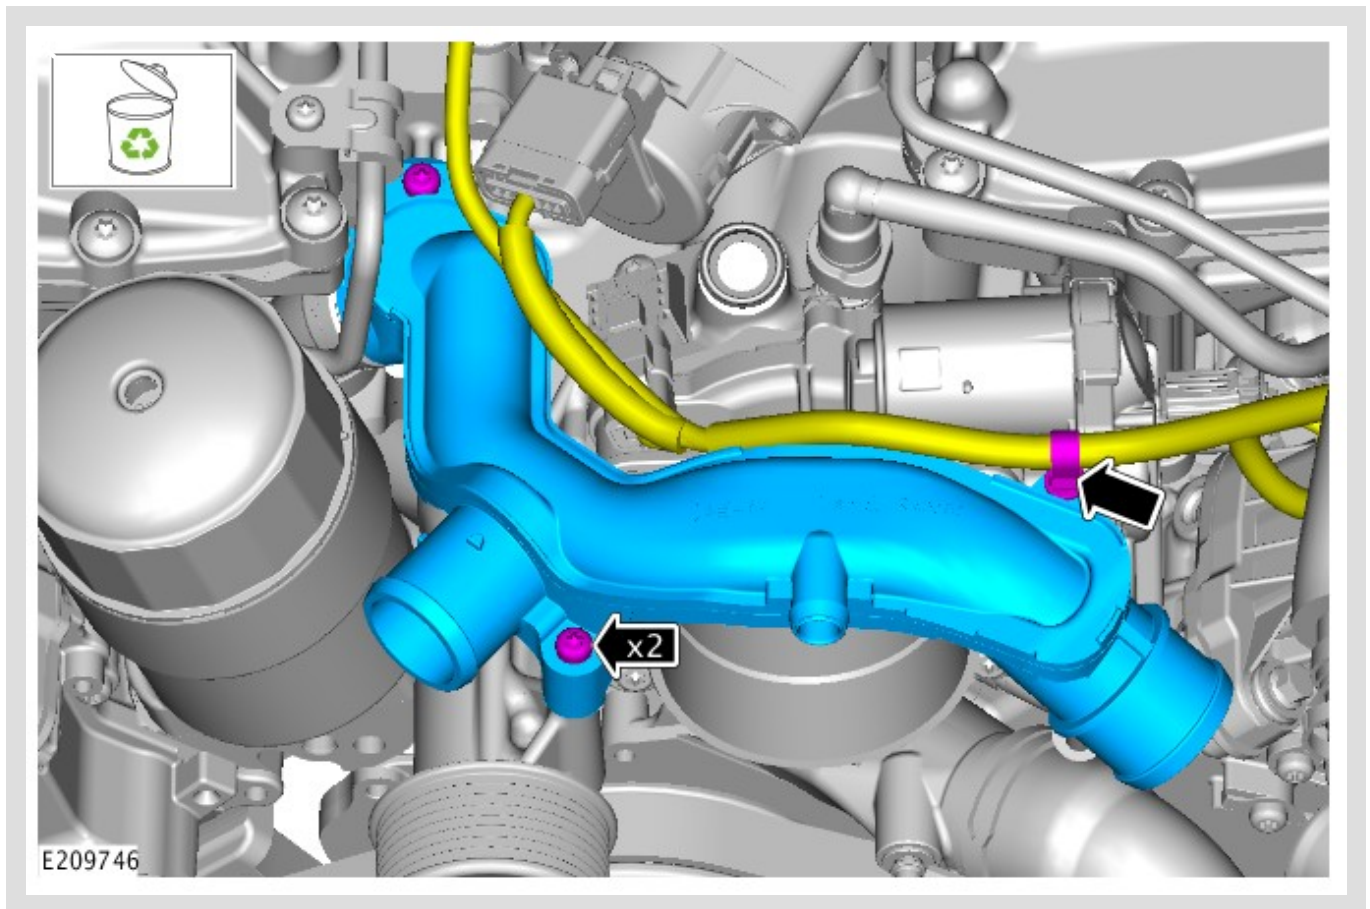

Remove and discard the upper coolant outlet pipe.


- 7 Remove supercharger (see TOPIx Workshop Manual section 303-12: Intake Air Distribution and Filtering - Removal and Installation - Supercharger [Steps 1-11]).

8 **CAUTIONS:**

- Be prepared to collect escaping engine coolant.
- Make sure no part of the lower coolant return pipe remains in both cylinder block recesses as these plastic pipes can sometimes break up on removal.

NOTE:

Retain the fasteners.

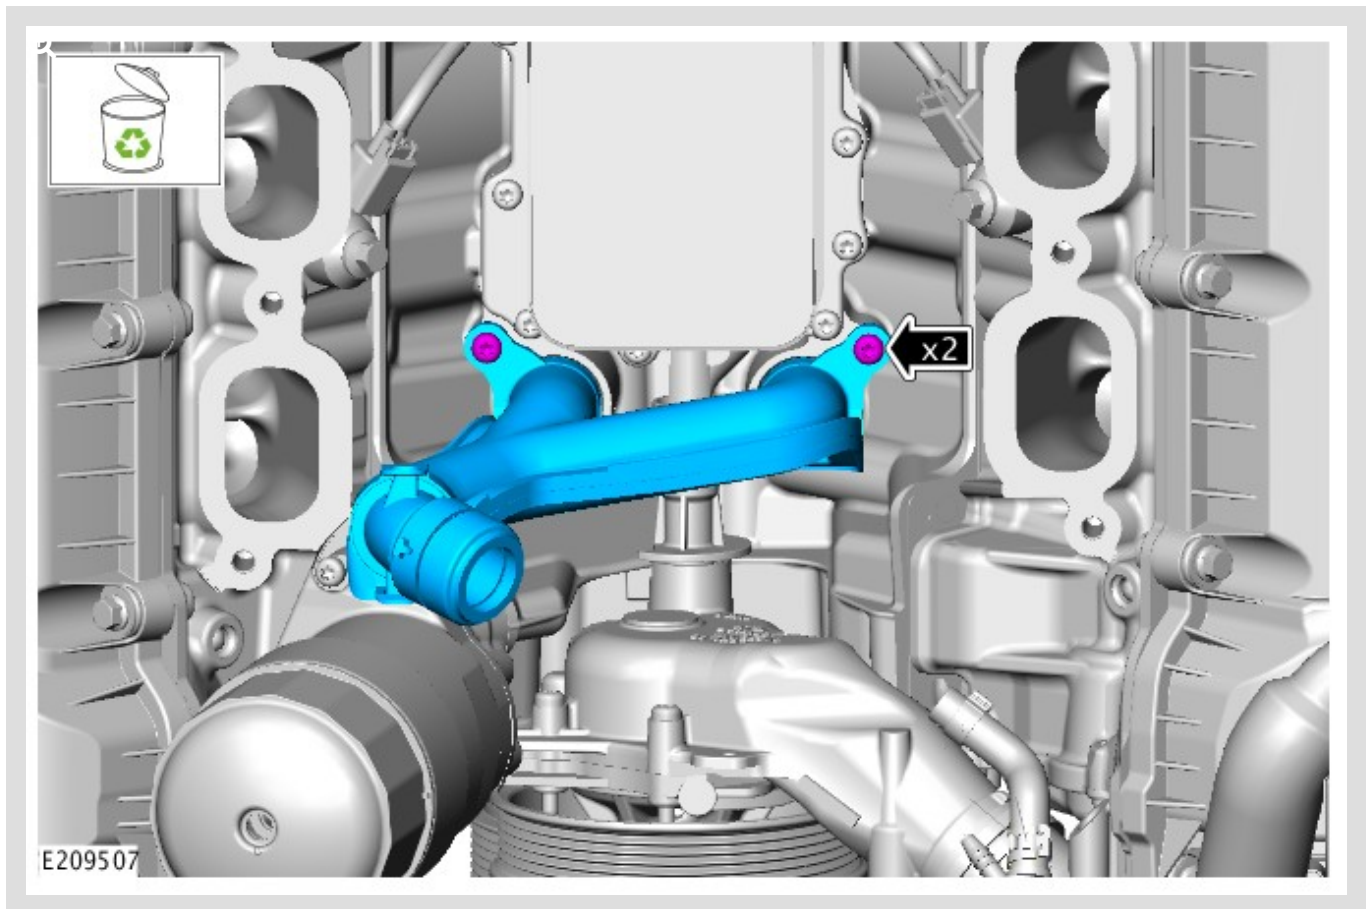


Remove and discard the lower coolant outlet pipe.

9

⚠ CAUTION:

Make sure the O-rings are correctly installed when installing the new coolant pipe into the cylinder block.

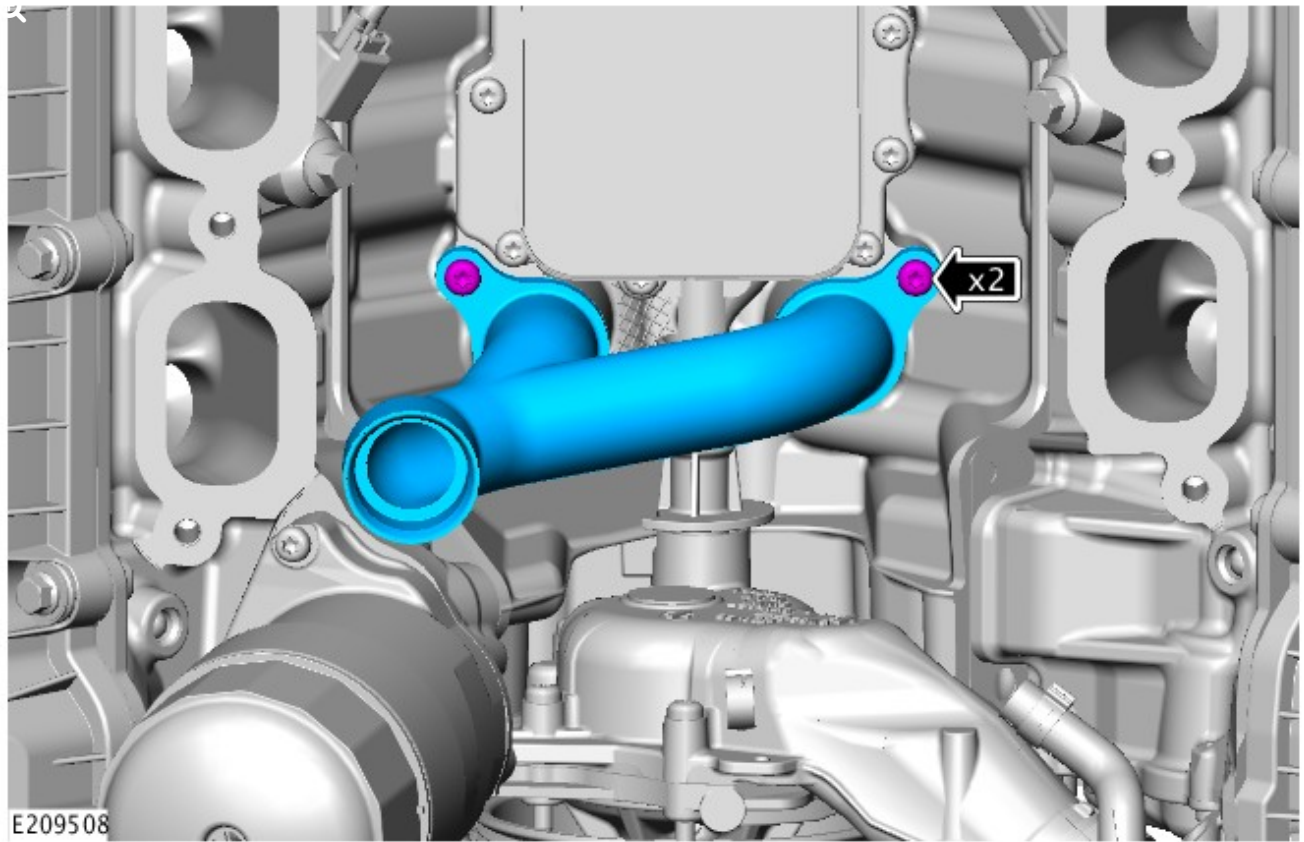

Install the new lower coolant outlet pipe.

- Torque: **12 Nm.**

10 Install supercharger (see TOPlx Workshop Manual section 303-12: Intake Air Distribution and Filtering - Removal and Installation - Supercharger [Steps 5-18]).


11

ⓘ CAUTION:

Make sure the O-rings are correctly installed when installing the new coolant pipe.


△ NOTE:

The new coolant pipe has no intermediate pipe between the upper and lower sections.

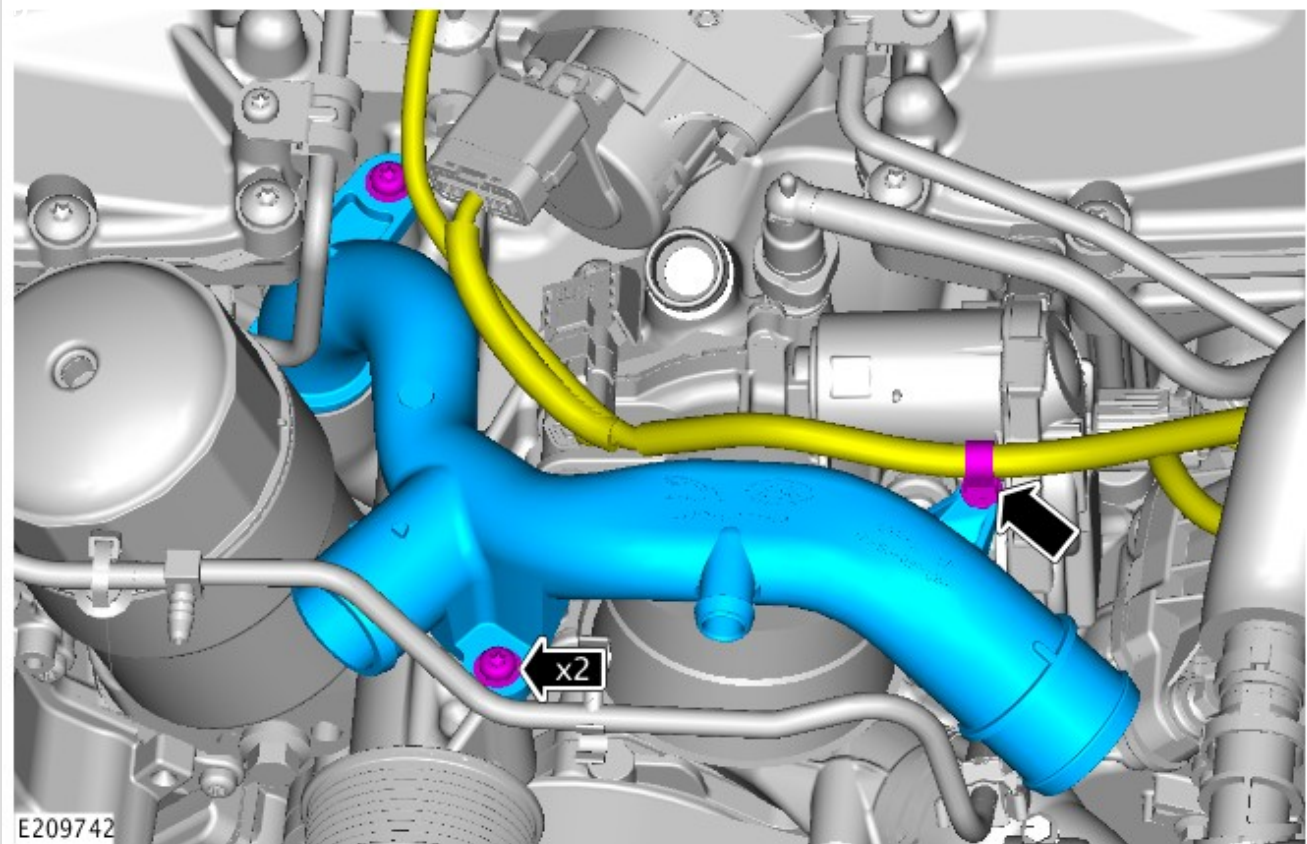


Install the new upper coolant outlet pipe.

- Clip the wiring harness to the pipe.
- Torque: **10 Nm**.

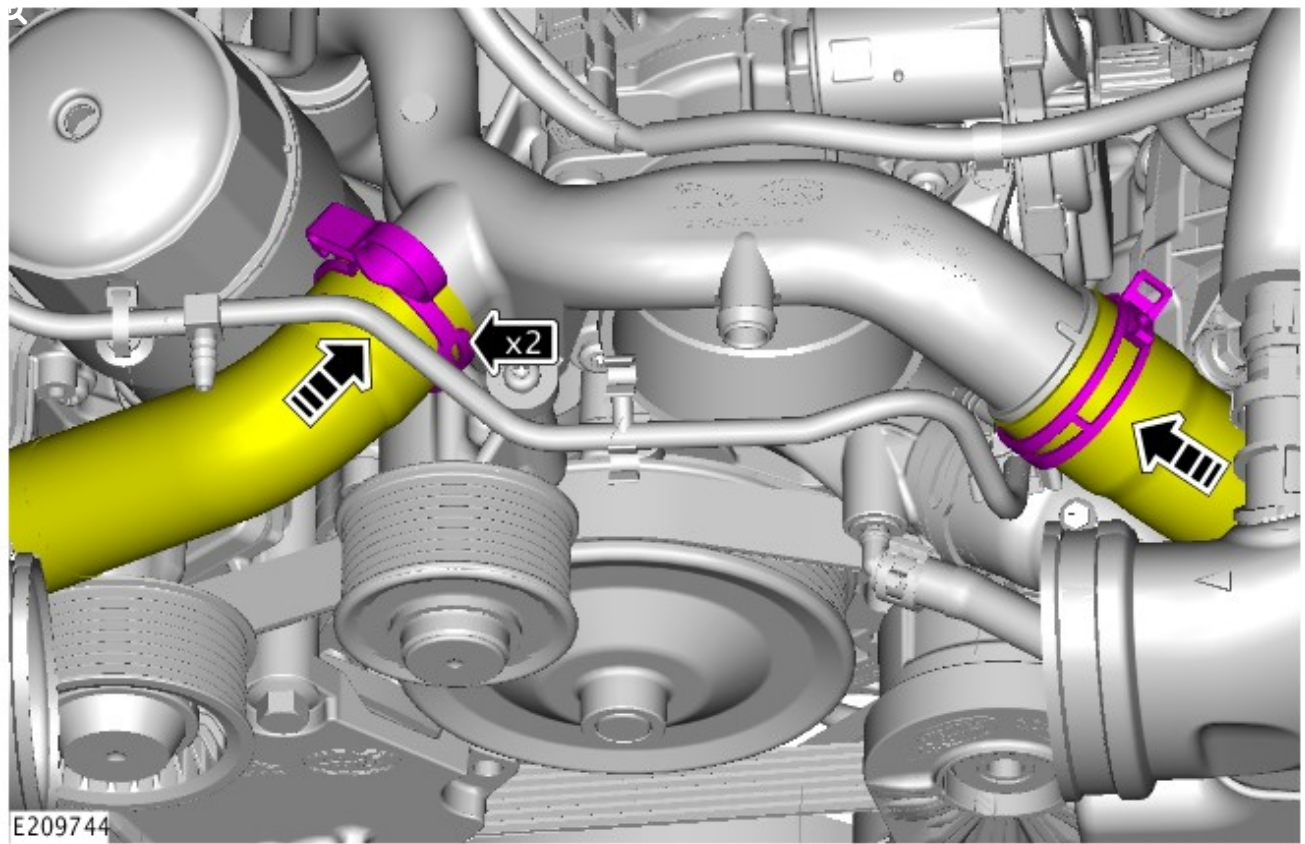


Install the 2 coolant hoses.

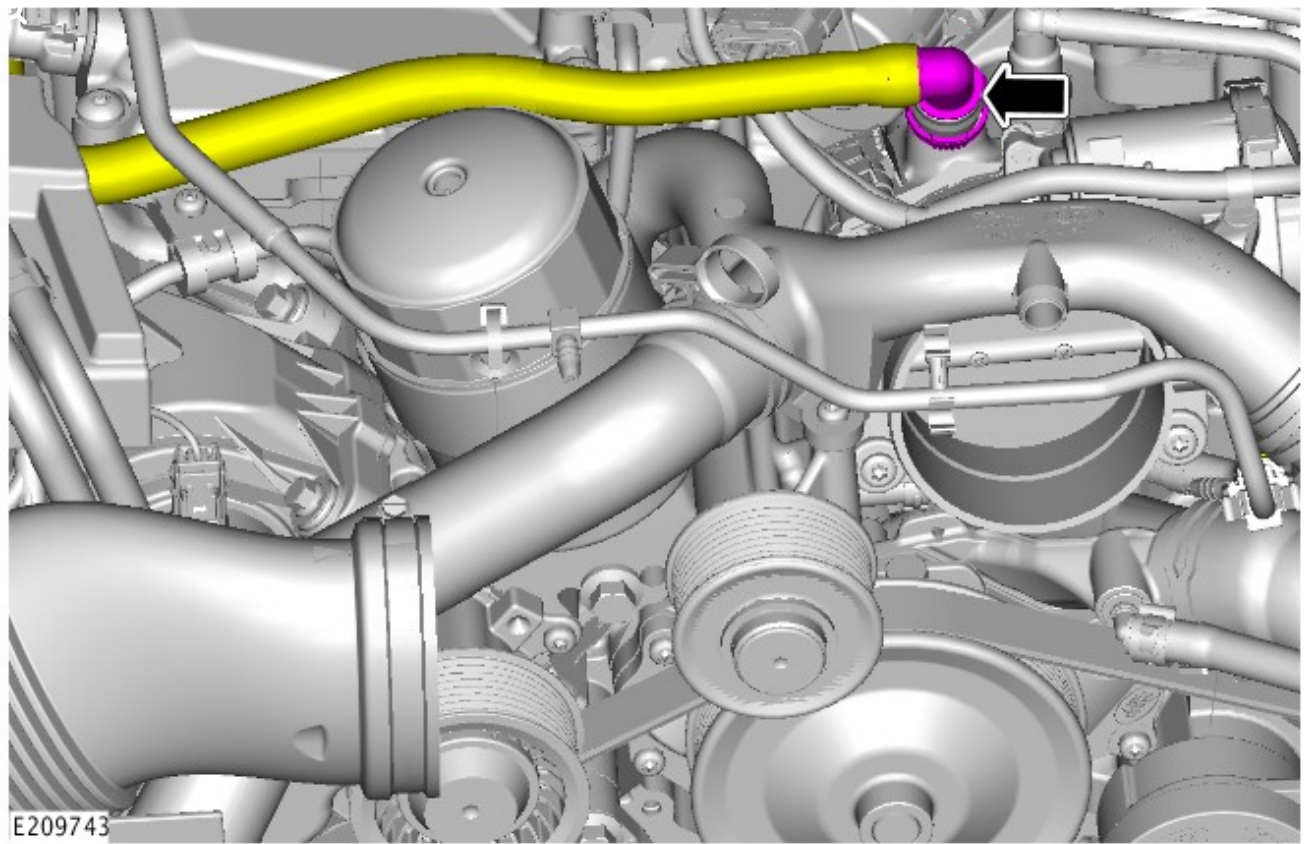

Install the hose.

14

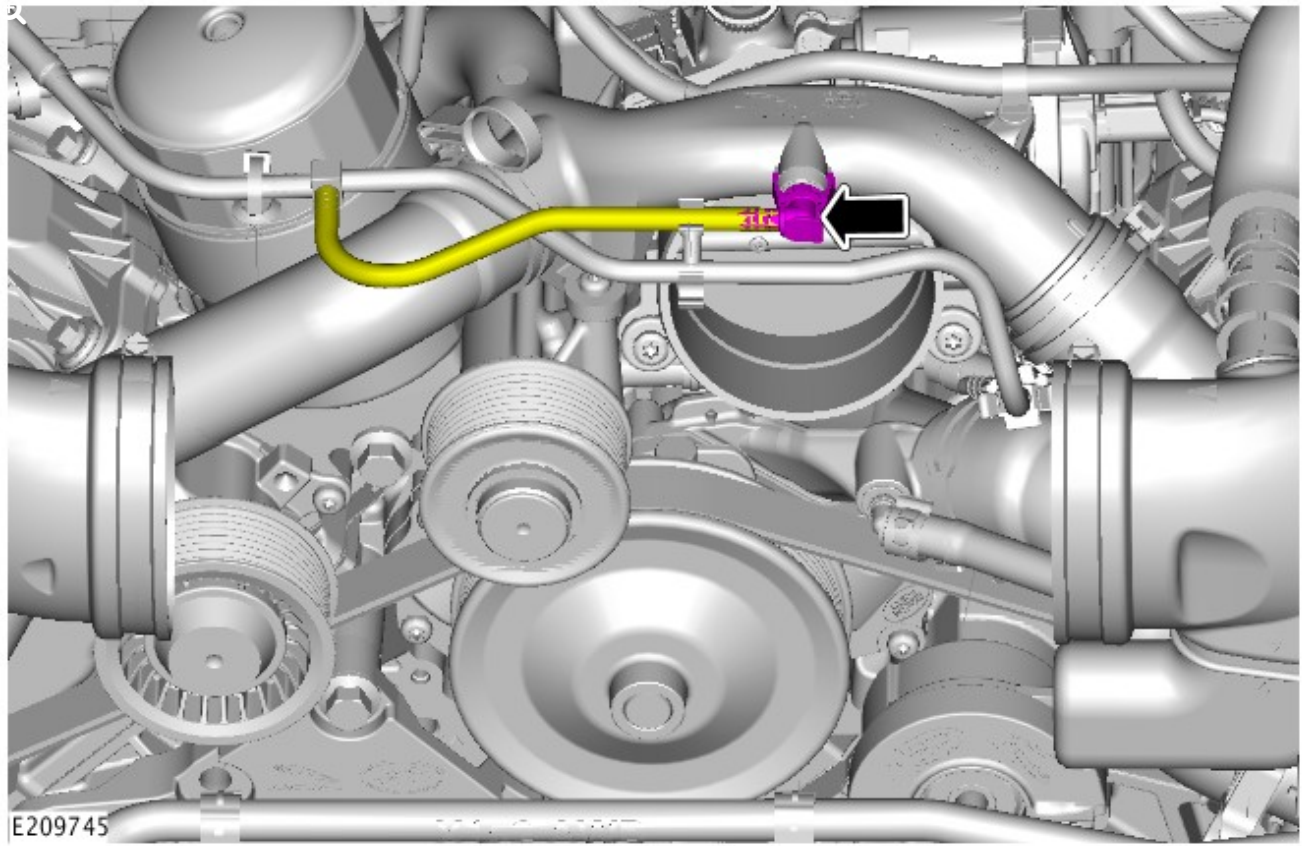

Install the hose

-
- 15 Install the air cleaner outlet pipe T-connector (see TOPIx Workshop Manual section 303-12: Intake Air Distribution and Filtering - Air Cleaner Outlet Pipe T-Connector).
-
- 16 Install the charge air cooler (see TOPIx Workshop Manual section 303-12: Intake Air Distribution And Filtering - Charge Air Cooler).

TECHNICAL BULLETIN
JTB00278NAS3
19 MAY 2015



© Jaguar Land Rover North America, LLC
NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in gray

SECTION: 303-03

Coolant Pump Diagnostics

AFFECTED VEHICLE RANGE:

F-TYPE (X152)

Model Year: 2014-2015
VIN: E8K00001-FMK20402

XF (X250)

Model Year: 2010-2015
VIN: ANR47154-F8U56155

Engine: V6 S/C 3.0L Petrol
V8 5.0L Petrol
V8 S/C 5.0L Petrol

XJ Range (X351)

Model Year: 2010-2015
VIN: AMV00047-F8V81366

XK Range (X150)

Model Year: 2010-2015
VIN: ALB32753-FMB56794

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The fluid level in the engine coolant system expansion tank may fall below the minimum level over a period of time or a 'Low coolant level' message is displayed in the message center. Upon inspection, a leak may be found to be from the front of the engine-driven coolant pump, together with excessive wear of the coolant pump bearing.



NOTE: the coolant pump can display some dry coolant residue on the pump body and surrounding area during normal operation. A small amount of coolant may temporarily weep through the pump seals or from the evaporation chamber. This does not affect the operation of the pump or the cooling system and does not damage the coolant pump. A small amount of dry coolant residue on the pump body, pulleys, belts, or around the front of the engine is not alone sufficient justification for changing a coolant pump.

Cause: This may be caused by coolant ingress into the coolant pump bearing housing, leading to corrosion of the bearing and incorrect support for the impeller shaft, leading to accelerated wear of the mechanical flat face of the seal and a coolant loss sufficient to display the warning message.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

No Parts Required

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.



NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Coolant pump bearing diagnostics - F-TYPE	26.50.08	0.3	42	C2Z29189
Coolant pump bearing diagnostics - XF - 3.0L SC V6, 5.0L NA V8, 5.0L SC V8	26.50.08	0.3	42	C2Z29189
Coolant pump bearing diagnostics - XJ	26.50.08	0.3	42	C2Z29189
Coolant pump bearing diagnostics - XK - 5.0L NA V8	26.50.08	0.5	42	C2Z29189
Coolant pump bearing diagnostics - XK - 5.0L SC V8	26.50.08	0.4	42	C2Z29189
Coolant Pressure Test - All	26.10.07	0.2	42	C2Z29189



NOTE: Normal Warranty procedures apply.

SERVICE INSTRUCTION:

Updates to the Service Instruction have **not** been highlighted.



NOTE: check the parts catalog to make sure the repair is made at the correct level. Coolant pump, cooling system gaskets, and seals are available through the parts catalog. These parts should be used whenever possible rather than fitting complete assemblies.



NOTE: in all cases, reference this Technical Bulletin in the technician comments on the Warranty claim and on the Parts return tag (if applicable). Parts may be subject to investigation.

- Check the coolant expansion tank level and message centre for a low coolant warning and record on the repair order. With the engine cold, top up the coolant as required to the maximum level in the coolant expansion tank, record the quantity of coolant required to top up the expansion tank to maximum level on the repair order.
- The current step will specify what to do next depending on where the vehicle identification number (VIN) of the current vehicle falls within the following bearing seal introduction VINs list below.
 - If the vehicle was manufactured before the bearing seal introduction VIN in the table below, a new pump should only be installed if the pump shows clear signs of leakage, and Steps 4-6 have been carried out. Install the coolant pump (see TOPIx Workshop Manual section 303-03). Do not continue with the rest of this service instruction.
 - If the vehicle was manufactured after the bearing seal introduction VIN in the table below, then go to the next step of this service instruction.

3.0L SC V6

MODEL CODE	MODEL NAME (engine)	BEARING SEAL INTRODUCTION VIN
X250	XF (V6)	S50940
X351	XJ (V6)	V34129
X152	F-TYPE (V6)	K00003

5.0L NA / SC V8

MODEL CODE	MODEL NAME (engine)	BEARING SEAL INTRODUCTION VIN
X150	XK (V8)	B46771
X250	XF (V8)	S40669
X351	XJ (V8)	V31764
X152	F-TYPE (V8)	K00004

3. On the current coolant pump there may be some signs of leakage, such as dry coolant residue, but this is not a reason to replace the coolant pump. It is necessary to check the coolant pump for an abnormal noise from the bearings, free play in the pulley, or a grinding/rumbling feel when rotating the pulley by hand see Steps 7-9.

4. If there is low coolant in the expansion tank and or a low coolant message from the message centre, continue with the next step of this Service Instruction to identify the source of the leak. If a leak is located this must be claimed as a separate Warranty Claim.

5.  **NOTE: a 1-1.5 PSI pressure drop is normal and does not indicate a system leak. An air leak may also be present in the pressure test equipment.**

Carry out a cooling system pressure test to 1 bar (15 PSI) for 5 minutes. Record the pressure drop on the repair order.

6. If there is a cooling system pressure drop of more than 1.5 PSI, then investigate the system for fresh (wet) leaks and record on the repair order. A UV light may be helpful as there is UV dye in the coolant. If there is fresh coolant dripping from the pump - this indicates a leak.

Coolant Pump Bearing Check Procedure:

7. Slacken the primary drive belt tensioner and move the primary drive belt to one side.

8. Hold the coolant pump pulley firmly and rock it up and down by hand.

- Feel for excessive play.
- Rotate the pulley a ¼ turn and repeat the check. Do this check twice more.
- Record the results on the repair order.

9. Spin the pulley and feel for roughness and record the results on the repair order. Check for free play on the coolant pump pulley shaft and record the results on the repair order.

10. The coolant pump should only be replaced where there are signs of free-play, excessive noise, or grinding/rumbling in the bearing (see TOPIx Workshop Manual section 303-03). Make sure that any repair is completed at the lowest possible component level - for example replacing gaskets and seals where appropriate rather than higher level assemblies.

LEAKING COOLANT PUMPS – 2.0L/P4

Customer Voice:

- Low coolant light on or visible signs of engine coolant on or around the coolant pump.

Technical Description:

- The engine cooling pump is misting from the front seal onto the coolant pump pulley.

Status:

- Please inspect and take a photo of outer casting under a UV light, showing the whole component with the area of leak.
- If you have found a leak, raise an EPQR with the pictures and reference P373483 to the attention of Local Engineering. They will dispatch sample bottle.
- To correctly gather a sample:
 - Run engine for 10 minutes at idle once thermostat has opened.
 - Turn engine off for 30 minutes, use a clean syringe to collect the engine coolant sample from the engine coolant expansion tank.
- USE SAMPLE BOTTLE ONLY to take 4 ounce Coolant sample before repair.
- Retain removed water pump for collection via PRR.

Range Rover



- 20-24MY RR Evoque
- 18-24MY RR Velar

Discovery

- 21-24MY Discovery Sport

Jaguar

- 19-24MY E-PACE
- 18-24MY F-PACE
- 19-24MY F-TYPE
- 19-24MY XF
- 19-20MY XE

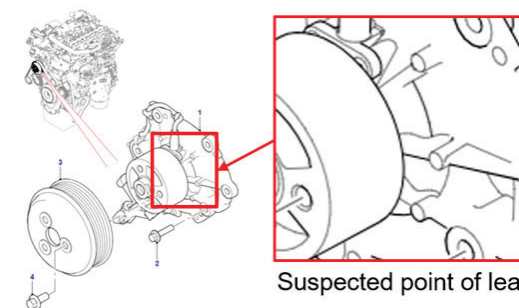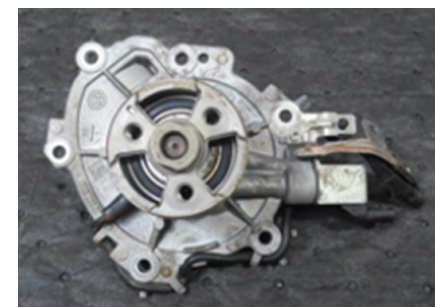

SSM 76161 / 76164



LEAKING COOLANT PUMPS – 2.0L/P4

Customer Voice:

- Low coolant light on or smell of coolant from engine area.

Technical Description:

- The engine cooling pump has a visible coolant leak.

Status:

- Follow **TOPIX workflow**. It will direct you to:
 - Please inspect and take a photo of outer casting showing the whole component, with leak.
- Please raise a **FRED** for the attention of Local Engineering who will dispatch sample bottle.
- USE SAMPLE BOTTLE ONLY to take 4 ounce Coolant sample before repair.
- Dispatch coolant sample using FEDEX label provided.
- Retain removed water pump for collection via PRR.
- **This item will now be on the FRED list November 18th.**

TOPIX: 303-03B: Engine Cooling - INGENIUM I4 2.0L Petrol

Range Rover



- 20-24MY RR Evoque
- 18-24MY RR Velar

Discovery

- 21-24MY Discovery Sport

Jaguar

- 19-24MY E-PACE
- 18-24MY F-PACE
- 20-24MY F-TYPE
- 19-24MY XF
- 19-21MY XE

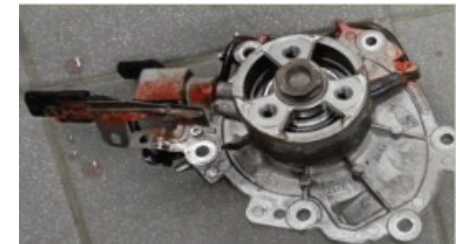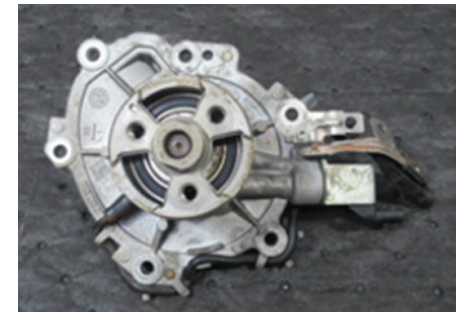

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 75559 - AJ20-P4 engine – Coolant leak from Thermostat

Models : E-Pace / X540

F-Pace / X761

F-Type / X152

XE / X760

XF / X260

Engineer Shilvock Matthew

Name :

Last 20 OCT 2021 16:46:11

Modified :

Category : Driveline

Symptom : 510000 Fluid Concerns

Content : Issue: JLR is investigating AJ20-P4 thermostats with complaints for coolant leaks (on any vehicle) that are coming into service with evident leak or with low coolant MIL warning [sometimes associated with P0128 DTC]

Causes: JLR investigation in progress

Action: If you see this issue present on a vehicle, and if you suspect the coolant leak is from the thermostat

A. Gross leak from thermostat

1. Screenshot of the latest DTCs / warning light
2. Share video evidence of fresh leak
3. Check if the housing is sitting properly – refer image (A) attached. If there are signs of incorrect assembly, replace the thermostat with a new
4. If no issue found in step (3), document evidence of location and reason for gross leak and replace the part with a new one

B. Evident fresh leak [not gross] from thermostat.

1. Screenshot of the latest DTCs / warning light
2. Share video evidence of fresh leak

3. Clean the fresh leak thoroughly and also ensure the grooves do not hold any residual coolant
4. Test drive the car for about 30 minutes and check for leak again
5. If there is a leak, provide video evidence of the leak and proceed with replacing the part with a new one.
6. If there is no leak, perform the standard cooling system pressure test and show evidence that leak is observed in thermostat
7. If the pressure test does not confirm leak on the thermostat, do not change the thermostat. Check rest of the coolant circuit for leak

C. No evident fresh leak but only dried up coolant deposit is seen on the body of the thermostat [Image B]

1. Screenshot of the latest DTCs / warning light
2. Confirm if there was any external coolant spill [either at dealer end or customer end]
3. Check the coolant pipes on top of / around the thermostats for any leak / damage [pipes which has possibility of leaking coolant to the thermostat body]
4. Clean the thermostat surface and the suspect leak location thoroughly [without removing thermostat from the engine]
5. Make sure the grooves do not contain any residual coolant.
6. Test drive the car for about 30 minutes and inspect the thermostat again for any fresh leak
7. If there is no leak, perform the standard cooling system pressure test and show evidence that leak is observed in thermostat
8. If the pressure test does not confirm leak on the thermostat, do not change the thermostat. Check rest of the coolant circuit for leak

NOTES:

- If the car comes in for repeat failure, perform the same checks as above. But replace the part with a new one and prepare the removed part for return to Engineer.
- Thermostats as a whole is a serviceable part. So, do not manipulate the thermostats in anyway.
- If P0128 DTC Is present, first perform actions as per TOPIX against the DTC prior to performing the actions in SSM.

Thank you for your assistance with this matter.

File : [AJ20-P4 engine – Coolant leak from Thermostat.pdf](#)

Jaguar Land Rover Limited 2000 - 2021 (Rel. 2693)