

CUSTOMER #: 10012996

824373



JAGUAR LAND ROVER LOS ANGELES

NYREE HINTON
616 MASSELIN AVE APT 210
Los Angeles, CA 90036

INVOICE
DUPLICATE 1
PAGE 1

400 S. La Brea Avenue
Los Angeles CA 90036
(310) 274-5133
www.jlrta.com

HOME: CONT: 732-979-6264
BUS: CELL: 732-979-6264

B.A.R. REG.# ARD303078 EPA# CAL000470554
SERVICE ADVISOR: 3391 Danny Sanchez

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	20	JAGUAR F-TYPE	SAJDD1GX4LCK67497		23278/23282	T4591	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
30SEP24 DD			14:00 08OCT24		299.00	CASH	14OCT24
R.O. OPENED		READY		OPTIONS: ENG:2.0_Liter_Supercharged			
14:31 07OCT24		15:45 14OCT24					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES THAT THE DRIVERS SIDE DOOR ELECTRONICS DO NOT OPERATE
CHECK AND ADVISE

86 ELECTRICAL

3238 KESROUANI, ROY LIC#: 3238

WJ

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

23279 LEFT ENGINE JUNCTION BOX TO REAR JUNCTION BOX CIRCUIT SHORT
CIRCUIT TO GROUND ATTEMPTED TO CONNECT WITH VEHICLE. NO CONNECTION WAS
POSSIBLE. GAINED ACCESS TO ENGINE JUNCTION BOX LEFT AND FOUND FUSE FL01
IN GOOD CONDITION. GAINED ACCESS TO REAR JUNCTION BOX AND FOUND FUSE RF
08 BLOWN. OBTAINED RVC NUMBER: TW55OR3S AND REPLACED FUSE RF 08 IN REAR
JUNCTION BOX. TOPIX CONNECTION TO VEHICLE IS NOW ESTABLISHED AND DRIVER
DOOR BUTTONS FOR WINDOW OPERATIONS AND DOOR LOCK FEATURES ARE NOW
WORKING NORMALLY. DROVE 2 MILES, FUSE RF08 BLEW AGAIN AND DRIVER DOOR
ELECTRONICS STOPPED WORKING. REMOVED DRIVER DOOR TRIM PANEL. REMOVED
DRIVER FOOT WELL LOWER TRIM PANEL. REMOVED REAR LEFT LUGGAGE
COMPARTMENT TRIM PANEL. (START OF DIAG TIME) USING ELECTRICAL WIRING
DIAGRAMS CHECKED CIRCUIT FROM DRIVER DOOR MODULE TO REAR JUNCTION BOX
CONNECTOR TO FROM CAPW02BD-14 TO CABR02D-1 FOUND 0.2 OHMS. CHECKED
CIRCUIT FROM DIAGNOSTIC CONNECTOR TO LEFT ENGINE JUNCTION BOX FROM
C2DB04B-16 TO C1BB01A-16 FOUND 0.2 OHMS. CHECKED CIRCUIT FORM LEFT
ENGINE JUNCTION BOX TO REAR JUNCTION BOX FROM C1BB01A-15 TO C4BR02D-1
FOUND 1.8 OHMS TO 3 OHMS VARIABLE READING. DETERMINED HIGH RESISTANCE.
CHECKED HARNESS AND FOUND CIRCUIT FROM CONNECTOR C13H-13 TO LEFT ENGINE
JUNCTION BOX AT C1BB01A-15 SHORTED TO GROUND WHERE DRIVER RESTS HIS/HER
LEFT FOOT UNDERNEATH THE CARPET. OBTAINED RVC NUMBER: TAKITXQX.
PERFORMED HARNESS REPAIR FROM C13H-13 TO C1BB01A-15. REFITTED DRIVER
DOOR TRIM PANEL;. REFITTED LEFT SIDE LUGGAGE COMPARTMENT TRIM PANEL.
REFITTED DRIVER FOOT WELL LOWER PANEL. CLEARED ALL CODES. DIVER DOOR
ELECTRONICS ARE NOW WORKING CORRECTLY.

B CLIENT STATES LOW BATTERY WARNING LIGHT COMES ON THE CLUSTER CHECK
AND ADVISE

86 ELECTRICAL

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By	Date & Time	Authorization Obtained By	*HAZARDOUS WASTE DISPOSAL COSTS: We have added this charge to cover costs associated with the handling, management and disposal of toxic wastes or hazardous substances under California and Federal Law.	DESCRIPTION	TOTALS
\$	\$			☐ In Person Approval ☐ Telephone ☐ Text ☐ Email/Fax (See Attached)		LABOR AMOUNT	
Revised Estimate	\$			☐ In Person Approval ☐ Telephone ☐ Text ☐ Email/Fax (See Attached)		PARTS AMOUNT	
☐ Tire pressure check/inflation service was performed. RF _____ psi LF _____ psi RR _____ psi LR _____ psi ☐ Customer declined tire pressure check/inflation service. Initials _____						GAS, OIL, LUBE	
						SUBLET AMOUNT	
						WASTE DISPOSAL COSTS *	
						TOTAL CHARGES	
						LESS INSURANCE	
						SALES TAX	
						PLEASE PAY THIS AMOUNT	
DATE		CUSTOMER SIGNATURE		AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE			

By signing below, you acknowledge that you were notified of and authorized the
Dealership to perform the services/repairs itemized in this invoice and that you received
(or had the opportunity to inspect) any replaced parts as requested by you.

ALL PARTS ARE NEW
UNLESS OTHERWISE
INDICATED.
☐ Some Parts Not Returnable

The vehicle is being returned to you in exchange for your payment of the Amount Due.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT
INFORMATION ON BACK.

CUSTOMER #: 10012996

824373



JAGUAR LAND ROVER LOS ANGELES

NYREE HINTON
616 MASSELIN AVE APT 210
Los Angeles, CA 90036*INVOICE*
DUPLICATE 1
PAGE 2400 S. La Brea Avenue
Los Angeles CA 90036
(310) 274-5133
www.jlra.comHOME: CONT: 732-979-6264
BUS: CELL: 732-979-6264

B.A.R. REG.# ARD303078 EPA# CAL000470554

SERVICE ADVISOR: 3391 Danny Sanchez

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	20	JAGUAR F-TYPE	SAJDD1GX4LCK67497		23278/23282	T4591	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
30SEP24 DD			14:00 08OCT24		299.00	CASH	14OCT24

R.O. OPENED READY OPTIONS: ENG:2.0_Liter_Supercharged

14:31 07OCT24 15:45 14OCT24

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

3238 KESROUANI, ROY LIC#: 3238

WJ

(N/C)

1 T2H33020 BATTERY

(N/C)

1 BAT California Battery Fee

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

23279 START UP BATTERY FAILURE. CHECKED CODES AND PRINTED FOUND
CODE U3003-16 STORED IN GSM. USING TOPIX CLOUD, STARTED NEW FAULT
WORKFLOW AND FOUND BCM AND GWM SOFTWARE UP TO DATE. PERFORMED IN
VEHICLE BATTERY TEST. RECHARGED BATTERY AND PERFORMED ANOTHER IN
VEHICLE BATTERY TEST. BATTERY FAILED. PERFORMED OUT OF VEHICLE BATTERY
TEST. BATTERY FAILED. OBTAINED RVC NUMBER; RC9F5PLX AND REPLACED START
UP BATTERY. REST BATTERY MONITORING SYSTEM. "LOW BATTERY: MESSAGE IS NO
LONGER DISPLAYED IN INSTRUMENT CLUSTER.

C CUSTOMER STATES RESET ALL TIRE PRESSURES

TP CUSTOMER STATES RESET ALL TIRE PRESSURES

3238 KESROUANI, ROY LIC#: 3238

ISPJ

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

23278 TIRE PSI VALUES. LEFT 37PSI FRONT RIGHT 37PSI REAR LEFT 37PSI
REAR RIGHT 37PSI

D COMPLIMENTARY JAGUAR MULTI-POINT INSPECTION

99PJ COMPLIMENTARY JAGUAR MULTI-POINT INSPECTION

3238 KESROUANI, ROY LIC#: 3238

ISPJ

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D: 0.00

23278 MPI MPI AVAILABLE IN MYMKARMA

E** CLIENT REQUEST EST ON A NEW SIMS CARD.

01 VEHICLE INSPECTION

3238 KESROUANI, ROY LIC#: 3238

ISPJ

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE E: 0.00

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By	Date & Time	Authorization Obtained By
\$	\$			☐ In Person Approval ☐ Telephone ☐ Text ☐ Email/Fax (See Attached)
Revised Estimate	\$			☐ In Person Approval ☐ Telephone ☐ Text ☐ Email/Fax (See Attached)

☐ Tire pressure check/inflation service was performed.
RF _____ psi LF _____ psi RR _____ psi LR _____ psi
☐ Customer declined tire pressure check/inflation service. Initials _____

*HAZARDOUS WASTE DISPOSAL
COSTS: We have added this
charge to cover costs associated
with the handling, management
and disposal of toxic wastes or
hazardous substances under
California and Federal Law.

ALL PARTS ARE NEW
UNLESS OTHERWISE
INDICATED.
☐ Some Parts Not Returnable

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
WASTE DISPOSAL COSTS *	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

By signing below, you acknowledge that you were notified of and authorized the
Dealership to perform the services/repairs itemized in this invoice and that you received
(or had the opportunity to inspect) any replaced parts as requested by you.

DATE

CUSTOMER SIGNATURE

AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

The vehicle is being returned to you in exchange for your payment of the Amount Due.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT
INFORMATION ON BACK.

CUSTOMER #: 10012996

824373



JAGUAR LAND ROVER LOS ANGELES

NYREE HINTON
616 MASSELIN AVE APT 210
Los Angeles, CA 90036

INVOICE

DUPLICATE 1
PAGE 3400 S. La Brea Avenue
Los Angeles CA 90036
(310) 274-5133
www.jlria.comHOME: CONT:732-979-6264
BUS: CELL:732-979-6264

B.A.R. REG.# ARD303078 EPA# CAL000470554


SERVICE ADVISOR: 3391 Danny Sanchez

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	20	JAGUAR F-TYPE	SAJDD1GX4LCK67497		23278/23282	T4591	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
30SEP24 DD			14:00 08OCT24		299.00	CASH	14OCT24
R.O. OPENED		READY	OPTIONS: ENG:2.0_Liter_Supercharged				
14:31 07OCT24		15:45 14OCT24					

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

23279 ESTIMATE PROVIDED ESTIMATE ON A NEW SIM CARD. PART IS
CURRENTLY OUT OF STOCK.

DRIVER SIDE DOOR CONTROL INOP

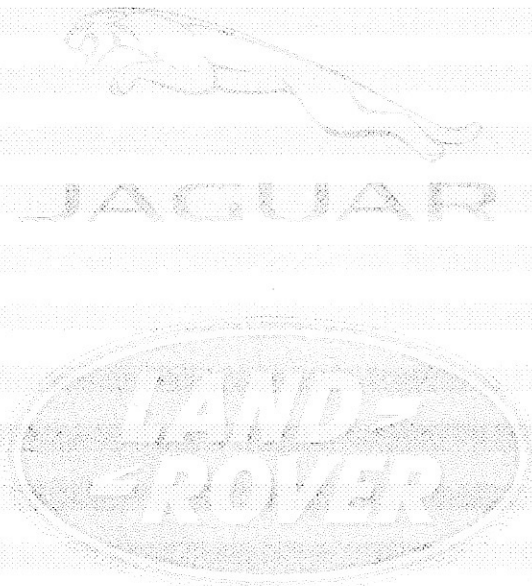

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By	Date & Time	Authorization Obtained By
\$	\$			☐ In Person Approval ☐ Telephone ☐ Text ☐ Email/Fax (See Attached)
Revised Estimate	\$			☐ In Person Approval ☐ Telephone ☐ Text ☐ Email/Fax (See Attached)

☐ Tire pressure check/inflation service was performed.
RF _____ psi LF _____ psi RR _____ psi LR _____ psi☐ Customer declined tire pressure check/inflation service.

Initials _____

***HAZARDOUS WASTE DISPOSAL COSTS:** We have added this charge to cover costs associated with the handling, management and disposal of toxic wastes or hazardous substances under California and Federal Law.**ALL PARTS ARE NEW
UNLESS OTHERWISE
INDICATED.**☐ Some Parts Not Returnable

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
WASTE DISPOSAL COSTS *	0.00
TOTAL CHARGES	0.00
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	0.00

DATE

CUSTOMER SIGNATURE

AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

The vehicle is being returned to you in exchange for your payment of the Amount Due.

**NOTICE TO CONSUMER: PLEASE READ IMPORTANT
INFORMATION ON BACK.**