

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 76556

A general cargo ship that is carrying general cargo and/or container cargo

Vessel Name:	DEVBULK GULTEN
IMO Number:	9659189
DOC Company:	Debulk Gemi Isletmeciligi AS
Place of Inspection:	Brazil, Belem
Name of Inspector:	Gonzalo Parra Sandoval
Inspection Completion Date:	8/5/2026 12:00:00 AM
Operational Variant:	The vessel involved in STS operations or planning to be involved in STS operations

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

Number of Findings: 26

Section 2: Certification and Personal Management

2.5 Do all personnel maintain rest period/work hours and are the rest hours in compliance with STCW or MLC requirements? (V)

Findings: During the review of the June and July records, the deck logbook recorded that the Officer of the Watch and an AB carried out the fire patrol at the end of each watch. However, the corresponding work periods were not recorded in the hours of work and rest records.

Section 3: Navigation

3.13 Where fitted are the standard magnetic compass, gyro compass and Global Navigation Satellite System compass, operational, adjusted and properly maintained?

Findings: The last gyro compass overhaul was completed on 24/Apr/2025. No evidence was available to demonstrate that a subsequent gyro compass overhaul had been carried out. At the time of the inspection, more than 15 months had elapsed since the last overhaul, exceeding the manufacturer's recommended annual maintenance interval by more than three months.

3.17 Were appropriate charts and publication used for the previous voyage?

Findings: Admiralty publication NP231, listed in the company's SMS as a required bridge publication, was not available on board.

Section 4: ISM System

4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course?

Findings: The two most recent enclosed space entry permits, the person designated as the responsible person for the enclosed space entry had also entered the enclosed space.

4.18 Are the lifeboats, rescue boat and davit-launched life raft their equipment and launching arrangements serviced periodically in good condition, and are the crew familiar with the launching procedure and operation?

Findings: During the operational test, Battery No. 1 of the port side davit-launched lifeboat was found discharged and was unable to provide electrical power for starting the lifeboat engine.

4.19 Are life rafts in good order and are hydrostatic release units maintained and installed correctly?

Findings: The securing lashing wire of the forward liferaft was found covered with vinyl sheathing.

Attachments:



[Q419_IMG_20260805_094755_HDR.jpg](#)

4.38 Has the vessel been provided with ship-specific fire safety and SOLAS training manuals and operational booklets?

Findings: The ship-specific SOLAS training manual did not include the required guidance on helicopter rescue gear and retrieval methods.

4.39 If the vessel is provided with a helicopter operating area, does the area comply with the requirements of ICS guidelines, and is there a safe access from the hatch cover to deck?

Findings: The vessel was unable to demonstrate the availability of the equipment required for helicopter operations in accordance with the ICS Guide to Helicopter/Ship Operations. Ship's personnel confirmed that the required helicopter operation equipment was not available on board.

4.41 Are the crew familiar with the helicopter operation at sea, and are records available to show that the proper communication, shipboard helicopter safety checklist and specific risk assessment conducted prior to helicopter operation?

Findings: Approximately 15 months had elapsed since the last helicopter operation drill, which had been conducted on 15/May/2025. No more recent records were available to demonstrate continued crew familiarisation with helicopter operations at sea.

Section 5: Pollution Prevention and Control

5.8 Are suitable containment arrangements in place around the hydraulic components of deck machinery? (V)

Findings: No hydraulic oil containment arrangements were provided beneath any of the hatch cover hydraulic cylinders or beneath the hatch cover hydraulic control stations.

Attachments:



[Q508_IMG_20260805_090521_HDR.jpg](#)



[Q508_IMG_20260805_091219_HDR.jpg](#)

Section 6: Ship's Structure

6.2 Does the SMS include procedures and instructions for regular inspection of cargo holds, ballast tanks, void spaces, trunks, duct keel and cofferdams by the ship's personnel and are records maintained? (V)

Findings: No inspection records, photographs or video evidence were available to demonstrate that the lower stools and pipe duct had been inspected by the ship's personnel.

Section 10: Mooring Operations

10.3 Are the certificates of mooring lines and mooring tails available on board? (V & M)

Findings: Certificates were not available for all mooring lines in use on board.

10.5 Is there a procedure for testing the winch brake rendering setting and is it being tested regularly? (V & M)

Findings: The port aft mooring winch, the inner brake adjustment indicator pointer was missing, and the brake setting position could not be identified.

Attachments:



[Q1005_IMG_20260805_084930_HDR.jpg](#)

10.6 Are mooring lines correctly deployed and tended? (V)

Findings: (1) The forward spring lines and one stern line were of different materials and had different construction.(2) The stern spring lines and forward head lines were observed slack.

Attachments:



[Q1006_IMG_20260804_175646_HDR.jpg](#)



[Q1006_IMG_20260804_180625_HDR.jpg](#)

10.8 Are all mooring lines on winches correctly reeled on drums, and if made fast ashore, are winch brakes secured and winches out of gear? (V)

Findings: The mooring line on the outer drum of the starboard aft mooring winch was observed crossing over and being trapped beneath other turns of the mooring line on the drum.

Attachments:



[Q1008_IMG_20260805_085051_HDR.jpg](#)

10.13 Are the mooring stations maintained in a safe working condition, and is the entire mooring deck area clearly marked with visible signage and appropriately identified as a hazardous zone? (V)

Findings: The mooring lines at the forward mooring station were stowed in direct contact with the deck.

Attachments:



[Q1013_IMG_20260805_094821_HDR.jpg](#)

10.19 Have the anchors been tightly secured in the hawse pipe? (V)

Findings: Both anchors were not fully housed and tightly secured in their respective hawse pipes while the vessel was alongside.

Attachments:



[Q1019_IMG_20260804_180516_HDR.jpg](#)



[Q1019_IMG_20260804_180730_HDR.jpg](#)

Section 13: Machinery Space

13.9 Is the engine room logbook, as well as other required records being properly maintained? (V)

Findings: The review of the engine room records, the engine room printer was configured to print only watch handover parameters, and no historical engine room alarm records were available for the previous 12 months.

13.26 Is the workshop clean and tidy, and are the engine room workshop tools' protective guards, shields, and emergency stops in good condition? (V)

Findings: The bench drill was not fitted with a fixed protective guard and was not provided with a dedicated emergency stop. Only the ON/OFF switch was fitted.

Attachments:



[Q1326_IMG_20260804_204816_HDR.jpg](#)

13.34 Is the pipe work in the machinery space, including but not limited to steam, fuel, lubricating oil, sewage, drain and air lines well maintained, in good condition and free of temporary repair and leakage? (V)

Findings: Two sections of the 6-inch main engine seawater cooling line were fitted with temporary soft patch repairs, with evidence of pinhole leakage observed. In the lower level of the engine room, a temporary soft patch repair was also fitted to the ballast stripping line. Additionally, approximately 50 cm of the port side grey water drain line was missing, leaving the line discontinuous.

Attachments:



[Q1334_IMG_20260804_213258_HDR.jpg](#)



[Q1334_IMG_20260804_213700_HDR.jpg](#)



[Q1334_IMG_20260805_101555_HDR.jpg](#)

13.37 If the starting source of the emergency generator relies on a single starter motor, has a spare starter motor been provided? (V)

Findings: No evidence was available to demonstrate that the spare starter motor for the emergency generator had been periodically tested.

Attachments:



[Q1337_IMG_20260805_081830_HDR.jpg](#)

Section 14: General Appearance - Hull and Superstructure

14.2 Are the following permanent markings on the ship's hull, where applicable, plainly visible and painted in a contrasting colour? (V) The vessel's name Port of registry Load lines Draft marks Thruster warnings Tug push points IMO number Bulbous bow mark

Findings: The starboard forward draught marks above the 9 m mark were obscured by corrosion and were not readily legible. The starboard aft draught marks showed evidence of corrosion.


14.10 Are portable and fixed cargo lights used for illumination of cargo holds inspected regularly and maintained in good condition? (V)

Findings: The lamp holder, drip shield and shade of the portable cargo lights on board were not made from non conductive material. There was no objective evidence of regular inspection and testing for the insulation of these portable cargo lights

Attachments:



[Q1410_IMG_20260805_091006_HDR.jpg](#)

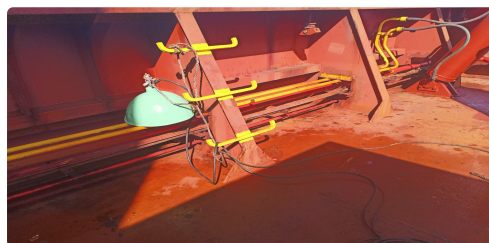

[Q1410_IMG_20260805_091447_HDR.jpg](#)

Section 17: Ship To Ship Operation

17.5 Was a Joint Plan of Operation (JPO) readily available onboard, and did the master and deck officers demonstrate familiarity with its contents, and were the operations executed in accordance with the plan's requirements?(V)

Findings: The STS documentation, no Joint Plan of Operation (JPO) was available on board to demonstrate the planned STS arrangements or crew familiarisation with its contents.

17.7 Has the company identified additional roles and responsibilities that necessitate training and familiarisation for the Officers to conduct the STS operation safely and effectively? Have the Master and Officers undergone suitable training for these roles?(V)

Findings: The STS documentation, no evidence was available to demonstrate that the Master and Officers had received training and familiarisation for their assigned roles and responsibilities during STS operations.

17.8 Has the vessel's manager developed procedures that require post-operation feedback and assessment by the Master and, where applicable, was there objective evidence demonstrating that such feedback was provided after the last STS operation?(V)

Findings: The vessel's STS procedures, no procedure was available requiring post-operation feedback and assessment by the Master following STS operations.

Vessel's Master Name


RASIT CIFTCIBASI

Vessel's Master Email Address

devbulkgulten@devbulk.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

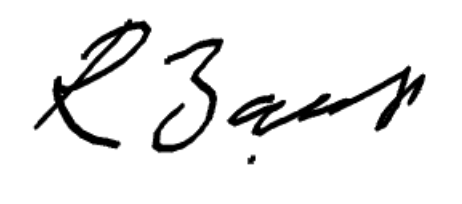

A handwritten signature in black ink, appearing to read "R. Zamp", is written above a solid horizontal line.

Inspector Name

Gonzalo Parra Sandoval

Inspector's Signature:



A stylized handwritten signature in black ink, featuring a large loop and a vertical stroke, is written above a solid horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta