

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 66703

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	PATAGONIA
IMO Number:	9611280
DOC Company:	Nordic Hamburg Shipmanagement (HK) Ltd
Place of Inspection:	Ecuador, Guayaquil
Name of Inspector:	Jose Medina Ortiz
Inspection Completion Date:	10/23/2025 12:00:00 AM
Operational Variant:	A bulk carrier that is carrying grain cargo - the cargo spaces had been fumigated at least once in the past 12 months

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

Number of Findings: 16

Section 2: Certification and Personal Management

2.1 Is the latest Class Survey Status available and are all statutory certificates listed in the Class Survey Status valid, and is the vessel free of condition of class or significant recommendations? (M)

Findings: The class status report dated 20 October 2025 was reviewed and a Condition of Installation was found recorded as follows: - The left arm of jib deck crane No. 4 must be permanently repaired at the owner's earliest convenience, but not later than the due date indicated below. (Due date: 12 January 2026)

Attachments:



[Q201_2ea46315-d99f-43f6-abfc-55bd1f32ba98.jpg](#)

2.15 Does the ship's manager provide value-added training courses beyond the STCW to its on-board officers? (V)

Findings: The Master, Chief Officer, 3rd deck officer had not attended BTM or BRM courses

Section 3: Navigation

3.6 Has the master/pilot information exchange been taking place effectively and is the standard pilot card being completed as required? (V)

Findings: Relevant information like the maximum SWL of the mooring bitts, bollard pull capacity of the tug boats used during the berthing manoeuvring, LDBF of the ship's mooring ropes, and the mooring plan were not recorded in the Pilot Card / Master- Pilot exchange information, the document boxes to insert the information were left blank

3.22 Are records available to show that the echo-sounder recorder is being switched on prior to each approach to shallow water, port entry and departure and has the echo sounder remained in operation while the vessel has been transiting in shallow waters? (V)

Findings: The 2nd deck officer was not familiarized with the operation of the echosounder. He was not able to test the echo sounder depth alarm

Section 5: Pollution Prevention and Control

5.26 Are bunker and ballast tank manholes maintained in good condition?

Findings: During the inspection of the starboard side water ballast tank No. 2, it was observed that the access manhole lid had nine (9) damaged and missing fastening bolts that were not fitted in their position to secure the lid

Attachments:



[Q526_8f515a07-25ea-48da-9d23-0e61fe8a3025.jpg](#)



[Q526_bd1c15cc-e2a7-42d2-b1de-3f667e5511b7.jpg](#)

Section 8B: Cargo Operation - Bulk Grain

8B.25 Has the vessel been provided with a gas free certificate at the discharge port prior to commencement of discharge operation? (V)

Findings: The vessel had not received a gas free certificate for the cargo holds that had been subjected to fumigation before the discharge operation. The certificate was requested by the inspector on 22 October 2025 at 19h45m during the inspection in the cargo ship's office

Section 9A: Hatch Cover and Lifting Appliances

9A.6 Are quick-acting cleats and crutches all in place and in good working condition with the rubber washers flexible and free from paint and crack? (V)

Findings: Three (3) quick-acting cleats of the hatch covers of the cargo holds No 1, 3 and 5 (Starboard side) their washers were not free of paint

Attachments:



[Q9a06_6a7393f7-87c6-4185-b57c-8335ec8da0fd.jpg](#)



[Q9a06_6b1cf1b9-ce8b-4b24-b8da-6e2b37eed902.jpg](#)

9A.21 Are the ship's grabs being maintained as per manufacturer recommendation and have the maintenance requirements been incorporated in the PMS? (V)

Findings: The capacity of grabs used for the loading and discharging of bulk cargoes utilising the ship's cranes, and the weight of the grab was not readable on the name plate attached to the grabs due to the weather exposure and paint applied during the maintenance

Attachments:



[Q9a21_6c0d018d-a996-455e-8bf2-4807a1b97f5d.jpg](#)



[Q9a21_dfcef1aa-8f5d-4786-9afd-cea652cfa9d8.jpg](#)



[Q9a21_e647eca4-6739-42fd-9961-3341e4e6b7c4.jpg](#)

Section 10: Mooring Operations

10.1 Has the company established guidelines and procedures for the inspection, maintenance and wear zone management of the mooring lines and are they being implemented? (V & M)

Findings: The LMP (Mooring Equipment Booklet) on board did not state procedures for the mooring ropes end to end. There was no evidence on board of mooring ropes end to end job

10.4 Do mooring lines and mooring tails comply with industry guidelines and are they in good order? (V & M)

Findings: The LDBF of the mooring ropes exceeded the 100 - 105 % of the maximum SDMBL of the vessel

10.6 Are mooring lines correctly deployed and tended? (V)

Findings: It was noted that the vessel used mooring ropes of different material like high grade synthetic compound with polyester and polypropylene, nylon and polyester (Atlas, polypropilen ropes) and all of them with different LDBF and diameters from 68 to 100 tons, and 67 to 72 mm, as per their certificates on board

Attachments:



[Q1006_66271aa2-6586-41f4-880e-992158fe110d.jpg](#)

Section 11: Radio and Communication

11.2 Is communication equipment, listed in the Record of Equipment attached to the Safety Radio Certificate or Safety Certificate (Form R or Form C), in good condition and has the GMDSS Logbook (the Radio Log) been maintained correctly and are daily, weekly and monthly tests being carried out? (V)

Findings: The AIS monthly test and the antenna inspection had not been recorded in the GMDSS log book

Section 13: Machinery Space

13.20 Is lagging and insulation, free of any significant oil impregnation ? (V)

Findings: The purifier room pipe system the lagging of a section approximately of 800 mm in length was soaked with oil. This observation was corrected before the inspector left the vessel

Attachments:



[Q1320_9f267f0b-8de8-4cb9-8871-8332fd5bb359.jpg](#)

Section 14: General Appearance - Hull and Superstructure

14.2 Are the following permanent markings on the ship's hull, where applicable, plainly visible and painted in a contrasting colour? (V)The vessel's namePort of registryLoad linesDraft marksThruster warningsTug push pointsIMO numberBulbous bow mark

Findings: The port side hull forward, midship and aft draft marks were not visible had lost their constrasting paint

Attachments:



[Q1402_1e656bc8-99d3-41ad-99eb-0b46a3d0f23b.jpg](#)



[Q1402_5913ada6-35f3-43dc-bbc9-34cb4e0ac7a8.jpg](#)



[Q1402_c6dc0c96-0a19-481f-b2d0-104974659248.jpg](#)

14.10 Are portable and fixed cargo lights used for illumination of cargo holds inspected regularly and maintained in good condition? (V)

Findings: The portable cargo lights for illumination of cargo holds were not nonconductive, and had a voltage of 200V

Attachments:




[Q1410_ed7e7ef0-753f-4638-b470-9d5407420182.jpg](#)

14.13 Are the stores located inside the accommodation and on the weather decks clean and tidy? (V)

Findings: Two (2) lights in the bosun store (Internal forecastle) their plastic covers were found broken and holed


Attachments:

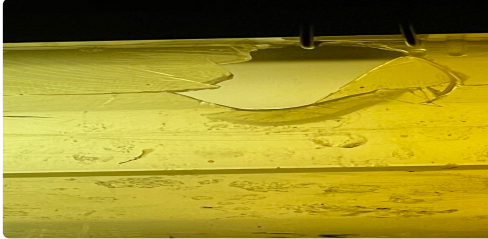

[Q1413_36068a5a-afb7-429b-a041-98ed0c57cda7.jpg](#)



[Q1413_e261ecab-73ec-4cd5-bf67-1fdd3bd563d5.jpg](#)

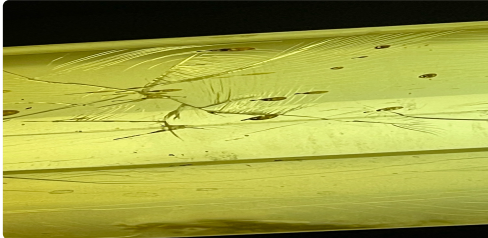

[Q1413_e36912c1-7928-4e9b-872a-b7be55c29b5a.jpg](#)

Vessel's Master Name

Capt. Marek Korzuch

Vessel's Master Email Address

patagonia@bertling.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:



Inspector Name

Jose Medina Ortiz

Inspector's Signature:



CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta