

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 71992

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	RUBY STAR
IMO Number:	9523512
DOC Company:	Chartworld Shipping Corp
Place of Inspection:	India, Kandla
Name of Inspector:	Aakriti Barthwal
Inspection Completion Date:	4/8/2026 12:00:00 AM
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

Number of Findings: 20

Section 3: Navigation

3.20 Are T&P NMs and navigation warnings being used correctly in voyage planning and monitoring?

Findings: ECDIS and Navtex were not integrated onboard , SAT-C warnings and messages were not up to date in the ECDIS. Few of sat-c warnings as reviewed were not updated in the ECDIS system .

Section 4: ISM System

4.3 Are the latest shipboard internal and external audits, as well as the superintendent inspection reports, available? Are corrective actions being taken in response to recorded non-conformances?

Findings: The internal Audit of the vessel by shore was conducted on 16 April 2025 and thereafter on 23 Mar 2026 , in between 11 months there was no visit from either Marine / technical representative from shore onboard.

4.17 Is the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

Findings: Annual pressure testing of oxy- acetylene system was carried out on 19/April 2025, the calibration of the equipment was due in April'26 , where the vessels next port of call was not fixed.

Section 5: Pollution Prevention and Control

5.19 Has a Garbage Management Plan been provided and is the Garbage Record Book (GRB) being correctly maintained?


Findings: Vessel had designated garbage storage locker onboard , the locker was completely filled with garbage bags without segregation of the garbage. Disposal of the garbage was awaited.

Section 7A: Fuel Management (Oil)

7A.2 Are bunker transfer systems hydrostatically tested to their Maximum Allowable Working Pressure (MAWP) on an annual basis and to 1.5 times their MAWP at least twice within any five years period?

Findings: MAWP of bunker transfer system was carried out onboard on 21 Mar 2026 at 7.5 bar, the pressure testing was carried out using compressed air which is not acceptable form of pressure testing the line.

Attachments:

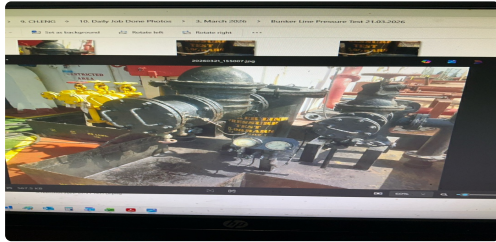

[Q7a02_6684e604-2b1e-4bd1-831b-2e4176e7892f.jpg](#)



[Q7a02_b5627d50-c1dd-446a-aa06-a30b4c8d9760.jpg](#)


7A.3 Are the drains, vents, pressure gauges, and thermometers on the bunker manifolds in good working order, and are blanks fitted when they are not in use? (V)

Findings: Bunker manifolds were not provided with thermometers at / near the bunker line / flange

7A.5 Are there procedures for the analysis of fuel, lubricating and hydraulic oils, and are oil sampling requirements aligned with equipment manufacturer's recommendations? (V & M)

Findings: Emergency diesel generator crankcase fuel oil analysis report indicated oil condition as critical , as per the chief engineer the oil was changed and was sent for sampling , results for the renewed oil were awaited from shore .

Attachments:

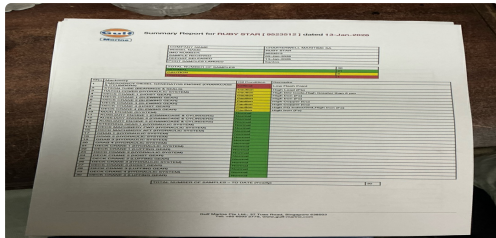

[Q7a05_4ca5f55f-c296-478c-958b-e968d7c2e9e2.jpg](#)

Section 9A: Hatch Cover and Lifting Appliances

9A.1 Are the cargo holds, including the underside of hatch covers, free of loose rust scale and paint flakes? (V)

Findings: Underside of cargo hold no. 7,6,5,4&3 was found to moderately rusted covering 15-20% of the area.

9A.4 Are the compression bars and the coaming tops' water channels clean, free of corrosion and maintained in good condition? (V)

Findings: 1. Coaming tops water channels of No7,6,5&4 CH was found to be moderately rusted. Nearly 8-9 m
2. Lips and rubber packing drain channel for no.7,6,5,4&3 cargo hold was found to be heavily rusted nearly 5-6

Section 10: Mooring Operations

10.5 Is there a procedure for testing the winch brake rendering setting and is it being tested regularly? (V & M)

Findings: Brake rendering test onboard was carried out by ship staff on 13 Mar 2026 , the gap between adjustable nut and below the brake band was more than 5-6 mm at 2 places ,while one of the nut was misaligned and was out of the brake band lining .

10.9 On split drum winches, have the split drums been set up correctly after the completion of mooring operation? (V)

Findings: Vessel was provided with split drum winches onboard , excessive turns and two layer turns were left on the working side of the mooring winch (tensions drum) thus Disabling it's maximum holding power.

10.18 Are the windlasses, anchors, locking bars, and cables, as well as the working access arrangement, in good working order and are they maintained as part of the plan maintenance system? (V)


Findings: Vessel was stbd side alongside , port anchor was lowered in water while vessels stay at port. It was advices by the pilot to keep the anchor lowered until berthing of the vessel .

Section 13: Machinery Space

13.3 Has the Chief Engineer prepared specific standing orders, night and day orders, and have these orders been read, understood, and signed by the watch standing engineers, engine crew, and electrical engineer, where applicable? (V & M)

Findings: Relevant engineers had signed the chief engineer standing order , the date for the orders were found to be missing. Vessel was certified to be operated in UMS operation , precautions during UMS operations was not identified in the standing orders issued by the chief engineer .

Attachments:

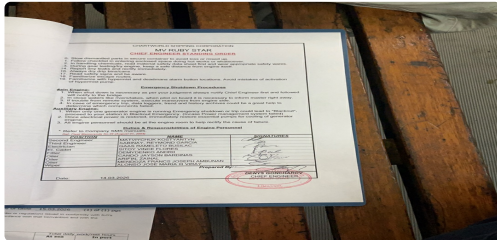


[Q1303_742d15f9-0911-435c-a224-56ddf788b801.jpg](#)


13.13 Is the main engine maintained as per manufacturer's recommendations and records of periodic maintenance kept? (V)

Findings: Vessel had Man B&W engines installed onboard . The maintenance schedule for main engine in PMS was not align as per manufacturer guidelines. Piston overhaul was 16000 hr in PMS as directed 12000 hr by manufacturer.

Attachments:

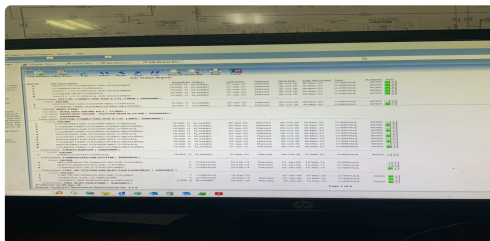

[Q1313_166102a2-71e7-4b01-9df2-2ef1bda041c3.jpg](#)

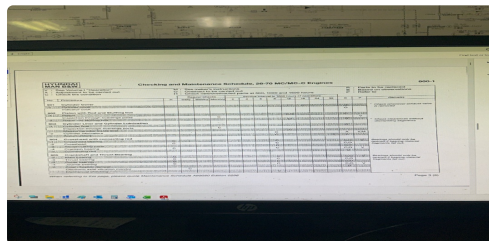


[Q1313_bf1e273d-8929-47e2-89b1-222c56aef41a.jpg](#)


13.14 Are the auxiliary engines maintained as per manufacturer's recommendations and records of periodic maintenance kept?(V)

Findings: Auxiliary engines onboard were Doosan , the maintenance schedule in PMS was not in line with manufacturer guidelines . Camshaft and camshaft drive was 16000 hrs overhaul interval in PMS as directed 12000 hrs by manufacturer .

Attachments:

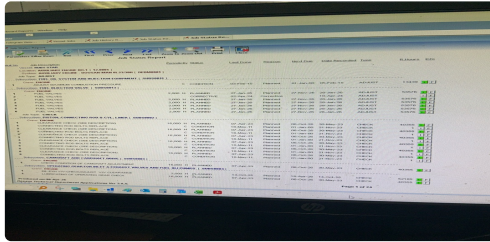

[Q1314_99412843-4e97-4c0c-a0f7-f5279ac35284.jpg](#)

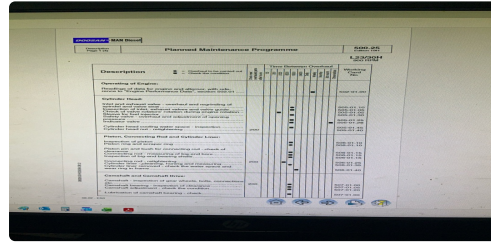

[Q1314_a53eac85-1618-4462-a728-30cc91eb0af1.jpg](#)

13.18 Are engine room emergency stops for ventilation fans and the closing mechanism of ventilation supply and exhaust ducts clearly marked, in working condition, and do records indicate that they have been regularly tested? (V)

Findings: Funnel flaps were not closing adequately where the light was passing once the flap were closed . The funnel flaps were not sitting adequately for light seal on the rubber packing .

13.33 Is the following machinery/equipment, where applicable, in good order and well maintained? (V)

Shaft generator and emergency generator Boilers, including waste heat and domestic boilers (Boilers should be operated in automatic mode where the automated boilers are installed) Boiler safety system and instrumentation Boiler water safety system Main and emergency air compressors Purifiers and fuel oil handling equipment Stern tube sealing arrangements Incinerator Sewage system Air condition and heating system Refrigeration plant Accommodation service systems (i.e., Calorifiers, Portable water equipment, heating etc) Any other items of machinery, including stand-by machinery. Burners, tubes, uptakes, exhaust manifolds and spark arrestors. Engine control console including the control and monitoring system Steering gear system Battery maintenance and renewal.

Findings: Fuel oil pump No.2 in purifier room lines/ valves were covered and stained in fuel oil . Steam line passing near fuel oil pump No.2 was leaking with spray of steam coming out from the flange area.

Section 14: General Appearance - Hull and Superstructure

14.1 Is the ship's hull clean, free of significant corrosion, extensive coating breakdown and marine growth? (V)

Findings: Vessel was stbd side alongside , the hull area had moderate rust at various places covering the hull of nearly 200x200 cm area each. 20% of the hull was covered in moderate rust .

14.2 Are the following permanent markings on the ship's hull, where applicable, plainly visible and painted in a contrasting colour? (V) The vessel's name Port of registry Load lines Draft marks Thruster warnings Tug push points IMO number Bulbous bow mark

Findings: Draft marks fwd and aft were rusted and faded above 10m line , midship draft marks below 10 m line were rusted and faded.

14.4 Are the pipes on deck free of significant corrosion, pitting, soft patches, leakage or temporary repair and maintained in good condition? (V)

Findings: 1. Nearly 20-30 m of CO2 line on deck was found to be moderately rusted with flakes of metal coming out of the line . 2. Nearly 20-30 m of hydraulic line on deck leading to hatch cover operating panel was found to be moderately rusted on deck. 3. Fire line flanges from D to C deck was found to be moderately rusted , few of the fire line flanges on deck was found to be moderately rusted.

Vessel's Master Name

Capt. Onbasilar Seckin

Vessel's Master Email Address

master.rubystar@gtships.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:



A handwritten signature in black ink, appearing to be 'Onbasilar Seckin', written over a horizontal line.

Inspector Name

Aakriti Barthwal

Inspector's Signature:



A handwritten signature in black ink, appearing to be 'Aakriti', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta