

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 64977

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	NORDIC MALMOE
IMO Number:	9602679
DOC Company:	Nordic Hamburg Shipmanagement GmbH & Co KG
Place of Inspection:	Indonesia, Bahodopi
Name of Inspector:	Muhammad Yussra
Inspection Completion Date:	7/15/2025 12:00:00 AM
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

Number of Findings: 39

Section 2: Certification and Personal Management


2.7 Have officers and ratings responsible for cargo handling on ships carrying dangerous and hazardous substances in solid form in bulk, undergone formal training? (V)

Findings: None of the deck ratings on board had undergone formal training in the carriage and care of dangerous and hazardous substances in solid form in bulk, including materials hazardous only in bulk (MHB), as outlined in paragraphs 2 to 14 of Section B-V/b of the STCW Code.

2.9 Has an SMS policy and procedure been established to enforce the STCW Convention and Code requirements for the purpose of preventing drug and alcohol abuse? (V & M)

Findings: The company's drug policy did not cover the vendors and contractors.

Attachments:

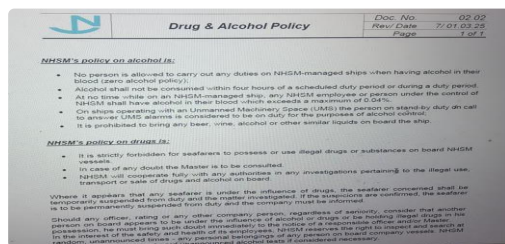

[Q209_1752474777627.jpg](https://www.rightship.com/attachments/2023/07/01/23/02_09_Drug_and_Alcohol_Policy.pdf)

Section 4: ISM System


4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course?

Findings: There was no evidence that the enclosed space register onboard the vessel had been identified through a risk assessment conducted in accordance with Annex 1.2 of the Code of Safe Working Practices for Merchant Seafarers. Additionally, the register did not include the following: - The characteristics of the space, including its physical layout and access/egress points. - Identification of any potential hazards. - Measures to prevent entry, including locking and signage arrangements. - Procedures to follow when entering, including details such as the estimated time required for ventilation. - Information related to ventilation, including equipment and its storage location. - Lighting requirements, including provisions for temporary lighting. - Requirements for atmospheric testing.


4.7 Are procedures in place for the control of hot work, are they incorporated in the safety management system and is there documented evidence of compliance? (M)

Findings: The hot work permit dated 26th June 2025 for welding on light stancion on port side bridge wing was valid from 08:00LT to 10:10 LT However, the Master signed the permit only at 08:15 LT,well after the permit validity period had already commenced.

Attachments:

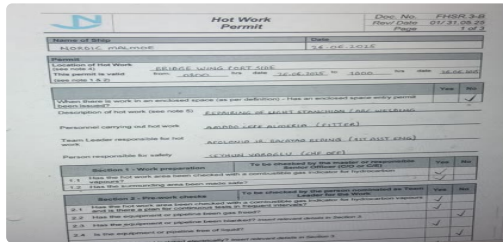

[Q407_1752474997614.jpg](#)

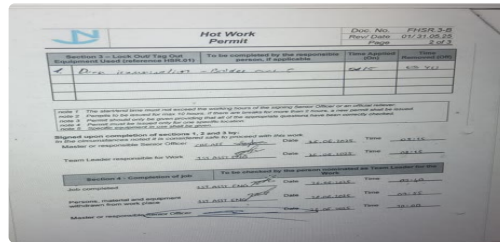

[Q407_1752475043470.jpg](#)


4.8 Has a specific permit to work and effective Lock-Out/Tag-Out (LOTO) system been introduced for high-risk duties and are the permits being used effectively? (V)

Findings: The vessel was not equipped with any physical lock-out arrangement to isolate any equipment as necessary.

4.10 Are there procedures for reporting, investigation and close-out of findings, accidents, and hazardous situations available and are they being followed? (V)

Findings: There was an incident which was not documented in Rightship record where one of crew member had declared unfit and had been repatriated home due to sustained a moderate deep wound in the right calf due to high pressure water jet penetrated his rubber boot on 21st April 2025.

Attachments:



[Q410_1752477869161.jpg](#)

4.11 Has a PPE Matrix for use of personal protective equipment been provided and is it being worn as required? (V)

Findings: There was no procedure established requiring the inspection of the inertia reel personal fall arrestor onboard every twelve months or after a fall.

4.12 Are on-board safety meetings held regularly are they reviewed by the vessel's manager and feedback provided where necessary? (M)

Findings: There was no record of the monthly onboard safety meetings on May 2025 and June 2025 being reviewed by the vessel's manager, nor was feedback provided where necessary.

4.17 Are the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

Findings: 1) The flexible hose for both oxygen and acetylene lines had been secured with jubilee clips at both ends of connections. 2) There had been no record of the annual inspection, thorough examination, and testing of all components of the oxygen and acetylene installation onboard, conducted by a competent person in accordance with the equipment manufacturer's guidelines.

4.18 Are the lifeboats, rescue boat and davit-launched life raft, their equipment and launching arrangements being serviced periodically in good condition, and are the crew familiar with the launching procedure and operation? (V & M)

Findings: 1) During the port side liferaft davit operational test, a trickle of hydraulic oil was leaking from the connection joints of the hydraulic line pipes. 2) The freefall lifeboat's forward window was found to be opaque with a brittle crack on the outer layer of the window.

4.24 Are fire mains and associated isolation valves, fire boxes, hoses, nozzles, applicators, and spanners regularly inspected and maintained and found to be in a satisfactory operating condition? (V & M)

Findings: The fire hose used at the forward mooring deck was detached from the connection coupling during the testing of the emergency fire pump.

4.34 Are Material Safety Data Sheets (MSDS) for all bunkers, chemicals, paint, corrosive, and toxic materials available, and are all crew familiar with their contents? (V)

Findings: The MSDS for all the bunker sample was not made available in the forward paint locker.

4.37 Are pilot ladders used for pilot transfer in good condition and inspected regularly, clearly identified with tags or with permanent marking and are maintenance records available? (V)

Findings: 1) The Record of Approved Safety Equipment was not updated to reflect the actual quantity of pilot ladders onboard, their installation dates, and manufacturers. The record indicated that the vessel carried pilot ladders manufactured by Jiangyan City Jingang Ship Machine Co. Ltd., with dimensions of 13.5 metres × 2. However, the vessel actually had two pilot ladders onboard, manufactured by Qingdao Good Brother Marine Lifesaving Appliances and Delmar Safety Inc., with lengths of 12 metres and 9 metres, respectively. 2) There was no evidence that the company had established a periodic training interval for personnel responsible for rigging and inspecting pilot ladders, specifically covering the inspection requirements, regulations, and standards related to pilot ladders and their use.

Section 5: Pollution Prevention and Control

5.4 Are the scupper plugs fitted and in a satisfactory condition, and are there suitable measures in place for draining water on deck when the vessel is involved in dry bulk cargo operations? (V)

Findings: There were no procedures established in the SMS to ensure that the deck containment's integrity was maintained, including the proper use of drain valves where fitted and ensuring controlled drainage of accumulated water from the deck during cargo operations.

5.10 Is the Ballast Water Treatment system in good order and were the Master and Officers familiar with the vessel's Ballast Water Management Plan, and were records available to demonstrate that ballast handling had been conducted in accordance with the plan?

Findings: The Ballast water treatment system was out of order at the time of inspection.

5.15 Are the Engine room Bilge pumping system and Oily Water Separator (OWS) in good order and being operated in accordance with MARPOL requirements? (V&M)

Findings: The time displayed on the oily water separator (OWS) monitoring panel had been 13:25 UTC /21:25 LT. However, the actual time had been 20:17 LT, making the displayed time offset by 1 hours and 8 minutes from the actual time.


5.24 Are the ballast pumping systems, their associated instruments, controls, valves, and pipework in good order and is there recorded evidence of regular inspection? (V)

Findings: There were three ballast valves (No. 1 Wing Starboard, No. 1 Double Bottom Port and No. 5 Double Bottom Starboard) that could not be operated remotely and required manual operation.

5.25 Is the ballast control panel, including the pressure gauges, draft gauges, remote control system for the ballast line and ballast valves in good order and maintained regularly?

Findings: 1) All the draft level monitors in the ship's offices were unreliable, showing significant differences from the actual draft. 2) The operating time of the ballast valve was not being recorded as per the manufacturer guidance for the optimum opening and closing times for each valves.

Attachments:

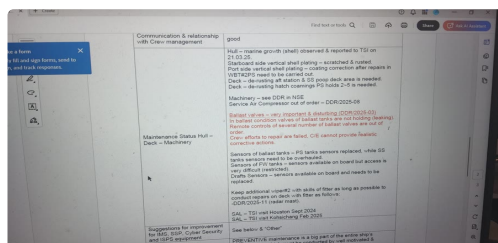


[Q525_1752475676791.jpg](#)

Section 6: Ship's Structure

6.2 Does the SMS include procedures for regular inspection of cargo holds, ballast tanks, void spaces, trunks, duct keel and cofferdams by the ship's personnel and are records maintained? (V)

Findings: 1) The fresh water tank port side had due for the 6-monthly inspection on 22nd May 2025 2) There was no evidence that the company had included a procedure for the regular inspection of the cofferdam onboard, and no inspection report was available.

Attachments:

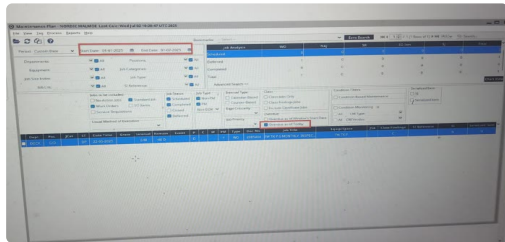

[Q602_1752475520090.jpg](#)

Section 9A: Hatch Cover and Lifting Appliances

9A.9 Are the side and cross-joint rubber seals in good condition? (V)

Findings: The rubber packing on the No. 5 hatch cover aft panel, port-side corner, was damaged over a length of approximately 10 cm.

9A.11 Are seal retaining channels in good condition and free of corrosion? (V)

Findings: The seal retaining channel on all the hatch cover aft panel was significantly wasted, corroded and thinned down.

9A.13 Are the following parts of the hatch covers, where applicable, all in good order and do they appear to be well maintained? (V) Wheels/bearings or trackway Hydraulic system including hoses Chains Link pin and safety pin Cargo holds' ventilator on the side and end of hatch panel


Findings: There was an active alarm "Low Oil Level" activated in the hatch cover hydraulic pump station panel.

Section 10: Mooring Operations

10.1 Has the company established guidelines and procedures for the inspection, maintenance and wear zone management of the mooring lines and are they being implemented? (V & M)

Findings: There was no evidence that the personnel assigned the responsibility for rope inspections was properly trained to recognise rope damage.

Attachments:

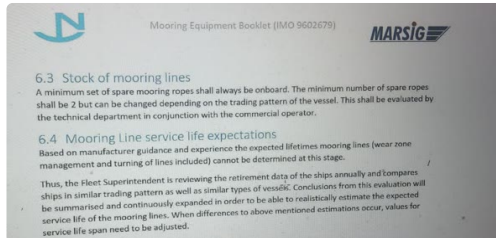

[Q1001_1752475423410.jpg](#)

10.2 Does the vessel's manager carry out regular safe mooring campaigns, learning from near misses and accidents related to mooring operations and are these shared with the fleet? (V & M)

Findings: There was no evidence of regular mooring campaigns being initiated by the vessel's manager to incorporate lessons learned from near misses and accidents related to mooring operations.

10.4 Do mooring lines and mooring tails comply with industry guidelines and are they in good order? (V & M)

Findings: 1) One of the starboard side aft spring lines were found with significant abrasion about 10cm in length. 2) One of the forward starboard-side outer mooring lines was found with significant abrasion approximately 10 cm in length. | The ship's design minimum breaking load (SDMBL) was 480 KN. However, 15 of the in use mooring ropes and 5 of the spare mooring ropes on board had a Line design breaking force ranging from 674 KN to 1020 KN , which exceeded 105% of the ship's design minimum breaking load.

Attachments:



[Q1004_1752558482269.jpg](#)

10.9 On split drum winches, have the split drums been set up correctly after the completion of mooring operation? (V)

Findings: 1) The company did not specify the minimum number of turns required to be maintained on the tension drum in the Line Management Plan. 2) There was only one turn remaining on the tension drum of the forward mooring winch on the inner port side.

10.15 Do controls, linkages, operating levers, brake drums, brake linings and pins of winches appear to be in good order? (V)

Findings: The starboard-side aft outer winch brake linings were significantly worn.

10.18 Are the windlasses, anchors, locking bars and cables in good order, operating effectively and is their maintenance incorporated in the plan maintenance system? (V)

Findings: There was no Planned Maintenance System in place covering the anchors, locking bars, cables, or the associated working access arrangements.

Section 11: Radio and Communication

11.2 Is communication equipment, listed in the Record of Equipment attached to the Safety Radio Certificate or Safety Certificate (Form R or Form C), in good condition and has the GMDSS Logbook (the Radio Log) been maintained correctly and are daily, weekly and monthly tests being carried out? (V)

Findings: There was no evidence in the GMDSS logbook for the monthly test carried out for the month of June 2025 that covered the checking and inspection of all GMDSS battery connection and antennas for security of mounting and visible damage to the cables and insulator.

Section 12: Security

12.4 If the vessel transits or may transit a high-risk piracy area, are updated security charts and publications being provided? (V)

Findings: The vessel did not have the security charts Q6113 that covered the vessel's passage to Bahodopi, Indonesia.

12.5 If the vessel transited or may transit an area with a high risk of piracy, has a voyage risk assessment been produced? (V)

Findings: There was no record indicating that the vessel had conducted a voyage risk assessment while transiting an area of high piracy risk in Indonesian waters.

Section 13: Machinery Space

13.2 Is an engineer manning matrix in place and are the responsibilities of watch standing engineers and engine ratings clearly defined and posted in the Engine Control Room? (V)

Findings: According to company procedure, the Engine manning level during arrival at Bahodopi, Indonesia, should have been set to Engine Watch Level 3. However, there was no record in the Engine logbook indicating that this requirement was adhered to upon arrival in Bahodopi, Indonesia.

13.7 If an engine room dead man alarm (personnel alarm) is provided, is it being set correctly and in good order? (V)

Findings: The vessel had been certified for UMS operation. However, there had been no company procedure or requirement established for regularly testing the engine room dead man alarm.

13.8 Is an engineer's calling alarm system fitted and is it tested regularly, in good order and the results recorded? (V)

Findings: The engineers' call alarm was not tested regularly, and there was no record maintained of such tests.

13.12 Is critical equipment identified and are a sufficient spare part available as per the manufacturers' recommendations? (V & M)

Findings: The vessel had below critical spare-part items, less than the minimum inventory required onboard. Fire detection - Heat detector Water Ingress System - Water ingress spare sensor Water Mist System - Flame detector

Attachments:

[illegible]

[Q1312_1752475201031.jpg](#)

13.14 Are the major components of the auxiliary engines maintained as per manufacturer's recommendations and records of periodic maintenance kept? (V)

Findings: 1) There was a trickle of fuel oil leaking from the outlet line connection of the fuel oil duplex filter on the No. 1 auxiliary engine. 2) There was approximately 1.5 litres of oil contained in the save-all of the No. 3 auxiliary engine base frame near the flywheel.

13.33 Is the following machinery/equipment, where applicable, in good order and well maintained?

(V)Shaft generator and emergency generatorBoilers, including waste heat and domestic boilers (Boilers should be operated in automatic mode where the automated boilers are installed)Boiler safety system and instrumentationBoiler water safety systemMain and emergency air compressorsPurifiers and fuel oil handling equipmentRefrigeration and air conditioning machineryStern tube sealing arrangementsIncineratorSewage systemAir condition and heating systemRefrigeration plantAccommodation service systems (i.e., Calorifiers, Portable water equipment, heating etc)Any other items of machinery, including stand-by machinery.Burners, tubes, uptakes, exhaust manifolds and spark arrestors.

Findings: 1) The boiler was out of order at the time of inspection. 2) There was a temperature sensor fault and a fault on the analog input pressure pickup for the diesel oil pump, both indicated on the fuel oil booster unit display panel in the purifier room. 3) Various sensor failure alarms appeared on the ECR monitoring alarm panel, including: – Ballast/Stripping Ejector Suction Pressure – No. 2 Ballast Pump Current – Bilge GE PP Outlet Pressure – Sea Water Temperature – CW Drain Tank Level High Alarm 4) The microphone headset inside the emergency generator room was out of order at the time of inspection.

Section 14: General Appearance - Hull and Superstructure

14.3 Are the weather decks free of loose rust scale and maintained in a satisfactory condition? (V)

Findings: The weather deck in the monkey island area had significant scattered hard rust covering approximately 20% of the total deck area.

14.19 Are the ship's guard rails, walkways, and access ladders, as well as the steps and railings, maintained and in good working order, and are the securing arrangements for deck cargoes on the deck also maintained and in satisfactory condition?

Findings: There was a slight bend in the cargo hold vertical ladder railing on the lower platform in Cargo Hold No. 3, forward port section.

Vessel's Master Name

Oleksii Dovgal

Vessel's Master Email Address

captain@nordic-malmoe.nhsm-fleet.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

A handwritten signature in black ink, appearing to be 'Oleksii Dovgal', written over a horizontal line.

Inspector Name

Muhammad Yussra

Inspector's Signature:

A handwritten signature in black ink, appearing to be 'Muhammad Yussra', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta