

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 68331

A general cargo ship that is carrying general cargo and/or container cargo

Vessel Name:	PACIFIC INNOVATION
IMO Number:	9469778
DOC Company:	Nordic Hamburg Turkey Gemi Yonetim Danismanligi AS
Place of Inspection:	Philippines, Batangas
Name of Inspector:	Jose Ray Tan
Inspection Completion Date:	12/21/2025 12:00:00 AM
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

Number of Findings: 18

Section 2: Certification and Personal Management

2.5 Do all personnel maintain rest period/work hours and are the rest hours in compliance with? STCW? or? MLC? requirements? (V)

Findings: The fire rounds during the vessel at sea from 13/Dec to 19/Dec undertaken by A/B 2000-2400H duty after his watch was not recorded in the work/Rest Hours record nor recorded in the logbook.

Section 3: Navigation

3.6 Has the master/pilot information exchange been taking place effectively and is the standard pilot card being completed as required? (V)

Findings: The section for the tug BHP/Bollard pull was not filled out in the Pilot Card form from 22/Jul/2025 till the last checklist dated 11/Dec/2025

3.8 Are the fire and safety rounds being conducted at the end of each watch? (V)

Findings: The fire round during the 0000-0400H watches was carried out at 0200H as recorded in the logbook, effectively leaving the OOW without a watchman during the dates of 12/Dec/2025 to 18/Dec/2025

3.26 Is the Global Navigation Satellite System (GNSS) set to the correct Geodetic Datum, and are officers aware of the errors and alarms associated with GNSS?

Findings: The officer was not familiar with the errors associated with the GNSS when questioned.

Section 4: ISM System

4.10 Are there procedures for reporting, investigation and close-out of findings, accidents, and hazardous situations available and are they being followed? (V)

Findings: 1) The vessel reported a Non-conformity Report on 19/Jun/2025 regarding the ship's office port hole window, which was found to be cracked. The NC had a due date of 20 September 2025, which was already three months past. 2) The vessel had an AMSA finding on 11/Sep/2025 due to the engine room ventilation fan being found inoperative, resulting in detention. This was not reported as a Non-conformity report.

4.17 Are the welding and gas-burning equipment, as well as the electric arc welding equipment, properly stored and maintained in good working order?

Findings: The Oxygen and acetylene bottles stored in the poop deck were found with their flexible hoses still connected between the bottles and the regulators. The vessel had been programmed to carry out hot work by service contractors that day, for which the crew had prepared the bottles.

Section 5: Pollution Prevention and Control

5.8 Are suitable containment arrangements in place around the hydraulic components of deck machinery? (V)

Findings: All the hatch cover hydraulic cylinder rams were found without a suitable containment arrangement on the main deck.

Section 7A: Fuel Management (Oil Fuel)

7A.3 Are the drains, vents, and pressure gauges at the bunker manifolds in good order and blanks fitted when not in use? (V)

Findings: The blank fitted to the bunkering manifold for the D.O. line port side was not rated to match the flange to which it was connected. The blank thickness was around 10mm, while the flange thickness was 20mm.

7A.7 Are bunkering and oil fuel transfer procedures carefully planned and executed in accordance with industry standards, are the details of the last operation in accordance with industry standards, is the vessel equipped with a procedure for sampling the oil fuel used on board, and are bunker samples stored in a sheltered location?

Findings: There were no records indicating that high-level alarms were tested during the bunkering operation dated 28 August 2025, nor were there any records preceding this date. The bunkering checklist does not contain that high-level alarms were tested before the bunkering operation. The vessel was equipped with high-level alarms in all fuel and diesel oil tanks.

Section 9A: Hatch Cover and Lifting Appliances

9A.3 Are adequate procedures in place for carrying out hose and / or ultrasonic testing of hatch covers and is documented evidence of such testing available? (V)

Findings: The last hose test was conducted on 29 March 2025, whereas PMS requirements specify that the test be conducted quarterly.

9A.10 Are hatch cover panels free of misalignment? (V)

Findings: 1) The cargo hold no. 2 locator or sliding positioner forward part (P & S) had an 18 mm gap at the aft end, while the forward part was already touching metal to metal. 2) The cargo hold no. 3 locator or sliding positioner forward part (starboard side) had an 18 mm gap at the aft end, while the forward part was already touching metal to metal. Meanwhile, on the port side, the sliding positioner's forward part had a 15 mm gap at the aft end, while the forward part was already touching metal to metal.

Section 10: Mooring Operations

10.14 Are appropriate stoppers in use and are the mooring ropes turned up to bitts correctly? (V)

Findings: The stopper found at the forecastle deck was found to be frayed, with the strands in the middle portion damaged.

10.18 Are the windlasses, anchors, locking bars and cables in good order, operating effectively and is their maintenance incorporated in the plan maintenance system? (V)

Findings: The vessel had anchored using the starboard anchor with the cable deployed up to 11 shackles. The chain visible on deck was heavily covered with marine growth.

Section 12: Security

12.6 Have preventive measures been taken by the master and crew during the stay in port and prior to departure to prevent stowaways? (V)

Findings: The last Stowaway checklist was dated 24/Apr/2025 at Marowai, Indonesia. The vessel had called numerous ports in Indonesia, Malaysia and the Philippines thereafter, but no stowaway checklist was filled out at these ports

Section 13: Machinery Space

13.12 Is critical equipment identified and are a sufficient spare part available as per the manufacturers' recommendations? (V & M)

Findings: The BWTS was not included in the Critical Equipment List as found in the SMS Document no. F10.02-C (Critical Equipment Spares). Upon further scrutiny, the vessel was found to have the spares required by the maker, Alfa Laval.

13.14 Are the major components of the auxiliary engines maintained as per manufacturer's recommendations and records of periodic maintenance kept? (V)

Findings: The A/E No. 1 parts (cylinder heads, piston rings, connecting rod with bearings, and 1 unit main bearing) were overdue. The present running hours were 42,722. The last major overhaul was completed with 31,340 running hours. This was planned for a major overhaul at Zhangjiagang, the vessel's next port of call.

Section 14: General Appearance - Hull and Superstructure

14.9 Are the mast heads and their fittings, including but not limited to wire stays, as well as the flood lights, deck lights, emergency lights, and hold lights (if installed), in good working order?

Findings: The radar mast, with 4 stays, was found covered with Denso tape. The tape was observed to be dry, and some sections were tattered, exposing the wire.

Section 15: Health and Welfare of Seafarers

15.14 Does the Air Handling Unit (AHU) maintain a comfortable temperature and is there recorded evidence of regular maintenance and cleaning of AHU available?

Findings: Lagging was found missing from one section of the condenser piping, with a length of about 50 cm. There were also 2 other sections of piping with lagging, crudely repaired with tape wound around the lagging material.

Vessel's Master Name


Volodymyr Davydenko

Vessel's Master Email Address

captain@pacific-innovation.nhsm-fleet.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

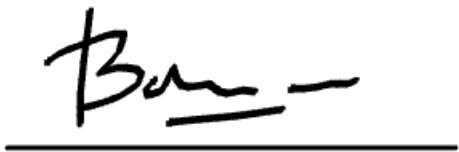


A handwritten signature in black ink, appearing to read 'Bam', is written above a solid horizontal line.

Inspector Name

Jose Ray Tan

Inspector's Signature:

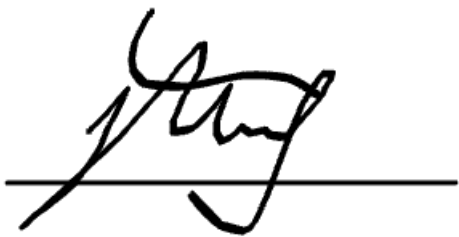

A handwritten signature in black ink, appearing to read 'J. Tan', is written above a solid horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta