

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 72171

A bulk carrier that is carrying grain cargo

Vessel Name:	ANADOLU S
IMO Number:	9667758
DOC Company:	Oras Denizcilik ve Ticaret Ltd Sti
Place of Inspection:	Egypt, El Dekheila
Name of Inspector:	Ahmed Awad
Inspection Completion Date:	4/9/2026 12:00:00 AM
Operational Variant:	A bulk carrier that is carrying grain cargo - the cargo spaces had been fumigated at least once in the past 12 months

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

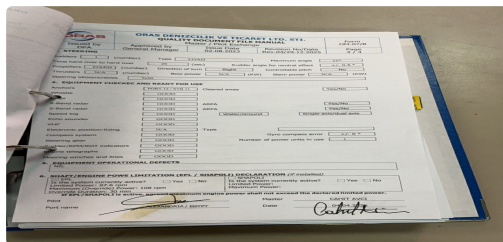
Number of Findings: 11

Section 3: Navigation

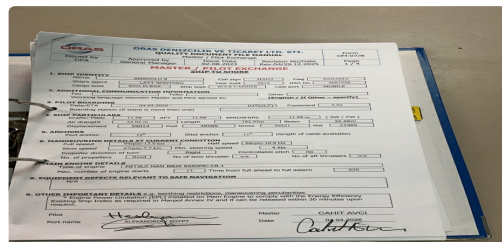
3.6 Has the Master/Pilot information exchange been taking place effectively and is the standard pilot card being completed as required? (V)

Findings: The pilot card for the previous and present port was reviewed. It was noticed that the form didn't clearly indicate whether a power limiter is engaged, the time necessary to override the power limitation systems, and the ship's maximum power capacity, both with and without the application of the limiter.

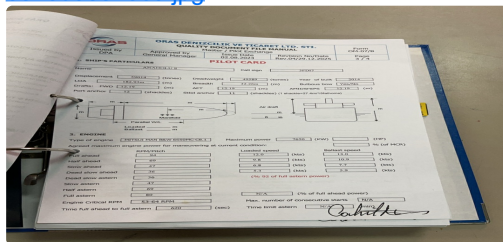
Attachments:

A photograph of a pilot card form titled "ORAS GENELİĞİ VE EKİPMANLARI" (General Information and Equipment). The form is filled out with handwritten information, including ship name, port, and various technical specifications. It is signed by the Master/Pilot.

[Q306_6e77fef7-4b89-4f0a-8785-5543d9857569.jpg](#)

A photograph of a pilot card form titled "ORAS GENELİĞİ VE EKİPMANLARI" (General Information and Equipment). The form is filled out with handwritten information, including ship name, port, and various technical specifications. It is signed by the Master/Pilot.

[Q306_8963dca7-6ac1-4d70-a3ab-5273de73cb48.jpg](#)

A photograph of a pilot card form titled "ORAS GENELİĞİ VE EKİPMANLARI" (General Information and Equipment). The form is filled out with handwritten information, including ship name, port, and various technical specifications. It is signed by the Master/Pilot.

[Q306_f48de3b7-93ae-4fca-bb9a-9045129edffb.jpg](#)

3.22 Are records available to show that the echo-sounder recorder is being switched on prior to each approach to shallow water, port entry and departure and has the echo sounder remained in operation while the vessel has been transiting in shallow waters?

Findings: No records were made to check the units of soundings on the echo sounder are the same as those on the chart in use.

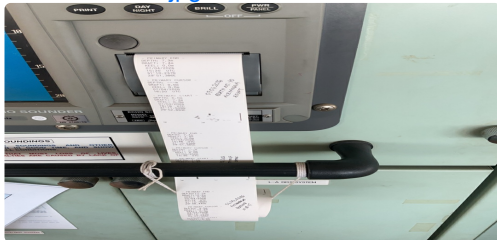
Attachments:



[Q322_96fa8090-9eb9-4d4f-ad49-372c81a42273.jpg](#)



[Q322_c46536d0-348c-4a16-8c00-65cc86e9e667.jpg](#)



[Q322_eec81ae9-d669-47af-9b29-3ebdaf61efab.jpg](#)

3.23 Was the berth-to-berth passage plan of the previous voyage comprehensive and approved by the Master?

Findings: Neither the point of no return and VTS and reporting points nor Stand-by Engine, call master were marked on the ECDIS passage planning course.

Section 4: ISM System

4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course?

Findings: 1. The vessel was not provided with enclosed space emergency response plan. 2 The vessel's portable multi gas detector is only capable of measuring O2, LEL, H2S and O2. The device was not suitable to measure CO2. 3. The vessel was provided with two multi gas detector type Honeywell BW Max XT II. None of the interviewed senior officers were aware of the time required to clear the air from a 12m hose based on the pump airflow/suction capacity to ensure that the reading were a true representation of the atmosphere inside the space being measured.

4.7 Are procedures in place for the control of hot work, are they incorporated in the safety management system and is there documented evidence of compliance? (M)

Findings: The most recent Hot work permit was sighted. The permit did contain a description of the work, did not list all the people involved in the job, nor the tools used or the methods being employed. There was no separate work plan

4.42 Are the lifebuoys, related equipment, and pyrotechnics in good working order?

Findings: Self igniting light and smoke signal connection line to the man overboard life buoy was shorter than required for this manufacture to generate the required force to release the smoke signal from its bracket. The manufacturers required 3.6 m while the connection length was 2.8 m.

Section 10: Mooring Operations

10.6 Are mooring lines correctly deployed and tended? (V)

Findings: Two Aft stern lines deployed from the port side were wrapped around the roller in a 360 deg angle. Mooring lines were not correctly deployed. Mooring lines were crossing and in some cases (forecastle deck) led with sharp changes of direction.

Section 13: Machinery Space

13.13 Is the main engine maintained as per manufacturer's recommendations and records of periodic maintenance kept? (V)

Findings: The main engine unit no. 3 cylinder drain pipes were found with active leaking fuel oil at the rate of about ~5 drops/min.

13.14 Are the auxiliary engines maintained as per manufacturer's recommendations and records of periodic maintenance kept?(V)

Findings: Two auxiliary engines no. 2, noted with trace of old leaking oil/oily water through flywheels, accumulating ~ 2 cm on platforms. According to CE it was from previous maintenance no.1 Cylinder.

13.27 Is the engine room crane, other lifting equipment, and hydraulic tools inspected, tested, and maintained on a regular basis? (V & M)

Findings: Engine room crane traveling beam, hook, as well on the internal fore and aft 'I' beam. were not marked to indicate the SWL.

13.43 Is the rudder angle indicator at the emergency steering position in good order, and is the display clearly legible? (V)

Findings: The rudder angle indicator at the emergency steering position was not clearly marked with red and green.

Vessel's Master Name

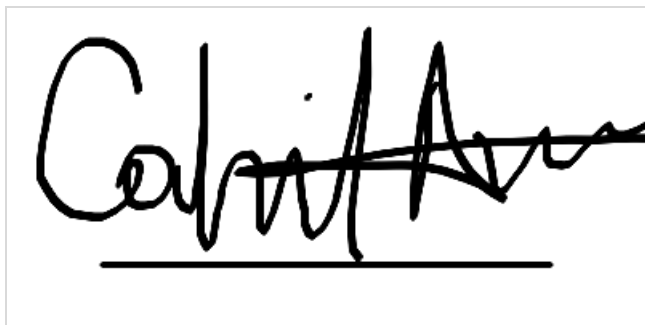
CAHIT AVCI

Vessel's Master Email Address

Anadokus@skyfile.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

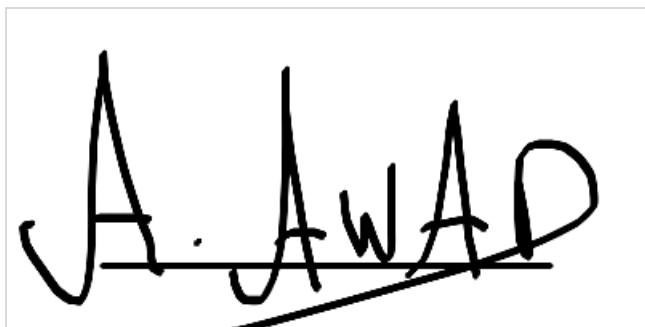
Vessel's Master Signature:

A handwritten signature in black ink, appearing to read 'Cahit Avci', written over a horizontal line.

Inspector Name

Ahmed Awad

Inspector's Signature:

A handwritten signature in black ink, appearing to read 'A. AWAD', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta