Tanny Spa Acquisitions

Shop Inspection

Customer: Mario Macias
Technician: James Moe

Mario Macias Restoration - 158

ID: 158
Mario Macias

Refurbishment JOB-01KZRNW557GPW46KFQCR1Z4Z1F

REPORTED ISSUE

Hot tub picked up in july. Customer wants it picked up as soon as possible

TECHNICIAN FINDINGS

the biggest thing you need to know the palm circuit board

DETAILS

INTAKE DATE

October 28, 2026 3:15 PM

OVERALL CONDITION

This score reflects the share of inspected components in passing condition at the time of service. Items marked N/A or NOT TESTED are excluded. Details for every checkpoint are listed below.

21 of **28** inspection points passed **Grade C**

INSPECTION SUMMARY

ELECTRICAL

Shop Power / GFCI Trip Test ..... NOT TESTED
Not able turn pump 1 on

Voltage ..... PASS

TS1 ..... NOT TESTED

TS2 ..... NOT TESTED

Heater ..... PASS

Spa Pack ..... PASS
Not giving voltage to the pump - Reconfigured wiring, got it working

Topside Controller ..... PASS

FILTRATION

Filters ..... PASS
Missing. - At the customer's house

Filter Housing ..... PASS
cover is missing - at the customer's house

Skimmer / Basket ..... N/A

STRUCTURE

Shell ..... FAIL
Excessive staining - CLR Cleaning and shell polishing

Frame ..... PASS

Aux Topside — FAIL
Sticker is peeling slightly

Flow Switch — N/A

Pressure Switch — FAIL
No continuity, while circulation bumped while circulation pump running. - Bypassed temporarily. New heater. we'll have a new one.

EQUIPMENT

Pump 1 — PASS
Rebuilt with new bearings and seals

Pump 2 — N/A

Circulation Pump — PASS

Blower — N/A

Light — PASS

Ozone — PASS

Stereo — N/A

PLUMBING & JETS

Jets — PASS
Because pump is not working.

Plumbing — PASS
Leaking from drain plug - needs overage pressure test once new pump and heater are installed.

Freeze Damage — PASS

Airrater Valves — NOT TESTED

Waterfall Control Valves — FAIL
Needs seal replaced.

Gate Valves — N/A

Diverter Valves — NOT TESTED

Waterfalls — PASS

Chemical Dispenser — N/A

Sides — PASS

Headrests — PASS
Missing - All the customers house

Insulation — PASS

Rodent Damage — FAIL
Mouse droppings - will be thoroughly cleaned when pump and heater are installed

Drain — PASS
It leaks - fixed 10/28

COVER

Cover — PASS
Missing - at customers house

Cover Clips — PASS

WATER

Cleanliness — FAIL
Needs rust staining removed.

FINAL TEST RUN

Final Test Run — FAIL
Will be completed after new components are installed.

REQUIRED REPAIRS

- **Install new hot springs seat.**
- **Diagnose & Re-Run Final Test**
- **Drain & Clean**

PHOTOS

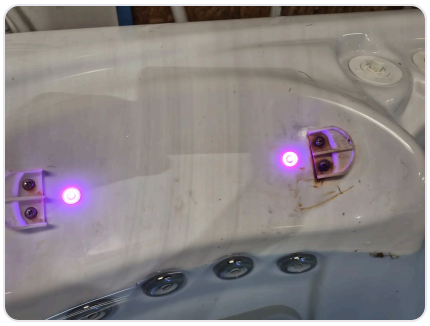
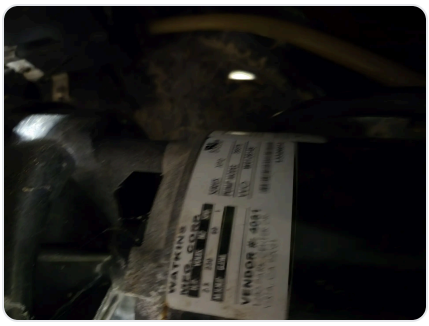

HotSpring
Portable Spas

E5-NSHNNN3W14
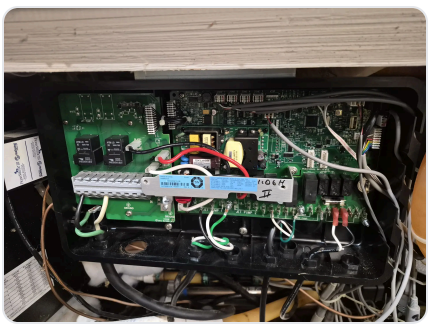

HotSpring
SOVEREIGN
II4R1455
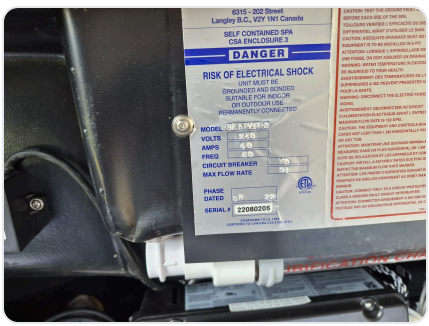
6315 - 202 Street
Langley B.C., V2Y 1N1 Canada
SELF CONTAINED SPA
CSA ENCLOSURE 3
DANGER
RISK OF ELECTRICAL SHOCK
UNIT MUST BE
GROUNDED AND BONDED
SUITABLE FOR INDOOR
OR OUTDOOR USE
PERMANENTLY CONNECTED
MODEL
VOLTS
AMPS
FREQ
CIRCUIT BREAKER
MAX FLOW RATE
PHASE
DATED
SERIAL #
22080205
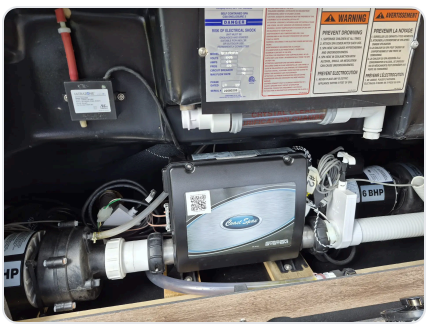
WARNING
PREVENT DROWNING
6 BHP