

HOME INSPECTION REPORT

Property Address:	456 Oak Avenue, Portland, OR 97210
Property Type:	Single Family Home
Year Built:	1998
Square Footage:	3,200 sq ft
Inspection Date:	2025-10-25
Inspector:	Professional Inspector (AI-Assisted)
Customer:	Test Client (Realistic Photo Test)

OVERALL CONDITION

Rating: Fair (3/5)

EXECUTIVE SUMMARY

Executive Summary: The property located at 456 Oak Avenue, Portland, OR 97210, is a single-family home constructed in 1998, encompassing 3,200 square feet. The inspection conducted on October 25, 2025, reveals that the home is generally well-maintained, with a solid foundation and no significant structural issues. However, several areas require attention to ensure the continued safety and integrity of the home. The inspection identified a total of six issues, with the most critical being severe rust on the furnace, which may compromise its efficiency and safety. This issue warrants immediate attention to prevent potential heating failures or safety hazards. Additionally, the presence of water damage and potential mold growth under the kitchen sink, along with a water stain on the master bedroom ceiling, suggests ongoing moisture issues that could lead to further damage if not promptly addressed. The roof's aging shingles also require evaluation and potential replacement to prevent future leaks. Furthermore, a vertical crack in the basement concrete wall, though not immediately threatening, should be monitored for any signs of expansion. To enhance the safety and functionality of the property, it is recommended to replace the non-functioning GFCI outlet to mitigate electrical hazards. Addressing these issues with timely repairs and maintenance will help preserve the home's value and ensure a safe living environment for the occupants. It is advisable to consult with qualified professionals for detailed assessments and remediation of the identified concerns.

INSPECTION SUMMARY

Total Issues Found: 6

By Severity:

- Safety Hazard: 1
- Major: 1
- Moderate: 4

By Category:

- Interior: 1
- Electrical: 1
- Plumbing: 1
- Roof: 1
- Structural: 1
- Hvac: 1

DETAILED FINDINGS

INTERIOR

■ ■ Water Stain on Master Bedroom Ceiling

Location: Master Bedroom Ceiling near Bathroom Wall

Severity: Moderate

Description:

A large brown water stain is visible on the ceiling near the bathroom wall in the master bedroom. The stain measures approximately 12-14 inches across and feels slightly damp to the touch, indicating a potential active leak from the bathroom above. This suggests a possible plumbing issue, such as a leak from the shower pan or fixtures.

Recommendation:

Investigate the source of the leak, which may be from plumbing or roof issues. Repair the leak and replace any damaged materials to prevent mold growth. Recommend plumber inspection of shower pan and fixtures.

Inspector Notes:

Recommend plumber inspection of shower pan and fixtures.



Photo: ceiling_water_stain.jpg (Timestamp: 30.0s)

ELECTRICAL

■ Non-Functioning GFCI Outlet

Location: Bedroom, north wall

Severity: Safety Hazard

Description:

The GFCI outlet located on the interior wall appears properly installed with no visible defects in the photo. However, the inspector noted that the GFCI outlet in the bedroom on the north wall does not trip when the test button is pressed, indicating a malfunction. This is identified as a safety hazard because GFCI outlets are essential for shock protection.

Recommendation:

Immediate replacement by a licensed electrician is recommended.

Inspector Notes:

GFCI outlets are required for shock protection.



Photo: gfc_i_outlet.jpg (Timestamp: 90.0s)

PLUMBING

■■ Water Damage and Potential Mold Growth Under Kitchen Sink

Location: Kitchen - Under Sink Cabinet

Severity: Moderate

Description:

The under-sink cabinet in the kitchen shows signs of water damage, including warping and discoloration of the plywood base, as well as potential mold growth. The inspector noted that the

particle board cabinet bottom is warped and discolored, indicating past water intrusion. Although the supply lines appear dry at the moment, the damage suggests there was a leak at some point.

Recommendation:

Inspect and repair any leaks in the plumbing. Replace the damaged plywood to prevent mold growth and structural issues. Conduct a mold assessment and remediation if necessary.

Inspector Notes:

Homeowner should monitor this area.



Photo: cabinet_water_damage.jpg (Timestamp: 145.0s)

ROOF

■■ Damaged and Aging Shingles

Location: Roof - North Side

Severity: Moderate

Description:

The roof on the north side shows several asphalt shingles that are lifted and appear to be damaged, likely due to wind or improper installation. The inspector noted significant age-related wear on the south-facing slope, with curling, cracking, and granule loss, and recommended roof replacement within 2-3 years.

Recommendation:

Replace damaged shingles on the north side to prevent water infiltration and further roof damage. Consider roof replacement within 2-3 years due to overall age-related wear.

Inspector Notes:

Inspector recommends roof replacement within 2-3 years due to significant age-related wear.

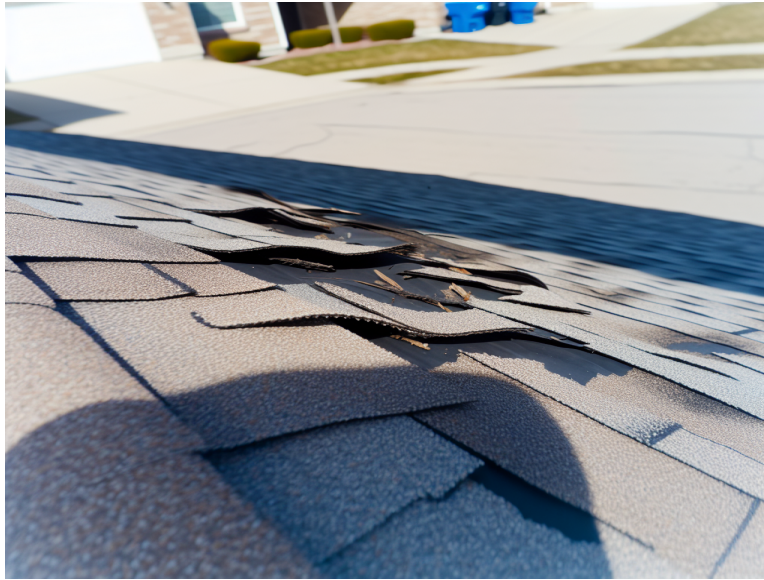


Photo: roof_shingle_damage.jpg (Timestamp: 200.0s)

STRUCTURAL

■■ Vertical Crack in Basement Concrete Wall

Location: Basement Wall, East Side

Severity: Moderate

Description:

A vertical crack approximately 6 feet in length and 1/8 inch in width is visible in the concrete wall of the basement on the east side. This crack may indicate settling or structural stress, and there is some moisture staining around the crack. It is recommended to consult a structural engineer to assess the cause and recommend repairs. Monitoring the crack for any changes in size or shape is advised.

Recommendation:

Consult a structural engineer to assess the cause and recommend repairs. Monitor the crack for any changes in size or shape.

Inspector Notes:

This needs monitoring and potential structural engineer consultation.



Photo: foundation_crack.jpg (Timestamp: 250.0s)

HVAC

■ ■ Severe Rust on Furnace

Location: Utility Room - HVAC Area

Severity: Major

Description:

The furnace in the utility room's HVAC area exhibits significant rust and corrosion on the exterior casing, particularly on the front panel. This rust indicates potential moisture issues and could compromise the structural integrity of the unit. The furnace is approximately 18 years old, which is nearing the end of its typical lifespan. While it is currently functional, the homeowner should budget for replacement in the near future.

Recommendation:

Immediate evaluation by a licensed HVAC technician is recommended to assess the extent of the damage and determine if repair or replacement is necessary. Homeowner should budget for replacement in the near future.

Inspector Notes:

While currently functional, homeowner should budget for replacement in the near future.



Photo: hvac_rust.jpg (Timestamp: 300.0s)