

## Handling and Assembly Guide for SCD30

CO<sub>2</sub>, humidity, and temperature sensor

#### **Preface**

This document provides recommendation on handling and assembly process of SCD30.

To measure CO<sub>2</sub> concentration, humidity and temperature, SCD30 requires interacting with the environment. Hence, special care has to be taken during handling and assembly

in order to achieve best performance.

If the physical characteristics of the sensor change due to mechanical or thermal stress, the calibration might not be valid anymore. In extreme cases, the sensor might be destroyed.

## **Package**

This document provides guidance for handling and assembly of Sensirion SCD30 CO<sub>2</sub>, humidity and temperature sensor. The CO<sub>2</sub> concentration is measured in an optical cavity mounted into a PCB cutout. The RH/T sensor is soldered to the same PCB with thermal isolation.





Figure 1: Package overview

### **ESD Protection**

It is mandatory to protect the sensor from ESD (Electrostatic Discharge). Only handle in ESD protected areas under protected and controlled conditions (ground all personnel with wrist-straps, ground all non-insulating and conductive objects, exclude insulating materials from the EPA, operate only in grounded conductive floor, etc.). Protect sensor outside the EPA using ESD protective packaging.

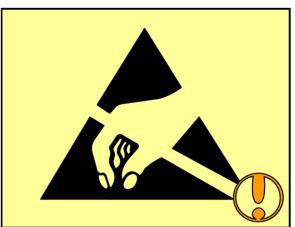

## Storage

Storage must be at a temperature between - 40°C and 70°C.

## **Moisture Sensitivity Level**

SCD30 is not meant to be reflow soldered, hence, the sensor does not have an MSL rating. However, for storage and handling the sensor can be considered to be compatible with MSL1.

#### Mechanical stress


No mechanical stress shall be applied to any part of the sensor during assembly or usage. Especially, no force shall be applied directly on the optical cavity.



## Assembly of SCD30 sensor

It is recommended to solder SCD30 by hand. A pin stripe with pitch 0.1 inch / 2.54 mm should be used to connect SCD30 to external electronics. Only contact pins should be used to mount the sensor. SCD30 should not touch any part of the host PCB.

To prevent contact of SCD30 with host PCB, below recommended standoff height,  $s_h$  should be maintained.



Symbol	Value
h <sub>c</sub>	1.55 mm
hp	Various
Sh	s <sub>h</sub> ≥ 1 mm
	$s_h + h_c > h_p + 0.5 \text{ mm}$

Table 1: Recommended stand of height.

A planar assembly jig (e.g. a cuboid) with a thickness of  $s_h$  can be used for optimal positioning of SCD30 above the

host PCB. When using the assembly jig assembly process is as follows:

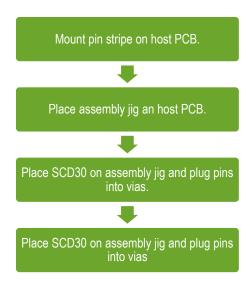


Figure 2 Assembly process of SCD30

## **Mounting Orientation**

SCD30 can be mounted facing upwards or downwards.



# **Revision History**

Date	Version	Page(s)	Changes
April 2018	0.1	all	Initial version

Copyright © 2018 by SENSIRION CMOSens® is a trademark of Sensirion All rights reserved



**Sensirion AG** 

Laubisruetistr. 50 CH-8712 Staefa ZH Switzerland

phone: +41 44 306 40 00 fax: +41 44 306 40 30 info@sensirion.com www.sensirion.com

Sensirion Taiwan Co. Ltd phone: +886 3 5506701 info@sensirion.com www.sensirion.com

Sensirion Inc., USA

phone: +1 312 690 5858 info-us@sensirion.com www.sensirion.com

Sensirion Japan Co. Ltd. phone: +81 3 3444 4940 info-jp@sensirion.com www.sensirion.co.jp

Sensirion Korea Co. Ltd.

phone: +82 31 337 7700~3 info-kr@sensirion.com www.sensirion.co.kr

Sensirion China Co. Ltd. phone: +86 755 8252 1501 info-cn@sensirion.com www.sensirion.com.cn

To find your local representative, please visit www.sensirion.com/distributors