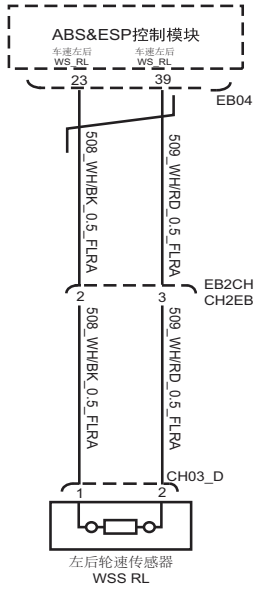
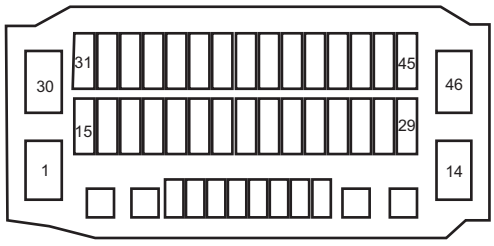
C0037-08、 C00A4-00、 C0038-00、 C00A5-00、 C0038-08

Description of fault diagnosis codes
C0037-08：Left Rear Wheel Speed Sensor multi Failures
C00A4-00：Wheel-speed sensor, front left:short to GND
C0038-00：Wheel-speed sensor, rear left:open
C00A5-00：Wheel-speed sensor, rear left:short to UBATT
C0038-08：Wheel-speed sensor, rear left:(signal failure) direction wrong
Detection tools
1 Multimeter and diagnostic apparatus
Possible causes
• Circuit,terminal and adapting piece fault • ABS&ESP module fault • Rear left wheel-speed sensor fault.
Conditions for fault code operation
Turn the ignition switch to ON position.
Conditions for fault code setting
C0037-08
C00A4-00
C0038-00
C00A5-00
C0038-08
To set the effect of a fault code condition
1 2
Description of circuit diagram
The ABS&ESP module monitors the rear left wheel-speed sensor via low level reference circuit and signal circuit.

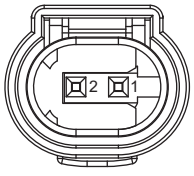
Circuit diagram



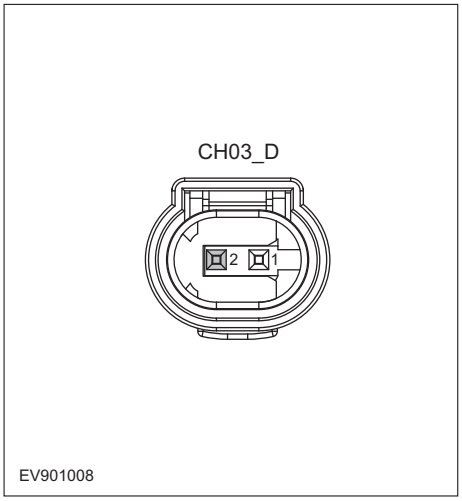
EB04

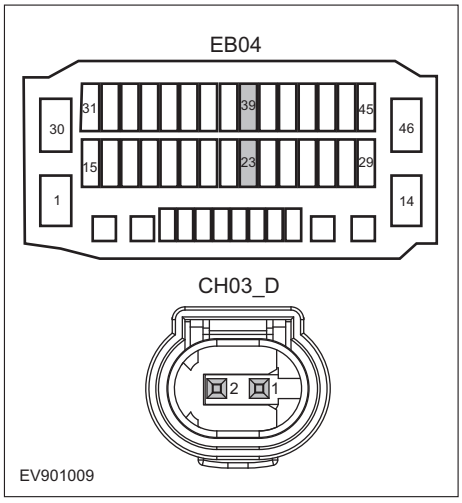


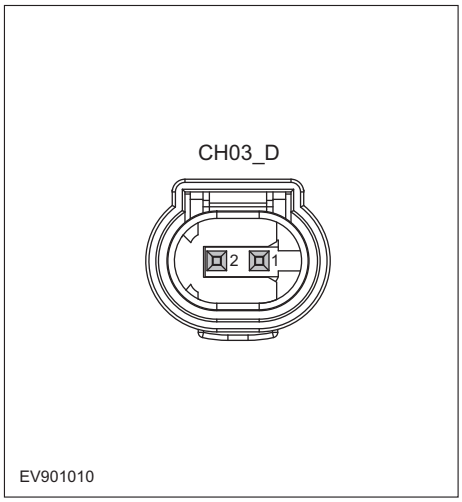
CH03_D

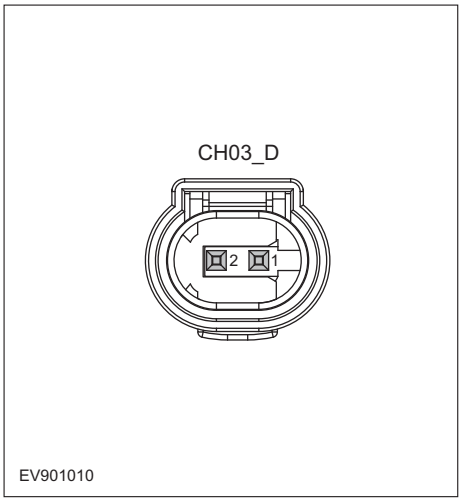


EV901027

Troubleshooting steps		
Step 1	General inspection.	
		1 Check fuse for damage. 2 Check battery capacity. 3 Check the harness plugs of the rear left wheel-speed sensor and the harness plug of ABS&ESP module for damage, poor contact, aging and looseness. 4 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		
Step 2	Check fault codes.	
		1 Connect the fault diagnosis instrument to the diagnosis interface. 2 Turn the ignition switch to ON position. 3 Check the ABS&ESP module with a diagnostic apparatus. 4 Is there any other fault code except for C0037-08/C00A4-00/C0038-00/C00A5-00/C0038-08?
		YES → Refer to:DTC Summary List (ABS&ESP).
NO ↓		
Step 3	Check the power supply circuit of rear left wheel-speed sensor.	
		1 Turn the ignition switch to OFF. 2 Disconnect the harness plug CH03_D of rear left wheel-speed sensor.. 3 Turn the ignition switch to ON. 4 Measure the voltage between the harness terminal of rear left wheel-speed sensor and ground. Measuring circuit: voltage between terminal 2 on plug CH03_D and ground. **Standard value:4.8~5.2V** 5 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		

Step 4	Check the rear left wheel-speed sensor circuit (open-circuit).
	1 Turn the ignition switch to OFF. 2 Disconnect the harness plug EB04 of ABS&ESP module.. 3 Measure the resistance between harness terminal of rear left wheel-speed sensor and ABS&ESP module. Measuring circuit: resistance between terminal 1 on plug CH03_D and terminal 23 on plug EB04. Measuring circuit: resistance between terminal 2 on plug CH03_D and terminal 39 on plug EB04. **Standard value: ≈ 0Ω** 4 Check whether the result is normal or not?
	NO → Repair or replace the faulted parts.
YES ↓	

Step 5	Check the rear left wheel-speed sensor circuit (short-circuit).
	1 Turn the ignition switch to OFF. 2 Measure the resistance between plug terminal of rear left wheel-speed and ground. Measuring circuit: resistance between terminal 1 on plug CH03_D and ground. Measuring circuit: resistance between terminal 2 on plug CH03_D and ground. **Standard value: ∞** 3 Measure the voltage between rear left wheel-speed sensor and ground. Measuring circuit: voltage between terminal 1 on plug CH03_D and ground. Measuring circuit: voltage between terminal 2 on plug CH03_D and ground. **Standard value: ≈ 0V** 4 Check whether the result is normal or not?
	NO → Repair or replace the faulted parts.
YES ↓	

Step 6	Check the rear left wheel-speed sensor (parts).
	1 Measure the resistance of rear left wheel-speed sensor terminal directly. Measuring circuit: resistance between terminal 1 and terminal 2 on plug CH03_D. **Standard value:** 2 Measure the resistance between the rear left wheel-speed sensor terminal and the housing. Measuring circuit: resistance between terminal 1 on plug CH03_D and the housing. Measuring circuit: resistance between terminal 2 on plug CH03_D and the housing. **Standard value: ∞** 3 Check whether the result is normal or not?
	NO → Replace the rear left wheel-speed sensor.
YES ↓	
Step 7	Check if ABS&ESP module is normal.
	1 Turn the ignition switch to OFF. 2 Disconnect and check the harness plug EB04 of ABS&ESP module. 3 Check and repair. • Corrosion(install new adapting piece or terminal-cleaning module and pin). • Pin damaged or bent-install new terminal/pin. • Fly out of pins-install new pins as needed. 4 Reconnect the air conditioning control module plug and all other previously disconnected plug. Make sure the pin is properly positioned and fixed. 5 Run the system and determine if the problem persists?
	YES → Replace the air conditioning control module.
NO ↓	
At this point the system is functioning normally. The problem may be caused by module connections. Address the root cause of any connector or pin problems,	
Next Step ↓	
Diagnosis end.	