

P1B2E-00


Fault diagnosis code
P1B2E-00：DC charging socket temperature sensor fault
Detection tools
1 Multimeter and diagnostic apparatus
Possible causes
• Circuit,terminal and adapting piece fault • Temperature sensor fault
Conditions for fault code operation
Turn the ignition switch to ON position.
Conditions for fault code setting
P1B2E-00
The temperature sensor of the charging socket is faulty, and the collected temperature value is invalid: the charging socket temperature sensor is sampling out of range
To set the effect of a fault code condition
The temperature sensor of the charging socket is faulty, and the collected temperature value is invalid
Description of circuit diagram


Circuit diagram

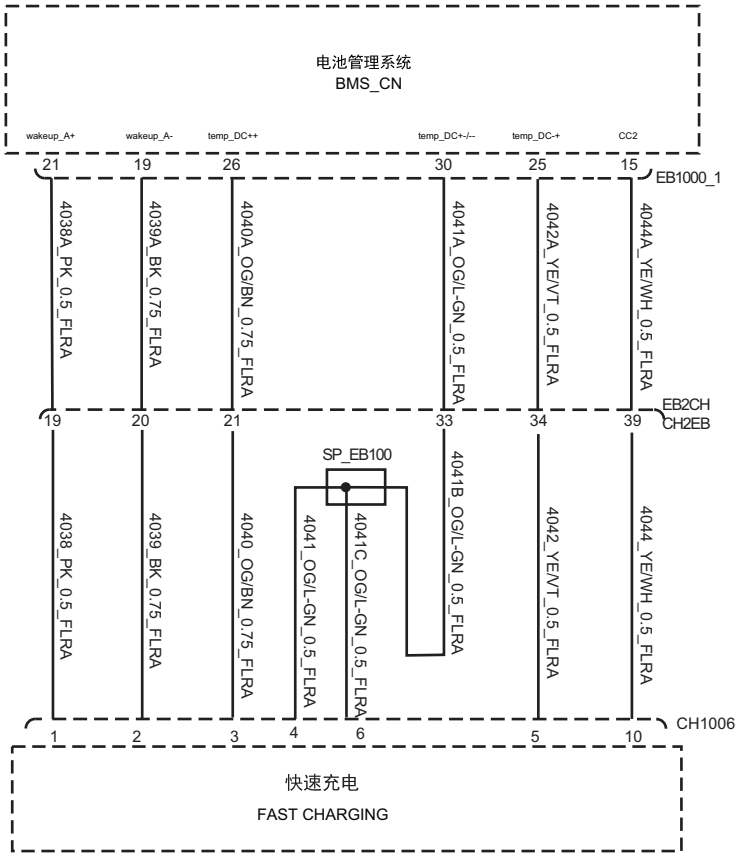

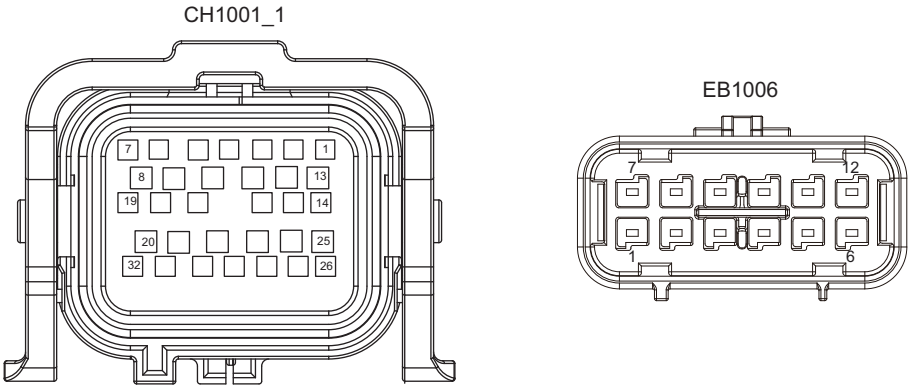

EV903010

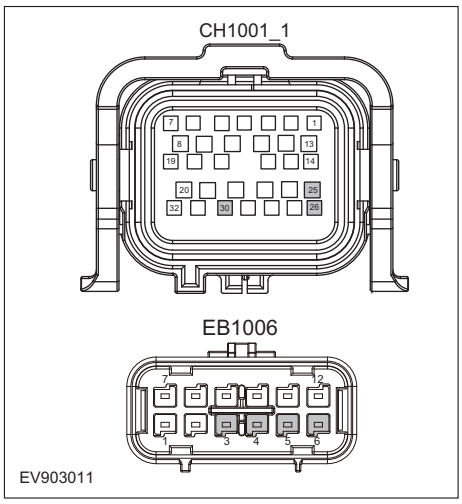Troubleshooting steps		
Step 1	General inspection.	
		1 Check the fuse for damage. 2 Check battery capacity. 3 Check the harness plug of BMS for damage, poor contact, aging and looseness. 4 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		
Step 2	Check fault codes.	
		1 Connect the fault diagnosis instrument to the diagnosis interface. 2 Turn the ignition switch to ON position. 3 Diagnose the BMS with diagnostic apparatus. 4 Is there any other fault code except for P1B2E-00?
		YES → Refer to:DTC Summary list(BMS).
NO ↓		
Step 3	Check the circuit between fast charging and BMS. (Open circuit)	
		1 Turn the ignition switch to OFF. 2 Disconnect the harness plug EB1006 of fast charging. 3 Disconnect the harness plug EB1001_1 of BMS. 4 Measure the resistance between the harness terminals of fast charging and BMS. Measuring circuit: resistance between terminal 3 on plug EB1006 and terminal 26 on plug EB1001_1. Measuring circuit: resistance between terminal 4 on plug EB1006 and terminal 30 on plug EB1001_1. Measuring circuit: resistance between terminal 5 on plug EB1006 and terminal 25 on plug EB1001_1. Measuring circuit: resistance between terminal 6 on plug EB1006 and terminal 30 on plug EB1001_1. **Standard value: < 1Ω** 5 Check whether the result is normal or not?
		NO → Repair or replace the faulted parts.
YES ↓		

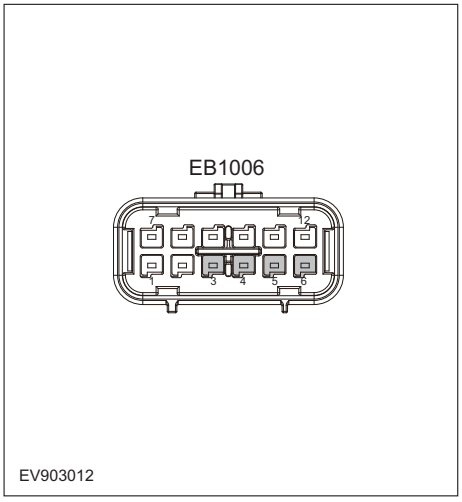Step 4	Check the circuit of fast charging. (Short circuit)
	1 Turn the ignition switch to OFF. 2 Connect the harness plug EB1001_1 of BMS. 3 Measure the resistance between the harness terminal of fast charging and ground. Measuring circuit: resistance between terminal 3 on plug EB1006 and ground. Measuring circuit: resistance between terminal 4 on plug EB1006 and ground. Measuring circuit: resistance between terminal 5 on plug EB1006 and ground. Measuring circuit: resistance between terminal 6 on plug EB1006 and ground. **Standard value: ∞** 4 Measure the voltage between the harness terminal of BMS and ground. Measuring circuit: voltage between terminal 3 on plug EB1006 and ground. Measuring circuit: voltage between terminal 4 on plug EB1006 and ground. Measuring circuit: voltage between terminal 5 on plug EB1006 and ground. Measuring circuit: voltage between terminal 6 on plug EB1006 and ground. **Standard value: ≈ 0V** 5 Check whether the result is normal or not?
	NO → Repair or replace the faulted parts.
YES ↓	
Step 5	Test whether BMS is norm.
	1 Turn the ignition switch to OFF. 2 Disconnect and check the harness plug CH1000_1 of BMS. 3 Check and repair. • Corrosion(install new adapting piece or terminal-cleaning module and pin). • Pin damaged or bent-install new terminal/pin. • Fly out of pins-install new pins as needed. 4 Reconnect the BMS plug and all other previously disconnected plug. Make sure the pin is properly positioned and fixed. 5 Run the system and determine if the problem persists?

	YES ➞ Replace the BMS.
NO ↓	
At this point the system is functioning normally. The problem may be caused by module connections. Address the root cause of any connector or pin problems.	
Next Step ↓	
Diagnosis end.	